
					_		
	Time of	Named or at	Translater Bugli. Sen Transfering	Resulting Product	Topic Acts		
	ı		ï		ı		
	Ш		-	H	Н		
	Ш	I		ı	Н		
	II		ii	I	4	****	
	Ш				-		
	Ш	l	ı	ı	ı	-	
-	Ш	H	i	H	4		
	Ш						
	Ш	-	-	-	4	22100	
	Ш				4	-	
	Ш		ı		Н		
	Ш			ш	44	-	
	И	ľ	i	ı	ľ	-	
10.0	ı	-	90	-	-	Subsection in	
	Ш				н		
100.00	wer	_	91	ALC:		Subsect Tendor	Republic b delictions. No the and for the Perfection
	Ш						
	Ш						
					4	-	
-	ı		1	-			
-	I		i	ш	4		
	Ш	ı	-	-	-		and the second second
	ı		ì	1	ì		Top Pin resistant Top at technic attack the specific Top Pin resistant Top at technic appropriate party.
	П						Top Etc. services. Top at Earlies operationing et al
	_	_	-	_	-		Any also reasons from the particular special characteristic for
	ı		ì	1	ì		Any Pin removes Any articles represent characteristics.
	П						Any Pic retroise full and tenning special popularities
100.0	NAME	_	90	No.	-	NAME OF TAXABLE PARTY.	No. 25. returns for all times operations and
10.0	į				į	Marton	No. 20: Services has an earlier square (column ton). No. 20: Services has an earlier square (column ton).
10.0	į		W.	ě	í	NAME AND ADDRESS OF	And the second field of the second operation of
							No. Po. orange from the appropriate to
MAT.	200	H	101	-	Η-	teneraci	The several appropriate CEST (by the other se-
	Ē	f		Ē	Œ		
⋿							
10.0	w		90	-	Ė	NAME OF TAXABLE PARTY.	The second department of the second
10.7	100	_	90	-	=	NAME TO AN	The second department of the second
10.0	-	=	99	No.	_	NAMES OF TAXABLE PARTY.	The special displace and distribute account.
_	Е						And the second section is a second section of the second section of the second section is a second section of the sect
=	=	=	=	=	=		2011/09/06/15/20/09/09/09/09/09/09/09/09/09/09/09/09/09
Ε.	Ē	_	=	Ξ	Ξ	_	
_	=						
10.7	200	_	- 22	_	_	NAME OF STREET	Name and Address of the Owner, where the Owner, which is the Owner, whi
10.0	į				į	Marton	Marin party marine surper a 1/2 of Topic Copies (provide Marin party marine surper a 1/2 of Topic Copies (provide
10.0	ı		100	1	١	Separation of the last of the	Marin paris, mateliar services and W.S. Paris, etc. (p. co.) granular above as a con-
	_	_	-	_	-		Mark you within super a CVS Property or product
	ı	I		l	l		Mark you washer supply colored from the contract of the colored for the colore
	П				Н		The payment with the payment of the
	П			Н	ľ		Mark pely Miller School of The Property of Street, Mark pely Miller School of The Property on Street,
	_	_		_	-		Mark park melake kepan anti-PR frequency and produc- tion park melake kepan anti-PR frequency and produc-
10.0	ı		100	1	١	Separation of the last of the	Marin paris, mateliar services and W.S. Paris, etc. (p. co.) granular above as a con-
10.7	100		90	80		NAME AND ADDRESS OF THE PARTY O	National angular prints to the parties of the parti
10.0	100				į	Marton	Marin party marine surper a 1/2 of Topic Copies (provide Marin party marine surper a 1/2 of Topic Copies (provide
	П						Mark party mediate surprise and W.S. Party de Appell grander. White D. College.
	_	_	-	_	-		Mark you window supply to FVE To the street of the street
	Н	I		l	l		Mark you within some office frequency of the Mark States of the States o
	Н						Mark yell within being only to furnish product of the
100.70	7777		101	200		NAME TO AN	and the man miner of all principles in the
10.0	í				į	Marton	Marin party marine surper a 1/2 of Topic Copies (provide Marin party marine surper a 1/2 of Topic Copies (provide
10.0	1		100	1	١	Separation of the last of the	Marin paris, mateliar services and W.S. Paris, etc. (p. co.) granular above as a com-
	П			Н	Н		Marks party materials section of Party Torques Sparry process.
	_	_		_	-		Mark you washe supply of CVE Proportion at com-
	П						Mark yell miller below on 18 for except or product
	П			Н	Н		Mark you with the supple of the frequency of product
	_	_	-	_	-		Mark you within super colors for particular grounds.
10.0	Ŗ				į	Marton	Marin party marine surper a 1/2 of Topic Copies (provide Marin party marine surper a 1/2 of Topic Copies (provide
10.0	ı		100	1	١	NAME AND ADDRESS OF	
100.00				200			
							Mark you work some office for the second
	Н		_	Н	Н		Marie para melaku minjan ministra Propintagan distribution di dan sa mana di dan
	Ш			Ξ	-		
							Service parts and the service parts of the service
						Total Control	
						Married Marrie	200 CO
						Management of the Control of the Con	200 (100) 200 (100)
10 10 10 10 10 10 10 10 10 10 10 10 10 1						Market State	200 000 000 000 000 000 000 000 000 000
							200 mm
						Marcola Marcol	200 cm 20
			20 20 20 20 20 20 20 20 20 20 20 20 20 2			MONEY COME TO SERVICE AND SERV	
			20 20 20 20 20 20 20 20 20 20 20 20 20 2			DESCRIPTION OF THE PROPERTY OF	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1
10 0 10 0 10 0 10 0 10 0 10 0 10 0 10 0			20 20 20 20 20 20 20 20 20 20 20 20 20 2			SOURCE VALUE OF THE PROPERTY O	
			20 20 20 20 20 20 20 20 20 20 20 20 20 2			Additional	20 - 10 - 10 - 10 - 10 - 10 - 10 - 10 -
						AND COMPANY OF THE PROPERTY OF	### 100 mm 100 m
						AMERICANA AMERIC	
			22 22 22 22 22 22 22 22 22 22 22 22 22			ACREC VALUE  ACREC	
						ACCUPATION AND ACCUPATION ACCUPATION AND ACCUPATION	
33 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3						ACTION CARDS	
						AND TABLE TO SERVICE AND TABLE	
						AND COMMENTS OF THE PROPERTY O	
						2000 Table	
303 33 33 33 33 33 33 33 33 33 33 33 33							

	Date	Measured Liquid	Transducer Height	Base of Sump	Elevation of	Pump on during		
	Reading	Level Above	above Floor of	Elevation	Leachate	measurement?		
LCS Number	Collected	Transducer (Ft.)	Quarry (Ft.)	(Ft. MSL)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 2D	11/8/19	N/A	14.4	235.92	,	N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	11/15/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	11/29/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/6/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/13/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/20/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/27/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/3/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/10/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/17/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/24/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/31/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/7/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/14/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/21/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/28/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/6/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/13/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/20/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/27/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/3/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/10/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/16/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/23/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/30/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/7/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/14/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/21/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/28/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/4/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/11/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/18/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/25/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/2/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/9/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/16/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/23/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/31/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/7/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/14/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	8/21/20 8/28/20	N/A N/A	14.4 14.4	235.92 235.92		N N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
							Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	9/4/20 9/11/20	N/A N/A	14.4 14.4	235.92 235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	9/11/20	N/A N/A	14.4 14.4	235.92		N N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	9/18/20	N/A N/A	14.4 14.4	235.92		N N	Dedicated Transducer Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	10/1/20	N/A N/A	14.4 14.4	235.92		N N		PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	10/1/20	N/A N/A	14.4	235.92		N N	Dedicated Transducer Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	10/8/20	N/A N/A	14.4	235.92		N N	Dedicated Transducer  Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	10/15/20	N/A N/A	14.4	235.92		N N	Dedicated Transducer  Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	10/22/20	N/A N/A	14.4	235.92		N N	Dedicated Transducer  Dedicated Transducer	
	10/29/20	N/A N/A	14.4 14.4	235.92		N N	Dedicated Transducer  Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	11/5/20	IN/A	14.4	230.92		IN	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement


	Date	Measured Liquid	Transducer Depth	Well Total Depth from Top of	Elevation of	Pump on during		
LCS Number	Reading Collected	Level Below Ground Surface (ft)	from Top of Casing (Ft.)	Casing (Ft.) (Ft. MSL)	Leachate (Ft. MSL)	measurement? (Y/N)	Liquid level meter used	Comments
LCS-3D	11/8/19	51.0	N/A	140	(i t. MOL)	Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/15/19	52.0	N/A	140		Ϋ́	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/22/19	52.1	N/A	140		Ϋ́	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/27/19	51.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	12/6/19	52.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	12/13/19	51.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	12/20/19	52.0	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	12/27/19	51.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/3/20	49.9	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/10/20	49.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/17/20	46.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/24/20	41.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/31/20	41.2	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/7/20	43.6	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/14/20	47.4	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/21/20	48.6	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/28/20	48.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/6/20	49.9	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/13/20	47.3	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/20/20	62.1	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/27/20	50.7	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/3/20	45.9	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/10/20	49.7	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/16/20	52.2	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/23/20	51.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/1/20	55.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/7/20	50.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/14/20	54.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/21/20	40.8	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/28/20	50.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/4/20	50.8	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/11/20	54.8	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/19/20	52.5	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/26/20	52.8	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/2/20	60.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/9/20	60.4	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/17/20	61.1	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/23/20	60.5	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/31/20	60.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/7/20	59.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/14/20	51.2	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/21/20	59.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/28/20	48.2	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/4/20	52.1	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/11/20	50.3	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/18/20	58.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/25/20	59.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/1/20	59.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/8/20	48.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/15/20	57.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/22/20	57.3	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/5/20	62.5	N/A	140	ļ	Y	Heron Dipper T	Pump operational; liquid level measured manually

## LCS-3D Liquid Level Below Ground Surface

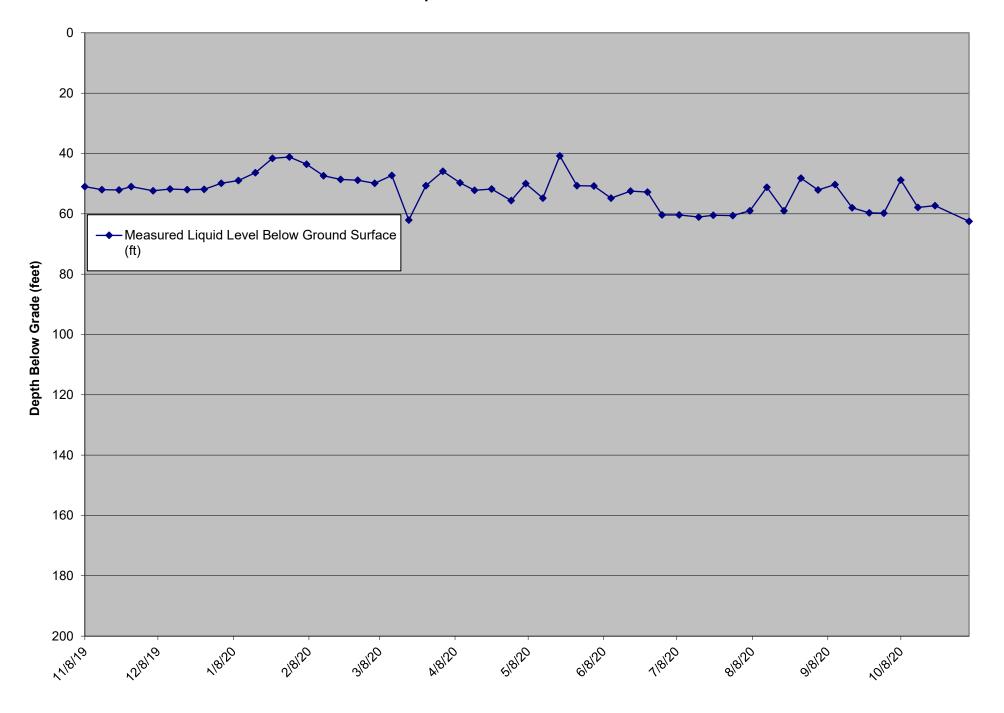


	Date	Measured Liquid	Transducer Depth	Base of Sump	Pump on during		
	Reading	Level Below Ground	from Top of Casing	Elevation	measurement?		
LCS Number	Collected	Surface (ft)	(Ft.)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 4B	11/8/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/15/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/22/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/29/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/6/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/13/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/20/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/27/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/3/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/10/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/17/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/24/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/31/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/7/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/14/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/21/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/28/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/6/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/13/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/20/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/27/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/3/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/10/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/16/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/23/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/30/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/7/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/14/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/21/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/28/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/4/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/11/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/18/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/26/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/2/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/9/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/16/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/23/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/31/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/7/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/14/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/21/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/28/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/4/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/11/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/18/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/25/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/1/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/8/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/15/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/22/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/29/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/5/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS

## LCS-4B Liquid Level Below Ground Surface

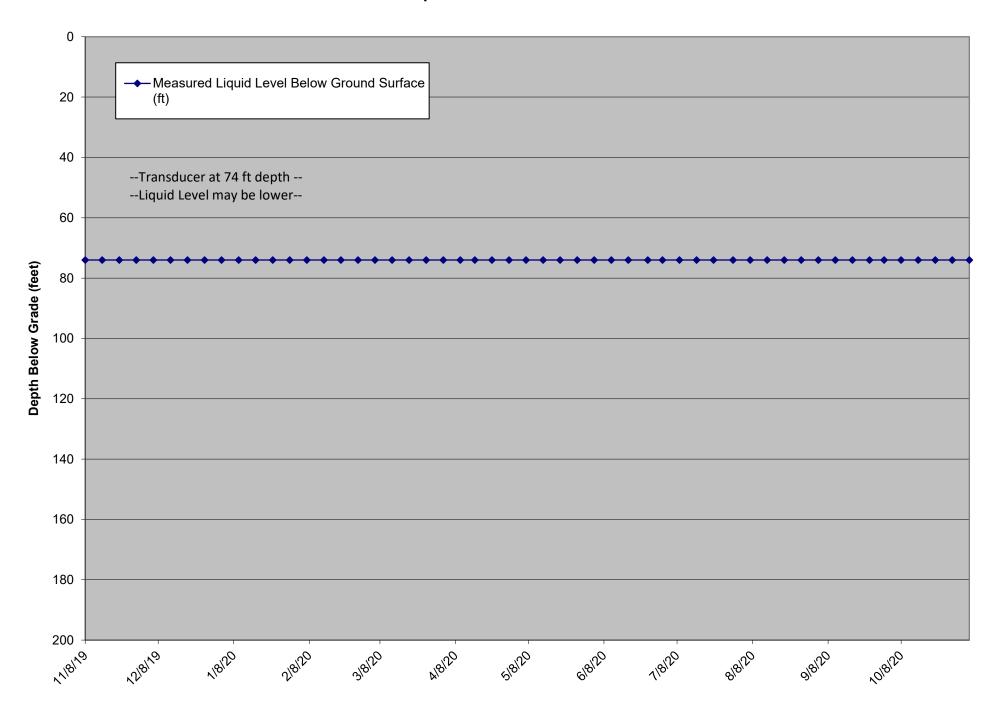

	Date	Measured Liquid	Transducer Height above Floor of Quarry	Base of Sump Elevation	Height of	Elevation of Leachate	Pump on during measurement?		
LCS Number	Reading Collected	Level Above Transducer (Ft.)	(Ft.)	(Ft. MSL)	Height of Liquid (ft )	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 5B	11/8/19		21.9	235.3		235.30	N	Dedicated Transducer	The transducer was observed to be non-operational on 11/6/19.  Transducer replacement is scheduled on 11/13/19.
									The transducer was observed to be non-operational on 11/6/19 and was replaced on 11/13/19. After transducer replacement, pump
									was replaced on 11/13/19. After transducer replacement, pump was non-operational due to suspected frozen forcemain section.
LCS- 5B	11/15/19		21.9	235.3		235.30	N	Dedicated Transducer	Troubleshooting will continue the week of 11/18/19.
100 FB	11/22/19	44.7	21.9	235.3	33.6	200 00	Y	Dadiested Terredove	The transducer was observed to be non-operational on 11/6/19 and was replaced on 11/13/19. After transducer replacement, pump was non-operational due to suspected frozen forcemain section.  The pump and motor were replaced on 11/19/19 and LCS-5B
	11/22/19	11.7 11.0	21.9	235.3	33.6	268.90 268.20	Y	Dedicated Transducer Dedicated Transducer	became fully operational.
LCS- 5B	12/6/19	12.4	21.9	235.3	34.3	269.60	Y	Dedicated Transducer	
LCS- 5B	12/13/19	12.0	21.9	235.3	33.9	269.20	Y	Dedicated Transducer	
LCS- 5B LCS- 5B	12/20/19 12/27/19	13.1 10.0	21.9 21.9	235.3 235.3	35.0 31.9	270.30 267.20	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	1/3/20	11.3	21.9	235.3	33.2	268.50	Ϋ́	Dedicated Transducer  Dedicated Transducer	
LCS- 5B	1/10/20	12.4	21.9	235.3	34.3	269.60	Y	Dedicated Transducer	
LCS- 5B	1/17/20	11.3	21.9	235.3	33.2	268.50	Y	Dedicated Transducer	
LCS- 5B LCS- 5B	1/24/20 1/31/20	13.0 11.7	21.9 21.9	235.3 235.3	34.9 33.6	270.20 268.90	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	2/7/20	12.6	21.9	235.3	34.5	269.80	Y	Dedicated Transducer	
LCS- 5B	2/14/20	12.3	21.9	235.3	34.2	269.50	Y	Dedicated Transducer	
LCS- 5B	2/21/20	11.3	21.9	235.3	33.2	268.50	Y	Dedicated Transducer	
LCS- 5B LCS- 5B	2/28/20 3/6/20	11.6 10.3	21.9 21.9	235.3 235.3	33.5 32.2	268.80 267.50	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	3/13/20	11.2	21.9	235.3	33.1	268.40	Y	Dedicated Transducer	
LCS- 5B	3/20/20	12.3	21.9	235.3	34.2	269.50	Y	Dedicated Transducer	
LCS- 5B	3/27/20	12.2	21.9 21.9	235.3	34.1	269.40 269.10	Y	Dedicated Transducer	
LCS- 5B LCS- 5B	4/3/20 4/9/20	11.9 10.9	21.9	235.3 235.3	33.8 32.8	268.10	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	4/16/20	11.3	21.9	235.3	33.2	268.50	Ϋ́	Dedicated Transducer	
LCS-5B	4/23/20	10.4	21.9	235.3	32.3	267.60	Y	Dedicated Transducer	
LCS- 5B LCS- 5B	4/30/20 5/7/20	11.7 10.1	21.9 21.9	235.3 235.3	33.6 32.0	268.90 267.30	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	5/14/20	12.0	21.9	235.3	33.9	269.20	Y	Dedicated Transducer  Dedicated Transducer	
LCS- 5B	5/21/20	11.7	21.9	235.3	33.6	268.90	Y	Dedicated Transducer	
LCS- 5B	5/28/20	11.2	21.9	235.3	33.1	268.40	Y	Dedicated Transducer	
LCS- 5B LCS- 5B	6/4/20 6/11/20	11.1 11.6	21.9 21.9	235.3 235.3	33.0 33.5	268.30 268.80	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	6/18/20	9.3	21.9	235.3	31.2	266.50	Ý	Dedicated Transducer	
LCS-5B	6/25/20	11.4	21.9	235.3	33.3	268.60	Y	Dedicated Transducer	
LCS- 5B	7/2/20	8.9	21.9	235.3	30.8	266.10	Y	Dedicated Transducer	
LCS- 5B LCS- 5B	7/9/20 7/16/20	10.0 8.3	21.9 21.9	235.3 235.3	31.9 30.2	267.20 265.50	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	7/23/20	12.4	21.9	235.3	34.3	269.60	Ϋ́	Dedicated Transducer	
LCS-5B	7/31/20	13.0	21.9	235.3	34.9	270.20	Y	Dedicated Transducer	
LCS- 5B	8/7/20	11.1	21.9	235.3	33.0	268.30	Y	Dedicated Transducer	
LCS- 5B LCS- 5B	8/14/20 8/21/20	14.0 14.1	21.9 21.9	235.3 235.3	35.9 36.0	271.20 271.30	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	8/28/20	13.1	21.9	235.3	35.0	270.30	Y	Dedicated Transducer	
LCS- 5B	9/4/20	82.1	21.9	235.3	104.0	339.30	N	Dedicated Transducer	The LCS-5B pump was turned off on 8/31/20 for forcemain repairs.  Forcemain repairs are anticipated to be completed the week of 9/7/20.
LOG- OD	3141ZU	UZ. I	6.12	200.0	104.0	JJ3.3U	iN	Dedicated Hallsducel	The LCS-5B pump was turned off on 8/31/20 for forcemain repairs
LCS- 5B	9/11/20	84.7	21.9	235.3	106.6	341.90	N	Dedicated Transducer	Forcemain repairs are anticipated to be completed the week of 9/7/20.
LCS- 5B	9/18/20	15.0	21.9	235.3	36.9	272.20	Y	Dedicated Transducer	The LCS-5B pump was replaced on 9/17/20 and was fully operational.
LCS- 5B	9/25/20	14.1	21.9	235.3	36.0	271.30	Y	Dedicated Transducer	The LCS-5B transducer was found to be non-operational on 9/21/20. The transducer was replaced on 9/24/20 and was fully operational.
LCS- 5B	10/1/20	13.9	21.9	235.3	35.8	271.10	Y	Dedicated Transducer	орогацопат.
LCS- 5B	10/8/20	14.0	21.9	235.3	35.9	271.20	Ý	Dedicated Transducer	
LCS- 5B	10/15/20	14.1	21.9	235.3	36.0	271.30	Y	Dedicated Transducer	
LCS- 5B LCS- 5B	10/22/20 10/29/20	14.8 14.2	21.9 21.9	235.3 235.3	36.7 36.1	272.00 271.40	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	11/5/20	14.1	21.9	235.3	36.0	271.30	Ý	Dedicated Transducer	


## LCS-5B Liquid Level Above Quarry Floor

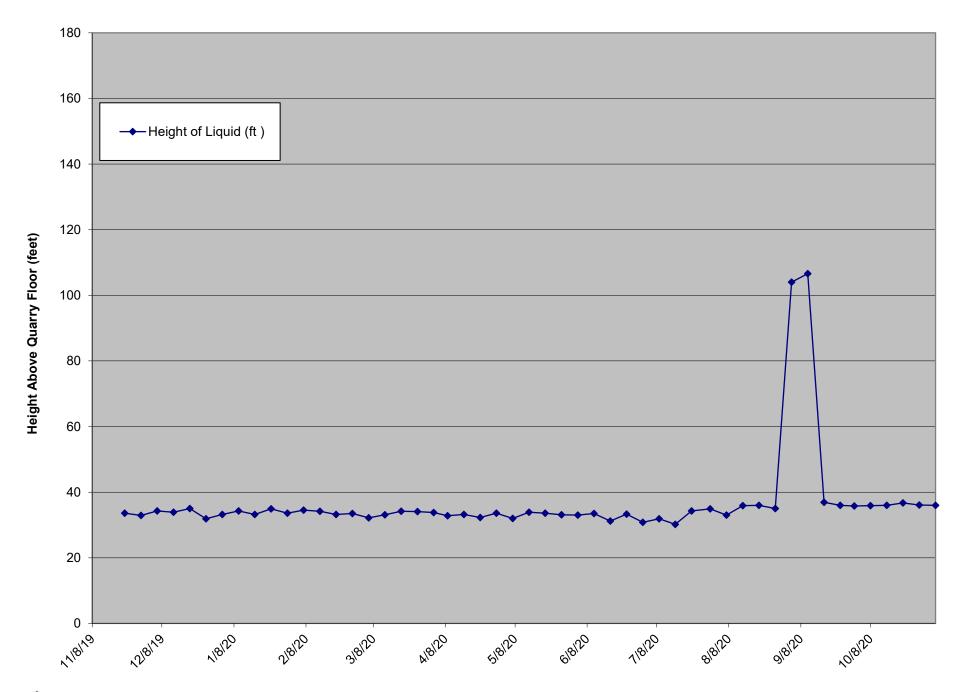

<sup>\*</sup>The transducer in LCS-5B was down from 11/6/19 to 11/19/19 The LCS-5B pump was turned off on 8/31/20 for forecmain repairs leading to an increase in liquid level. The pump was replaced on 9/17/20.

			T =			T =	r		
	Date		Transducer Height	Base of Sump	Halaba of	Elevation of	Pump on during		
	Reading		above Floor of	Elevation	Height of	Leachate	measurement?		
LCS Number	Collected	V	Quarry (Ft.)	(Ft. MSL)	Liquid (ft )	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 6B	11/8/19	9.9	9.4	429.52	19.3	448.82	Y	Dedicated Transducer	
LCS- 6B	11/15/19	9.5	9.4	429.52	18.9	448.42	Y	Dedicated Transducer	
LCS- 6B	11/22/19	9.8	9.4	429.52	19.2	448.72	Y	Dedicated Transducer	
LCS- 6B	11/29/19	8.9	9.4	429.52	18.3	447.82	Υ	Dedicated Transducer	
LCS- 6B	12/6/19	10.4	9.4	429.52	19.8	449.32	Υ	Dedicated Transducer	
LCS- 6B	12/13/19	10.2	9.4	429.52	19.6	449.12	Y	Dedicated Transducer	
LCS- 6B	12/20/19	9.1	9.4	429.52	18.5	448.02	Υ	Dedicated Transducer	
LCS- 6B	12/27/19	9.3	9.4	429.52	18.7	448.22	Υ	Dedicated Transducer	
LCS- 6B	1/3/20	10.1	9.4	429.52	19.5	449.02	Υ	Dedicated Transducer	
LCS- 6B	1/10/20	9.2	9.4	429.52	18.6	448.12	Υ	Dedicated Transducer	
									The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is
LCS- 6B	1/17/20		9.4	429.52			N	Dedicated Transducer	pending replacement parts arrival.
									The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is
LCS- 6B	1/24/20		9.4	429.52			N	Dedicated Transducer	pending replacement parts arrival.
									The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is
LCS- 6B	1/31/20		9.4	429.52			N	Dedicated Transducer	pending replacement parts arrival.
	.,,,,,								The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is
LCS- 6B	2/7/20		9.4	429.52			N	Dedicated Transducer	pending replacement parts arrival.
E00- 0B	211120		3.4	423.0Z			- 14	Dedicated Transducer	The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is
LCS- 6B	2/14/20		9.4	429.52			N	Dedicated Transducer	
LUS- 0D	2/ 14/20		9.4	429.02	<b>-</b>	1	IN	Dedicated Transducer	pending replacement parts arrival.  The LCS 6B transducer was observed to be non-perentianal an 1/13/20. Transducer replacement in
LCS- 6B	0/04/00	A1/A	A1/A	400.50	07.0	457.00		Di T	The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is pending replacement parts arrival. Liquid level was measured manually.
LCS- 6B	2/21/20	N/A	N/A	429.52	27.8	457.32	N	Heron Dipper T	penung repracement parts arrival, Liquid level was measured manually.
									T. 100.00
	1		l		l		l		The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is
LCS- 6B	2/28/20	N/A	N/A	429.52	28.3	457.82	N	Heron Dipper T	tentatively scheduled the week of 3/9/20. Liquid level was measured manually.
									The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is
LCS- 6B	3/6/20	N/A	N/A	429.52	28.0	457.52	N	Heron Dipper T	scheduled for 3/11/20. Liquid level was measured manually.
									The LCS-6B transducer was replaced on 3/11/20 and the pump became fully operational. The LCS-
									6B pump was observed to be non-operational on 3/12/20. The LCS-6B pump was replaced on
LCS- 6B	3/13/20	12.5	9.4	429.52	21.9	451.42	Y	Dedicated Transducer	3/13/20. LCS-6B became fully operational on 3/13/20.
LCS- 6B	3/20/20	12.3	9.4	429.52	21.7	451.22	Y	Dedicated Transducer	
LCS- 6B	3/27/20	11.9	9.4	429.52	21.3	450.82	Υ	Dedicated Transducer	
LCS- 6B	4/3/20	11.5	9.4	429.52	20.9	450.42	Ý	Dedicated Transducer	
LCS- 6B	4/10/20	12.0	9.4	429.52	21.4	450.92	Υ	Dedicated Transducer	
LCS- 6B	4/16/20	12.4	9.4	429.52	21.8	451.32	Ý	Dedicated Transducer	
200 05	1710/20	12.1	0.1	120.02	21.0	101.02	·	Dogradou Tranodados	<u> </u>
									The LCS-6B VFD was observed to be non-operational on 4/23/20. The VFD was replaced on 4/23/20 and LCS-6B became fully operational. A level sensor reading was not collected during the
LCS- 6B	4/23/20		9.4	429.52			Y	Dedicated Transducer	weekly reporting period due to VFD communication loss with the site's SCADA system.
LCS- 6B	4/30/20	8.9	9.4	429.52	18.3	447.82	Y	Dedicated Transducer	
LCS- 6B	5/7/20	9.0	9.4	429.52	18.4	447.92	Y	Dedicated Transducer	
LCS- 6B	5/14/20	13.3	9.4	429.52	22.7	452.22	Y	Dedicated Transducer	
LCS- 6B	5/21/20	13.3	9.4	429.52	22.7	452.22	Y	Dedicated Transducer	
LCS- 6B	5/28/20	7.8	9.4	429.52	17.2	446.72	Y	Dedicated Transducer	
LCS- 6B	6/4/20	8.9	9.4	429.52	18.3	447.82	Y	Dedicated Transducer	
LCS- 6B	6/11/20	7.9	9.4	429.52	17.3	446.82	Ý	Dedicated Transducer	
LCS- 6B	6/18/20	8.9	9.4	429.52	18.3	447.82	Ý	Dedicated Transducer	<u> </u>
LCS- 6B	6/25/20	8.7	9.4	429.52	18.1	447.62	Ý	Dedicated Transducer	†
LCS- 6B		9.2	9.4	429.52	18.6	448.12	Ÿ		
LCS- 6B	7/2/20 7/9/20	9.2	9.4	429.52 429.52	18.4	448.12	Y	Dedicated Transducer Dedicated Transducer	
							Y		
LCS- 6B	7/16/20	8.7	9.4	429.52	18.1	447.62	Y	Dedicated Transducer	
LCS- 6B	7/23/20	8.6	9.4	429.52	18.0	447.52		Dedicated Transducer	
LCS- 6B	7/31/20	8.6	9.4	429.52	18.0	447.52	Y	Dedicated Transducer	
LCS- 6B	8/7/20	8.4	9.4	429.52	17.8	447.32	Y	Dedicated Transducer	
LCS- 6B	8/14/20	8.7	9.4	429.52	18.1	447.62	Y	Dedicated Transducer	
LCS- 6B	8/21/20	7.2	9.4	429.52	16.6	446.12	Υ	Dedicated Transducer	
LCS- 6B	8/28/20	8.5	9.4	429.52	17.9	447.42	Υ	Dedicated Transducer	
LCS- 6B	9/4/20	15.5	9.4	429.52	24.9	454.42	N	Dedicated Transducer	The LCS-6B pump was turned off on 8/31/20 for forcemain repairs. Forcemain repairs are anticipated to be completed the week of 9/7/20.
									The LCS-6B pump was turned off on 8/31/20 for forcemain repairs. Forcemain repairs are
LCS- 6B	9/11/20	19.4	9.4	429.52	28.8	458.32	N	Dedicated Transducer	anticipated to be completed the week of 9/7/20.
LCS- 6B	9/18/20	20.1	9.4	429.52	29.5	459.02	N	Dedicated Transducer	The LCS-6B pump was turned off on 8/31/20 for forcemain repairs. Forcemain repairs were completed on 9/9/20. The pump in LCS-6B was non-operational when attempts were made to turn it back on after forcemain repairs. Pump repairs are tentatively scheduled for the week of 9/21/20.
LCS- 6B	9/25/20	N/A	N/A	429.52	24.1	453.62	N	Heron Dipper T	The LCS-6B pump was turned off on 8/31/20 for forcemain repairs. Forcemain repairs were completed on 9/9/20. The pump in LCS-6B was non-operational when attempts were made to turn back on after forcemain repairs. The ele
									The electric pump in LCS-6B was converted to a pneumatic pump on 9/30/20. Liquid level was
LCS- 6B	10/1/20	N/A	N/A	429.52	14.3	443.82	Y	Heron Dipper T	measured manually.
LCS- 6B	10/8/20	N/A	N/A	429.52	6.9	436.42	Υ	Heron Dipper T	
LCS- 6B	10/15/20	N/A	N/A	429.52	7.1	436.62	Y	Heron Dipper T	
LCS- 6B	10/22/20	N/A	N/A	429.52	7.5	437.02	Υ	Heron Dipper T	
LCS- 6B	10/29/20	N/A	N/A	429.52	8.0	437.52	Υ	Heron Dipper T	
LCS- 6B	11/5/20	N/A	N/A	429.52	5.3	434.82	Y	Heron Dipper T	

## LCS-6B Liquid Level Above Quarry Floor

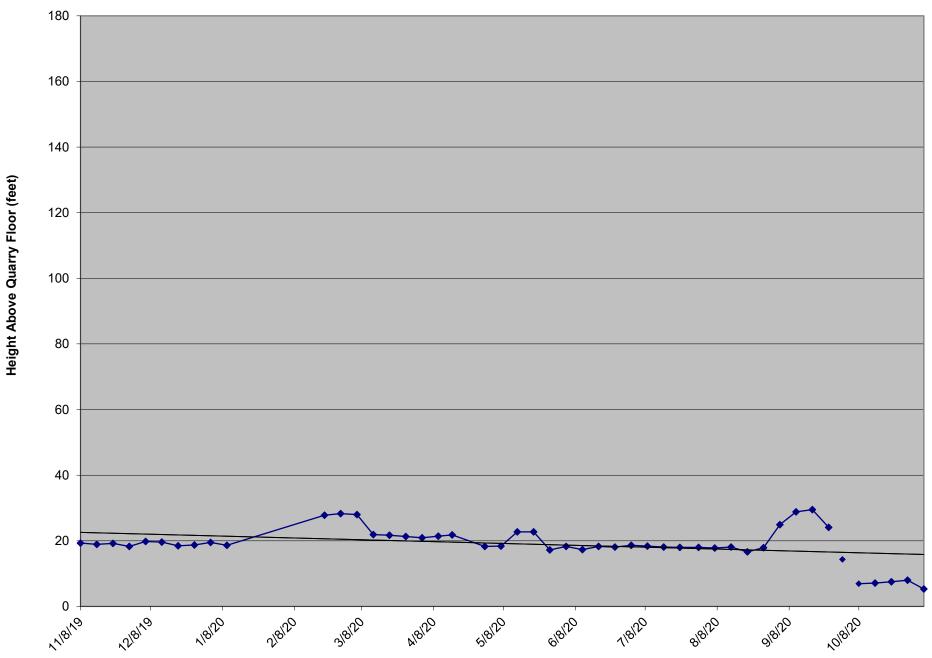

The transducer became non-operational on 1/13/20. Liquid level was measured manually on 2/21/20, 2/28/20 and 3/6/20. The transducer became operational on 3/13/20. The VFD was observed to be non-operational on 4/23/20, it was replaced on 4/23/20, however the level sensor reading was not taken due to VFD communication loss with SCADA. The LCS-6B pump was turned off on 8/31/20 for forcemain repairs leading to an increase in liquid level. The electric pump was converted to a pneumatic pump on 9/30/20.