
LCS-6B Liquid Level Above Quarry Floor

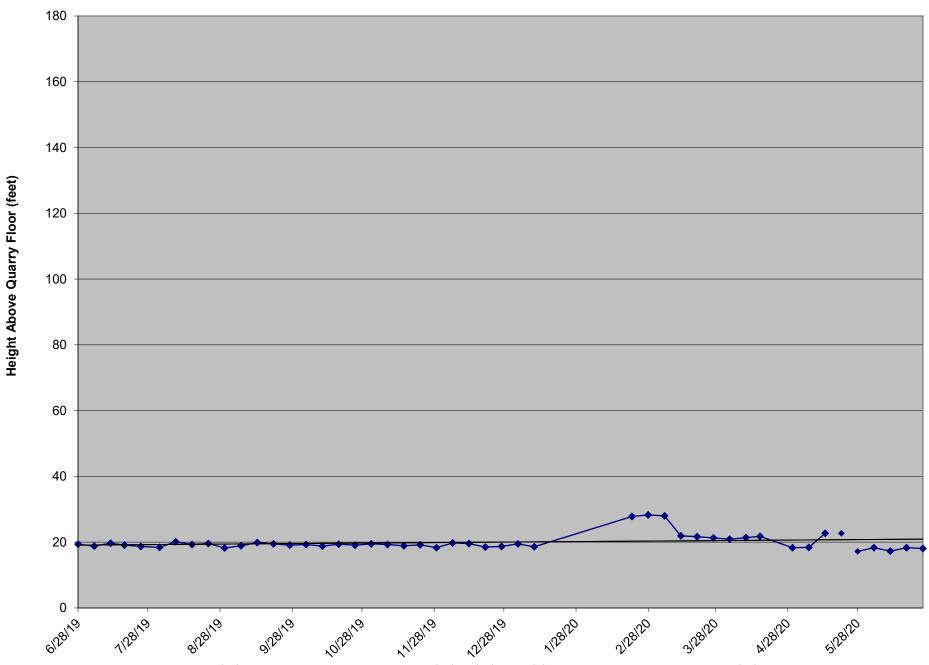


The transducer became non-operational on 1/13/20. Liquid level was measured manually on 2/21/20, 2/28/20 and 3/6/20. The transducer became operational on 3/13/20. The VFD was observed to be non-operational on 4/23/20, it was replaced on 4/23/20, however the level sensor reading was not taken due to VFD communication loss with SCADA.

_	_						
	and territ	Resonativo di Last Retradorisco di	Texas tigh hartestising	Base F berg Position	***************************************		
10.7	=				H	2000	
45.5	-			94	Н	NAME AND ADDRESS OF	
10.7	1		315	20	ł	NAME AND ADDRESS OF	
MA W	ij			ä	Ť	NAME AND ADDRESS OF	
	Ш			H	H		
				Н	Н		
10.7	=	ı			H	2000	
MA W	ı	1		ä	H	NAME AND ADDRESS OF	
100.0	100			200	ł	NAME AND ADDRESS OF	
100.00	E	- 11	-	81	Н	NAMES AND ADDRESS OF THE PARTY	
105.0	=		-	20	H	NAME AND ADDRESS OF THE PARTY O	
10.0	ı	-		1	ł	DOM: NO.	
-	I	ı	ı	H	H		
10.0	100		-	20	Ť	DESCRIPTION AND ADDRESS OF THE PARTY NAMED IN COLUMN TWO PARTY NAMED I	
MAN	¥		n	rea.	*	DESCRIPTION.	fagi dikan katarana kantarata bunke taphakan yan
-	Ξ				т		
10.7	I			-	۳	NAME AND ADDRESS OF	
MA W	H			ä	Ť	NAME AND ADDRESS OF	
105.0	=		-	20	H	NAME AND ADDRESS OF THE PARTY O	
10.7	-				H	2000	
===	=		-	Н	H		Ten etc. Selecte Source State of the Control of the
					Н		Applie televis for artists of the standard and
100.00	-		-	84		NAME OF TAXABLE PARTY.	
	-		-	1	ì		for the restored for extracting operations of the con-
				1	Н	*******	True Ph. selector from contractor special challenges and
	_		-	-	-		Perguille sections for activates special population and Perguille sections for activates special population and
US.W	w			-	ì	DESCRIPTION AND ADDRESS OF THE PARTY OF THE	Any after terminant they artifected in special proposed for their
	F						For the section for extended operations and the section for the section for the section of the s
			-	90	-	DESCRIPTION OF	Ang dia seriesa dapartenas aparat paparia san
ĿΞ	E	ΕĒ	ĿΞ	ΕĒ	ΕĒ		Any after restriction from an interest in operation to the force of the restriction from the restriction of the restriction for the second of the sec
	-		-	-	Ξ	NAME AND ADDRESS OF	Any spiriture has been destroyed the second
10.5	=		-	04	=	Mark Table	
100.00			-	000		ALC: UNIVERSAL SERVICE	
	E						
	-		-	-		NAME OF STREET	
	Ε.	_	_	-			
MAN	10			80	í	NAME AND ADDRESS OF	
100.00	_				Н	NAME AND ADDRESS OF THE PARTY O	Propression desperts approximate assessment than yet
100.00	_		-	ma	-	DOM: THOU	The property of the state of th
	=		ì	Н	Н		Mark you winter supposed on the August property of the
					Н		What had maken retires to and produced to the same
US W	-			80	1	NAME AND ADDRESS OF	Mark you within super which frequency and product and
	-		_	_	_		Mark york with the service of the first frequency of the same
	=		ł	ı	H		Mark you with the same of the free state of the
				ı	Н		Marty party materials and past and "FRE Angles Appendix and a state of the Control of the Contro
100.00			-	84		NAME AND ADDRESS OF	Mark you within super parties from the property and a star
			H	Н	Н		Mark you within hopes of TR Aspendigment and a few
MAN.	100			000	1	DESCRIPTION OF	When have another region of the property of the second of the
	-		-	_	-		Mark york minder separa and "PR Property and provide a file Mark york minder separa and "PR Property and provide a file
10.0	-			200	í	NAME AND ADDRESS OF	
					Н		their personal angles of PR Personal and State of
100.00	100			ma.	-	DESCRIPTION AND ADDRESS OF THE PARTY NAMED IN COLUMN TWO PARTY NAMED I	When had makes probes to part of the state of the state of the
	-		ì	l	l		Mark you within super out of Angele Confirming a feet Mark you within super out of Angele Confirming a feet and a feet out of the Angele Confirming of the Angele Confirming out of the Angele Confirming of the Angele Confirming out of the Angele Confirming out of the Angele Confirming out of the Angele Confirming out of the Angele Confirming out of the Angele Confirming out of the Angele Confirming out of Angele Confirming out of
NA.				200	í	NUMBER	Mark had made and experience by the section facilities when
				l	Н		their year within super-parties Property or property and
	=		-	-	-		White had proper probes to and a fundamental comment of the
	=		ì	Н	Н		Mark you within super with forest property and all
10.0	63			ma.	í	NAME AND ADDRESS OF	What had maken an international professional state and
				l	Н		their year within super-parties Property or property and
	-		_	_	_		Mark york Milder Stepes and PM Proportion of States and Mark Stepes States and PM Proportion of States and PM Prop
			ì		Н		Mark you with the super out of further special code and
NA.	=			-	ľ	DESCRIPTION AND ADDRESS OF THE PARTY NAMED IN COLUMN TWO PARTY NAMED I	Mark you works super out of frequency or growth of
100.00	-		-	84		NAME OF TAXABLE PARTY.	White had proper probes to any and the fundamental transfer to the
	-		_	_	_		Mark york with the service of the first frequency of the same
	=		-	-	Ė		
10.0	-		-	-	-	NAME AND ADDRESS OF	Mark you with a super-solve frequency or growth and
	Е	_	_	_	ᆣ	2000000	man park Milder Super-served Property and provider and
-	F		_	Ξ			
	=		-				
				ì	÷	NAME AND ADDRESS OF THE PARTY.	
	_					-	
-	Ξ			1111		Total Control	
100.00	Ξ					NAME OF TAXABLE PARTY.	
	-					Mariana Mariana Mariana Mariana	
	=					Marray Marray	
						MATERIAL STREET	
	-				***********	MONTH OF THE PARTY OF T	
						MATERIAL STATES	
						MARCOLLINA DE LA CONTRACTOR DE LA CONTRA	
						Marie Carlo	
						March 1	
10 10 10 10 10 10 10 10 10 10 10 10 10 1						MARKETON MAR	
10 A						MARKETON STATES	
						MARCONAL MAR	
100 M							
						DESCRIPTION OF THE PROPERTY OF	
100 M							
100 M							
333 333 333 333 333 333 333 333 333 33							
113 113 113 113 113 113 113 113 113 113							
133 133 133 133 133 133 133 133 133 133							
133 133 133 133 133 133 133 133 133 133							
100 100 100 100 100 100 100 100 100 100							

	Date	Measured Liquid	Transducer Height	Base of Sump	Elevation of	Pump on during		
l	Reading	Level Above	above Floor of	Elevation	Leachate	measurement?		
LCS Number	Collected	Transducer (Ft.)	Quarry (Ft.)	(Ft. MSL)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 2D	6/28/19	N/A	14.4	235.92	,	N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/5/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/12/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/18/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/25/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/2/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/9/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/16/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/23/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/30/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/6/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/13/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/20/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/27/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	10/4/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	10/11/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	10/18/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	10/25/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	11/1/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	11/8/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	11/15/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	11/29/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/6/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/13/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/20/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/27/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	1/3/20	N/A	14.4 14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
	1/10/20	N/A		235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	1/17/20 1/24/20	N/A N/A	14.4 14.4	235.92 235.92		N N	Dedicated Transducer Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/24/20	N/A N/A	14.4	235.92		N N	Dedicated Transducer Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/7/20	N/A N/A	14.4	235.92		N N	Dedicated Transducer Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/1/20	N/A N/A	14.4	235.92		N N	Dedicated Transducer Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/14/20	N/A	14.4	235.92		N N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/28/20	N/A	14.4	235.92		N	Dedicated Transducer Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/6/20	N/A	14.4	235.92		N	Dedicated Transducer Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/13/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/20/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/27/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/3/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/10/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/16/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/23/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/30/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/7/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/14/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/21/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/28/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/4/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/11/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/18/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/25/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement


				Well Total Depth				
	Date	Measured Liquid	Transducer Depth	from Top of	Elevation of	Pump on during		
	Reading	Level Below Ground	from Top of Casing	Casing (Ft.)	Leachate	measurement?		
LCS Number	Collected	Surface (ft)	(Ft.)	(Ft. MSL)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS-3D	6/28/19	39.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/5/19	39.8	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/12/19	36.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/18/19	36.5	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/25/19	37.1	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/2/19	37.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/9/19	34.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/16/19	34.2	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/23/19	34.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/30/19	32.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/6/19	32.1	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/13/19	32.5	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/20/19	35.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/27/19	37.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/4/19	42.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/11/19	43.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/18/19	44.5	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/25/19	48.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/1/19	49.5	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/8/19	51.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/15/19	52.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/22/19	52.1	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/27/19	51.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	12/6/19	52.4	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	12/13/19	51.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	12/20/19	52.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	12/27/19	51.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/3/20	49.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/10/20	49.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/17/20	46.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/24/20	41.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/31/20	41.2	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/7/20	43.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/14/20	47.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/21/20	48.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/28/20	48.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/6/20	49.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/13/20	47.3	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/20/20	62.1	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/27/20	50.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/3/20	45.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/10/20	49.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/16/20	52.2	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/23/20	51.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/1/20	55.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/7/20	50.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D LCS-3D	5/14/20	54.8	N/A	140 140		Y	Heron Dipper T	Pump operational; liquid level measured manually
	5/21/20	40.8	N/A	140 140			Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/28/20	50.7	N/A			Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/4/20	50.8	N/A	140			Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/11/20	54.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/19/20	52.5	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/26/20	52.8	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually

LCS-3D Liquid Level Below Ground Surface

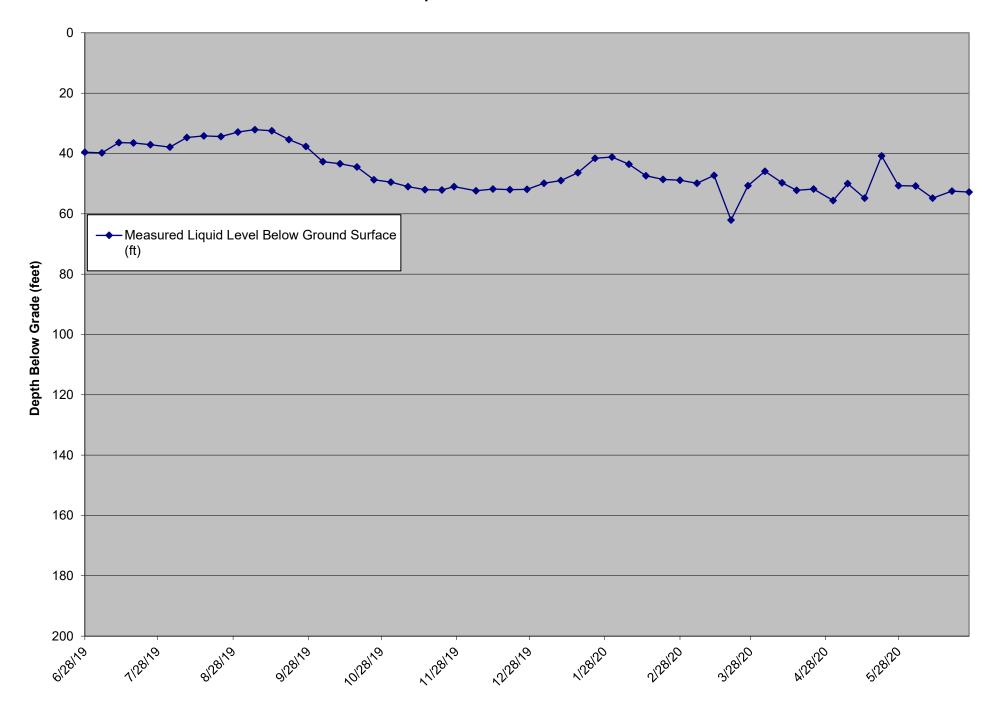


	Date	Measured Liquid	Transducer Depth	Base of Sump	Pump on during		
	Reading	Level Below Ground	from Top of Casing	Elevation	measurement?		
LCS Number	Collected	Surface (ft)	(Ft.)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 4B	6/28/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/5/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/12/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/18/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/25/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/2/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/9/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/16/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/23/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/30/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/6/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/13/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/20/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/27/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/4/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/11/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/18/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/25/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/1/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/8/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/15/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/22/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/29/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/6/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/13/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/20/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/27/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/3/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/10/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/17/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/24/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/31/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/7/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/14/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/21/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/28/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/6/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/13/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/20/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/27/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/3/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/10/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/16/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/23/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/30/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/7/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/14/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/21/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/28/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/4/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/11/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/18/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/26/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS

LCS-4B Liquid Level Below Ground Surface

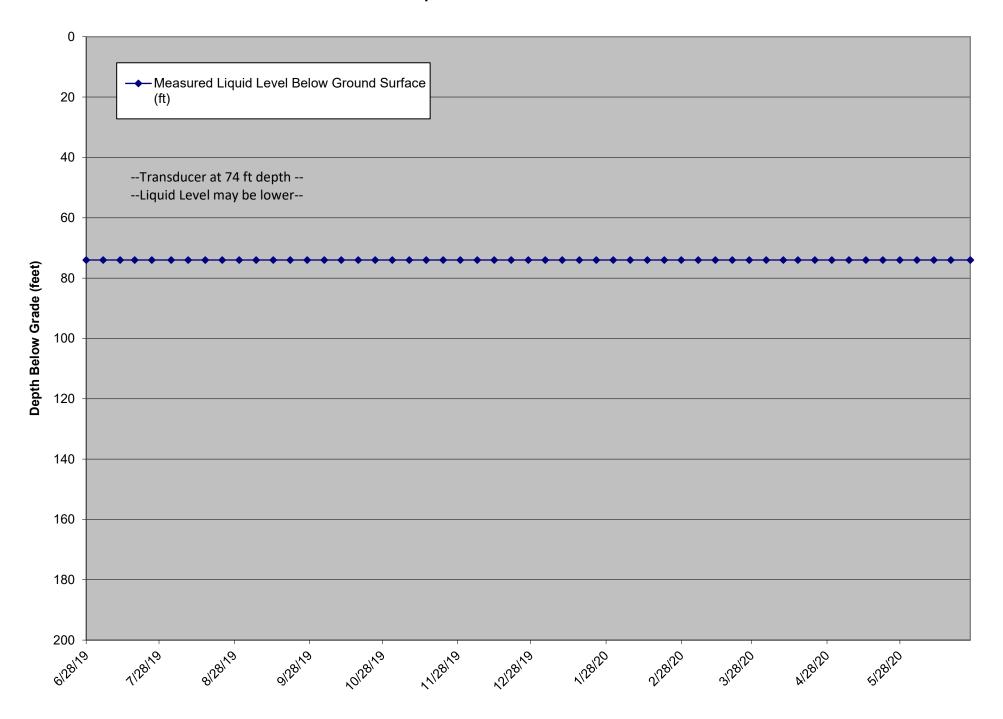

	Date Reading	Measured Liquid Level Above	Transducer Height	Base of Sump		Elevation of	Pump on during		
	Reading			Elevation	Height of	Leachate	measurement?		
LOG Mullibel	Collected	Transducer (Ft.)	above Floor of Quarry (Ft.)	(Ft. MSL)	Liquid (ft)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 5B	6/28/19	13.2	21.9	235.3	35.1	270.40	(1/N) Y	Dedicated Transducer	Comments
LCS- 5B	7/5/19	12.2	21.9	235.3	34.1	269.40	Ϋ́	Dedicated Transducer	
LCS- 5B	7/12/19	13.4	21.9	235.3	35.3	270.60	Ϋ́	Dedicated Transducer	
LCS- 5B	7/18/19	11.6	21.9	235.3	33.5	268.80	Υ	Dedicated Transducer	
LCS- 5B	7/25/19	12.8	21.9	235.3	34.7	270.00	Υ	Dedicated Transducer	
LCS- 5B	8/2/19	13.5	21.9	235.3	35.4	270.70	Υ	Dedicated Transducer	
LCS- 5B	8/9/19	11.3	21.9	235.3	33.2	268.50	Y	Dedicated Transducer	
LCS- 5B	8/16/19	12.6	21.9	235.3	34.5	269.80	Y	Dedicated Transducer	
LCS- 5B	8/23/19	12.5	21.9	235.3	34.4	269.70	Υ	Dedicated Transducer	
LCS- 5B	8/30/19	12.3	21.9	235.3	34.2	269.50	Y	Dedicated Transducer	
LCS- 5B	9/6/19	11.1	21.9	235.3	33.0	268.30	Υ	Dedicated Transducer	
LCS- 5B	9/13/19	12.6	21.9	235.3	34.5	269.80	Y	Dedicated Transducer	
LCS- 5B	9/20/19	12.8	21.9	235.3	34.7	270.00	Y	Dedicated Transducer	
LCS- 5B	9/27/19	13.0	21.9	235.3	34.9	270.20	Y	Dedicated Transducer	
LCS- 5B	10/4/19	12.2	21.9	235.3	34.1	269.40	Y	Dedicated Transducer	
	10/11/19	13.3	21.9	235.3	35.2	270.50	Y	Dedicated Transducer	
	10/18/19	11.5	21.9	235.3	33.4	268.70	Y	Dedicated Transducer	
LCS- 5B LCS- 5B	10/25/19 11/1/19	12.7 12.3	21.9 21.9	235.3 235.3	34.6 34.2	269.90 269.50	Y	Dedicated Transducer Dedicated Transducer	
FC9- 2R	11/1/19	12.3	∠1.9	∠ა5.3	34.2	∠09.50	ſ	Dedicated Fransducer	
LCS- 5B	11/8/19		21.9	235.3		235.30	N	Dedicated Transducer	The transducer was observed to be non-operational on 11/6/19. Transducer replacement is scheduled on 11/13/19.
LCS- 5B	11/15/19		21.9	235.3		235.30	N	Dedicated Transducer	The transducer was observed to be non-operational on 11/6/19 and was replaced on 11/13/19. After transducer replacement, pump was non-operational due to suspected frozen forcemain section. Troubleshooting will continue the week of 11/18/19.
									The transducer was observed to be non-operational on 11/6/19 and was replaced on 11/13/19. After transducer replacement, pump was non-operational due to suspected frozen forcemain section. The pump and motor were replaced on 11/19/19 and LCS
	11/22/19	11.7	21.9	235.3	33.6	268.90	Y	Dedicated Transducer	5B became fully operational.
	11/29/19	11.0	21.9	235.3	32.9	268.20	Y	Dedicated Transducer	
LCS- 5B	12/6/19	12.4	21.9	235.3	34.3	269.60	Y	Dedicated Transducer	
	12/13/19	12.0	21.9	235.3	33.9	269.20	Y	Dedicated Transducer	
	12/20/19 12/27/19	13.1 10.0	21.9 21.9	235.3 235.3	35.0 31.9	270.30 267.20	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	1/3/20	11.3	21.9	235.3	33.2	268.50	Y		
LCS- 5B	1/3/20	11.3	21.9	235.3	34.3	269.60	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	1/17/20	11.3	21.9	235.3	33.2	268.50	Y	Dedicated Transducer	
LCS- 5B	1/24/20	13.0	21.9	235.3	34.9	270.20	Y	Dedicated Transducer	
LCS- 5B	1/31/20	11.7	21.9	235.3	33.6	268.90	Y	Dedicated Transducer	
LCS- 5B	2/7/20	12.6	21.9	235.3	34.5	269.80	Y	Dedicated Transducer	
LCS- 5B	2/14/20	12.3	21.9	235.3	34.2	269.50	Υ	Dedicated Transducer	
LCS- 5B	2/21/20	11.3	21.9	235.3	33.2	268.50	Y	Dedicated Transducer	
LCS- 5B	2/28/20	11.6	21.9	235.3	33.5	268.80	Υ	Dedicated Transducer	
LCS- 5B	3/6/20	10.3	21.9	235.3	32.2	267.50	Υ	Dedicated Transducer	
LCS- 5B	3/13/20	11.2	21.9	235.3	33.1	268.40	Y	Dedicated Transducer	
LCS- 5B	3/20/20	12.3	21.9	235.3	34.2	269.50	Y	Dedicated Transducer	
LCS- 5B	3/27/20	12.2	21.9	235.3	34.1	269.40	Y	Dedicated Transducer	
LCS- 5B	4/3/20	11.9	21.9	235.3	33.8	269.10	Y	Dedicated Transducer	
LCS- 5B	4/9/20	10.9	21.9	235.3	32.8	268.10	Y	Dedicated Transducer	
LCS- 5B	4/16/20	11.3	21.9	235.3	33.2	268.50	Y	Dedicated Transducer	
LCS- 5B	4/23/20	10.4 11.7	21.9	235.3 235.3	32.3	267.60	Y	Dedicated Transducer	
LCS- 5B LCS- 5B	4/30/20 5/7/20	11.7	21.9 21.9	235.3	33.6 32.0	268.90 267.30	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	5/1/20	12.0	21.9	235.3	32.0	267.30	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	5/14/20	11.7	21.9	235.3	33.6	268.90	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	5/28/20	11.2	21.9	235.3	33.1	268.40	Y	Dedicated Transducer Dedicated Transducer	
		11.1	21.9	235.3	33.0	268.30	Y	Dedicated Transducer	
	6/4/20								
LCS- 5B LCS- 5B	6/4/20 6/11/20	11.6	21.9		33.5	268.80	Υ	Dedicated Transducer	
LCS- 5B				235.3 235.3	33.5 31.2	268.80 266.50	Y	Dedicated Transducer Dedicated Transducer	

LCS-5B Liquid Level Above Quarry Floor

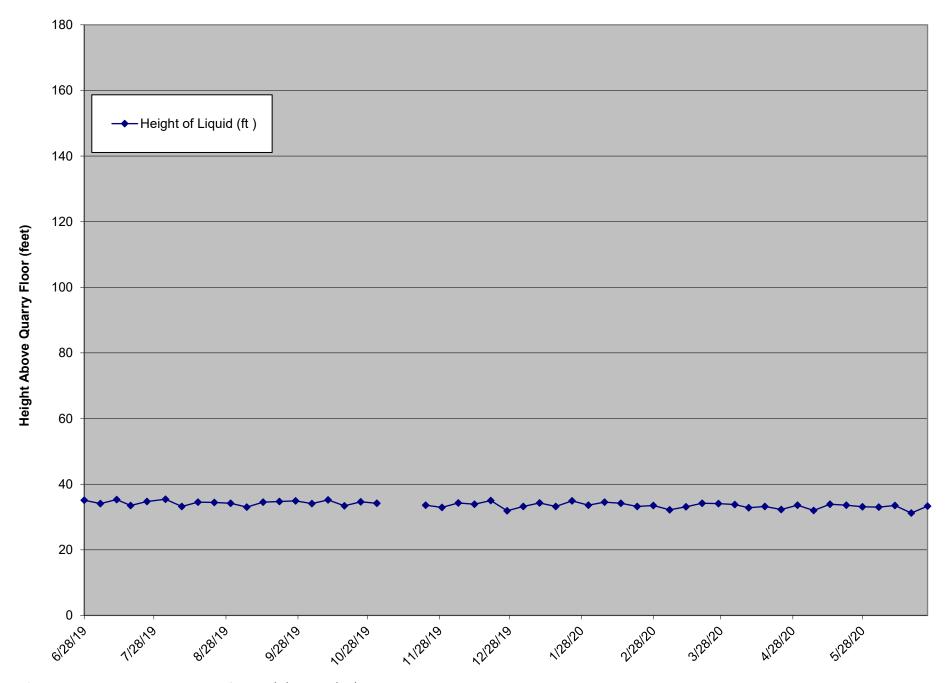

^{*}The transducer in LCS-5B was down from 11/6/19 to 11/19/19.

	Date		Transducer Height	Base of Sump		Elevation of	Pump on during		
	Reading		above Floor of	Elevation	Height of	Leachate	measurement?		
LCS Number	Collected	V	Quarry (Ft.)	(Ft. MSL)	Liquid (ft)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 6B	6/28/19	10.0	9.4	429.52	19.4	448.92	Υ	Dedicated Transducer	
LCS- 6B	7/5/19	9.4	9.4	429.52	18.8	448.32	Υ	Dedicated Transducer	
LCS- 6B	7/12/19	10.3	9.4	429.52	19.7	449.22	Y	Dedicated Transducer	
LCS- 6B	7/18/19	9.7	9.4	429.52	19.1	448.62	Y	Dedicated Transducer	
LCS- 6B LCS- 6B	7/25/19 8/2/19	9.3	9.4 9.4	429.52 429.52	18.7 18.4	448.22 447.92	Υ Υ	Dedicated Transducer Dedicated Transducer	
LCS- 6B	8/9/19	10.7	9.4	429.52	20.1	449.62	Y	Dedicated Transducer	
LCS- 6B	8/16/19	9.9	9.4	429.52	19.3	448.82	Y	Dedicated Transducer	
LCS- 6B	8/23/19	10.2	9.4	429.52	19.6	449.12	Y	Dedicated Transducer	
LCS- 6B	8/30/19	8.8	9.4	429.52	18.2	447.72	Υ	Dedicated Transducer	
LCS- 6B	9/6/19	9.5	9.4	429.52	18.9	448.42	Υ	Dedicated Transducer	
LCS- 6B	9/13/19	10.5	9.4	429.52	19.9	449.42	Υ	Dedicated Transducer	
LCS- 6B	9/20/19	10.1	9.4	429.52	19.5	449.02	Y	Dedicated Transducer	
LCS- 6B	9/27/19	9.7	9.4	429.52	19.1	448.62	Y	Dedicated Transducer	
LCS- 6B	10/4/19 10/11/19	9.9 9.4	9.4 9.4	429.52 429.52	19.3 18.8	448.82 448.32	Y	Dedicated Transducer	
LCS- 6B LCS- 6B	10/11/19	10.0	9.4	429.52 429.52	18.8	448.32 448.92	Y	Dedicated Transducer Dedicated Transducer	
LCS- 6B	10/16/19	9.7	9.4	429.52	19.4	448.62	Y	Dedicated Transducer	
LCS- 6B	11/1/19	10.1	9.4	429.52	19.5	449.02	Y	Dedicated Transducer	
LCS- 6B	11/8/19	9.9	9.4	429.52	19.3	448.82	Y	Dedicated Transducer	
LCS- 6B	11/15/19	9.5	9.4	429.52	18.9	448.42	Y	Dedicated Transducer	
LCS- 6B	11/22/19	9.8	9.4	429.52	19.2	448.72	Y	Dedicated Transducer	
LCS- 6B	11/29/19	8.9	9.4	429.52	18.3	447.82	Υ	Dedicated Transducer	
LCS- 6B	12/6/19	10.4	9.4	429.52	19.8	449.32	Υ	Dedicated Transducer	
LCS- 6B	12/13/19	10.2	9.4	429.52	19.6	449.12	Y	Dedicated Transducer	
LCS- 6B	12/20/19	9.1	9.4	429.52	18.5	448.02	Y	Dedicated Transducer	
LCS- 6B	12/27/19	9.3	9.4	429.52	18.7	448.22	Y	Dedicated Transducer	
LCS- 6B LCS- 6B	1/3/20 1/10/20	10.1 9.2	9.4 9.4	429.52 429.52	19.5 18.6	449.02 448.12	Y	Dedicated Transducer Dedicated Transducer	
LC3- 0B	1/10/20	9.2	9.4	429.02	10.0	440.12	Т	Dedicated Transducer	The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement
LCS- 6B	1/17/20		9.4	429.52			N	Dedicated Transducer	is pending replacement parts arrival.
LCS- 6B	1/24/20		9.4	429.52			N	Dedicated Transducer	The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is pending replacement parts arrival.
LC3- 0B	1/24/20		9.4	429.02			IN	Dedicated Transducer	The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement
LCS- 6B	1/31/20		9.4	429.52			N	Dedicated Transducer	is pending replacement parts arrival.
E00-0B	1701720		0.4	420.02				Dedicated Transducer	The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement
LCS- 6B	2/7/20		9.4	429.52			N	Dedicated Transducer	is pending replacement parts arrival.
									The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement
LCS- 6B	2/14/20		9.4	429.52			N	Dedicated Transducer	is pending replacement parts arrival.
									The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement
LCS- 6B	2/21/20	N/A	N/A	429.52	27.8	457.32	N	Heron Dipper T	is pending replacement parts arrival. Liquid level was measured manually.
									The LOO OF the state of the Lorentz to the Lorentz to the AMOUNT To the Lorentz t
LCS- 6B	2/28/20	N/A	N/A	429.52	28.3	457.82	N	Heron Dipper T	The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is tentatively scheduled the week of 3/9/20. Liquid level was measured manually.
LC3- 0B	2/20/20	IN/A	IN/A	429.02	20.3	457.02	IN	петоп Біррег і	The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement
LCS- 6B	3/6/20	N/A	N/A	429.52	28.0	457.52	N	Heron Dipper T	is scheduled for 3/11/20. Liquid level was measured manually.
200 02	3,3,23		147.	120.02	20.0	101.02	.,	, local Dippor 1	The LCS-6B transducer was replaced on 3/11/20 and the pump became fully operational. The
									LCS-6B pump was observed to be non-operational on 3/12/20. The LCS-6B pump was replaced
LCS- 6B	3/13/20	12.5	9.4	429.52	21.9	451.42	Υ	Dedicated Transducer	on 3/13/20. LCS-6B became fully operational on 3/13/20.
LCS- 6B	3/20/20	12.3	9.4	429.52	21.7	451.22	Y	Dedicated Transducer	
LCS- 6B	3/27/20	11.9	9.4	429.52	21.3	450.82	Y	Dedicated Transducer	
LCS- 6B	4/3/20	11.5	9.4	429.52	20.9	450.42	Y	Dedicated Transducer	
LCS- 6B LCS- 6B	4/10/20 4/16/20	12.0 12.4	9.4 9.4	429.52 429.52	21.4 21.8	450.92 451.32	Y	Dedicated Transducer	
LCS- 6B	4/16/20	12.4	9.4	429.52	21.8	451.32	Y	Dedicated Transducer	
						Ì			The LCS-6B VFD was observed to be non-operational on 4/23/20. The VFD was replaced on
									4/23/20 and LCS-6B became fully operational. A level sensor reading was not collected during the
LCS- 6B	4/23/20		9.4	429.52			Υ	Dedicated Transducer	weekly reporting period due to VFD communication loss with the site's SCADA system.
LCS- 6B	4/30/20	8.9	9.4	429.52	18.3	447.82	Y	Dedicated Transducer	
LCS- 6B	5/7/20	9.0	9.4	429.52	18.4	447.92	Υ	Dedicated Transducer	
LCS- 6B	5/14/20	13.3	9.4	429.52	22.7	452.22	Y	Dedicated Transducer	
LCS- 6B	5/21/20	13.3	9.4	429.52	22.7	452.22	Y	Dedicated Transducer	
LCS- 6B	5/28/20	7.8	9.4	429.52	17.2	446.72	Y	Dedicated Transducer	
LCS- 6B	6/4/20	8.9	9.4	429.52	18.3	447.82	Y	Dedicated Transducer	
LCS- 6B LCS- 6B	6/11/20 6/18/20	7.9 8.9	9.4 9.4	429.52 429.52	17.3 18.3	446.82 447.82	Y	Dedicated Transducer Dedicated Transducer	
LCS- 6B	6/25/20	8.7	9.4	429.52	18.1	447.62	Y	Dedicated Transducer Dedicated Transducer	
E00-0B	0/20/20	0.1	0.4	720.02	10.1	771.02	'	Dealouted Transadtel	