



	Date	Measured Liquid	Transducer Height	Base of Sump	Elevation of	Pump on during		
LCS Number	Reading Collected	Level Above Transducer (Ft.)	above Floor of Quarry (Ft.)	Elevation (Ft. MSL)	Leachate (Ft. MSL)	measurement? (Y/N)	Liquid level meter used	Comments
LCS-2D	8/2/19	N/A	14.4	235.92		(T/N) N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/9/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/16/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/23/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/30/19	N/A N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/6/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/13/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/20/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/27/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	10/4/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	10/11/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	10/18/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	10/25/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	11/1/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	11/8/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	11/15/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	11/29/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/6/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/13/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/20/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/27/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/3/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/10/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/17/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/24/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/31/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/7/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/14/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/21/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/28/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/6/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/13/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/20/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/27/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/3/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/10/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/16/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/23/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/30/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/7/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/14/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/21/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/28/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/4/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/11/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/18/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/25/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/2/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/9/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/16/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/23/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/31/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement

				Mall Tatal Dauth				
	Date	Measured Liquid	Transducer Depth	Well Total Depth from Top of	Elevation of	Pump on during		
	Reading	Level Below Ground	from Top of Casing	Casing (Ft.)	Leachate	measurement?		
LCS Number	Collected	Surface (ft)	(Ft.)	(Ft. MSL)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS-3D	8/2/19	37.9	N/A	140	(Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/9/19	34.7	N/A	140		Ý	Heron Dipper T	Pump operational: liquid level measured manually
LCS-3D	8/16/19	34.2	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/23/19	34.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/30/19	32.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/6/19	32.1	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/13/19	32.5	N/A	140		Ý	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/20/19	35.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/27/19	37.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/4/19	42.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/11/19	43.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/18/19	44.5	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/18/19	44.5	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
						Y		
LCS-3D LCS-3D	11/1/19 11/8/19	49.5 51.0	N/A N/A	140 140		Y	Heron Dipper T	Pump operational; liquid level measured manually
						Y Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/15/19	52.0	N/A	140		Y Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/22/19	52.1	N/A	140			Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/27/19	51.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	12/6/19	52.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	12/13/19	51.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	12/20/19	52.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	12/27/19	51.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/3/20	49.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/10/20	49.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/17/20	46.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/24/20	41.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/31/20	41.2	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/7/20	43.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/14/20	47.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/21/20	48.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/28/20	48.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/6/20	49.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/13/20	47.3	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/20/20	62.1	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/27/20	50.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/3/20	45.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/10/20	49.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/16/20	52.2	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/23/20	51.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/1/20	55.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/7/20	50.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/14/20	54.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/21/20	40.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/28/20	50.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/4/20	50.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/11/20	54.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/19/20	52.5	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/26/20	52.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/2/20	60.4	N/A	140		Ŷ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/9/20	60.4	N/A	140		Ŷ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/17/20	61.1	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/23/20	60.5	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/31/20	60.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually

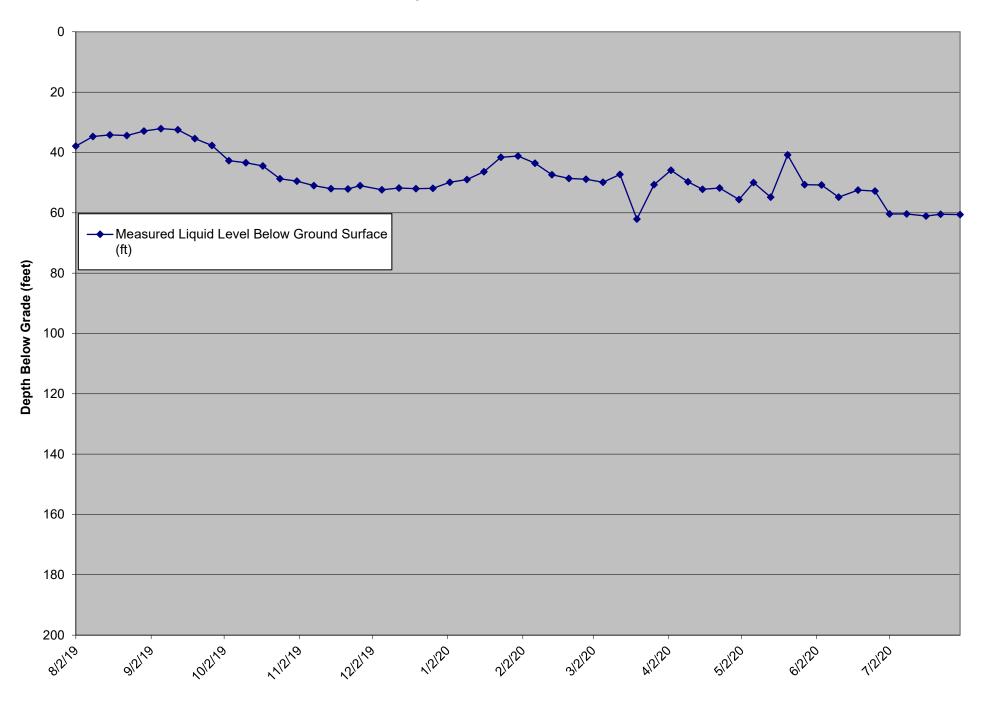


	Date	Measured Liquid	Transducer Depth	Base of Sump	Pump on during		
	Reading	Level Below Ground	from Top of Casing	Elevation	measurement?		
LCS Number	Collected	Surface (ft)	(Ft.)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 4B	8/2/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/9/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/16/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/23/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/30/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/6/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/13/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/20/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/27/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/4/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/11/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/18/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/25/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/1/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/8/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/15/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/22/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/29/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/6/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/13/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/20/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/27/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/3/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/10/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/17/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/24/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/31/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/7/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/14/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/21/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/28/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/6/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/13/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/20/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/27/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/3/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/10/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/16/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/23/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/30/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/7/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/14/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/21/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/28/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/4/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/11/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/18/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/26/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/2/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/9/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/16/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/23/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/31/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS

LCS-4B Liquid Level Below Ground Surface

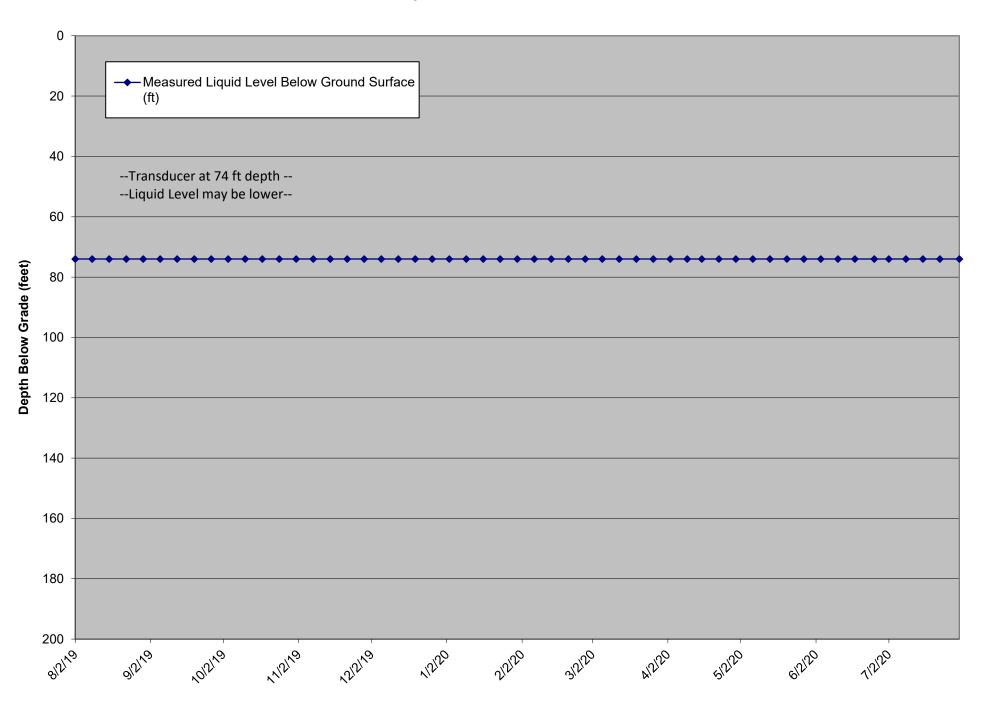

				-			-		
	Date	Measured Liquid	Transducer Height	Base of Sump		Elevation of	Pump on during		
	Reading	Level Above	above Floor of	Elevation	Height of	Leachate	measurement?		
LCS Number	Collected	Transducer (Ft.)	Quarry (Ft.)	(Ft. MSL)	Liquid (ft)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 5B	8/2/19	13.5	21.9	235.3	35.4	270.70	Y	Dedicated Transducer	
LCS- 5B	8/9/19	11.3	21.9	235.3	33.2	268.50	Y	Dedicated Transducer	
LCS- 5B	8/16/19	12.6	21.9	235.3	34.5	269.80	Y	Dedicated Transducer	
LCS- 5B	8/23/19	12.5	21.9	235.3	34.4	269.70	Y	Dedicated Transducer	
LCS- 5B	8/30/19	12.3	21.9	235.3	34.2	269.50	Y	Dedicated Transducer	
LCS- 5B	9/6/19	11.1	21.9	235.3	33.0	268.30	Ŷ	Dedicated Transducer	
LCS- 5B	9/13/19	12.6	21.9	235.3	34.5	269.80	Ý	Dedicated Transducer	
LCS- 5B	9/20/19	12.8	21.9	235.3	34.7	270.00	Ŷ	Dedicated Transducer	
LCS- 5B	9/27/19	13.0	21.9	235.3	34.9	270.20	Ŷ	Dedicated Transducer	
LCS- 5B	10/4/19	12.2	21.9	235.3	34.1	269.40	Ý	Dedicated Transducer	
LCS- 5B	10/11/19	13.3	21.9	235.3	35.2	270.50	Y	Dedicated Transducer	
LCS- 5B	10/18/19	11.5	21.9	235.3	33.4	268.70	Y	Dedicated Transducer	
LCS- 5B	10/25/19	12.7	21.9	235.3	34.6	269.90	Y	Dedicated Transducer	
LCS- 5B LCS- 5B	11/1/19	12.7	21.9	235.3	34.0	269.90	Y		
LCS- 5B	11/1/19	12.3	21.9	235.3	34.2	269.50	ř	Dedicated Transducer	
									T
									The transducer was observed to be non-operational on 11/6/19
LCS- 5B	11/8/19		21.9	235.3		235.30	N	Dedicated Transducer	Transducer replacement is scheduled on 11/13/19.
LCS- 5B	11/15/19		21.9	235.3		235.30	N	Dedicated Transducer	The transducer was observed to be non-operational on 11/6/19 and was replaced on 11/13/19. After transducer replacement, pump was non-operational due to suspected frozen forcemain section. Troubleshooting will continue the week of 11/18/19.
LCS- 5B	11/22/19	11.7	21.9	235.3	33.6	268.90	Y	Dedicated Transducer	The transducer was observed to be non-operational on 11/6/19 and was replaced on 11/13/19. After transducer replacement, pump was non-operational due to suspected frozen forcemain section. The pump and motor were replaced on 11/19/19 and LC 5B became fully operational.
LCS- 5B	11/29/19	11.0	21.9	235.3	32.9	268.20	Y	Dedicated Transducer	
LCS- 5B	12/6/19	12.4	21.9	235.3	34.3	269.60	Ŷ	Dedicated Transducer	
LCS- 5B	12/13/19	12.0	21.9	235.3	33.9	269.20	Ŷ	Dedicated Transducer	
LCS- 5B	12/20/19	13.1	21.9	235.3	35.0	270.30	Y	Dedicated Transducer	
LCS- 5B	12/27/19	10.0	21.9	235.3	31.9	267.20	Ý	Dedicated Transducer	
LCS- 5B	1/3/20	11.3	21.9	235.3	33.2	268.50	Ý	Dedicated Transducer	
LCS- 5B	1/10/20	12.4	21.9	235.3	34.3	269.60	Ý	Dedicated Transducer	
LCS- 5B	1/17/20	11.3	21.9	235.3	33.2	268.50	Y	Dedicated Transducer	
LCS- 5B	1/24/20	13.0	21.9	235.3	34.9	270.20	Y		
LCS- 5B	1/24/20	11.7	21.9	235.3	33.6	268.90	Y	Dedicated Transducer	
							Y Y	Dedicated Transducer	
LCS- 5B	2/7/20	12.6	21.9	235.3	34.5	269.80		Dedicated Transducer	
LCS- 5B	2/14/20	12.3	21.9	235.3	34.2	269.50	Y	Dedicated Transducer	
LCS- 5B	2/21/20	11.3	21.9	235.3	33.2	268.50	Y	Dedicated Transducer	
LCS- 5B	2/28/20	11.6	21.9	235.3	33.5	268.80	Y	Dedicated Transducer	
LCS- 5B	3/6/20	10.3	21.9	235.3	32.2	267.50	Y	Dedicated Transducer	
LCS- 5B	3/13/20	11.2	21.9	235.3	33.1	268.40	Y	Dedicated Transducer	
LCS- 5B	3/20/20	12.3	21.9	235.3	34.2	269.50	Y	Dedicated Transducer	
LCS- 5B	3/27/20	12.2	21.9	235.3	34.1	269.40	Y	Dedicated Transducer	
LCS- 5B	4/3/20	11.9	21.9	235.3	33.8	269.10	Y	Dedicated Transducer	
LCS- 5B	4/9/20	10.9	21.9	235.3	32.8	268.10	Y	Dedicated Transducer	
LCS- 5B	4/16/20	11.3	21.9	235.3	33.2	268.50	Y	Dedicated Transducer	
LCS- 5B	4/23/20	10.4	21.9	235.3	32.3	267.60	Y	Dedicated Transducer	
LCS- 5B	4/30/20	11.7	21.9	235.3	33.6	268.90	Y	Dedicated Transducer	
LCS- 5B	5/7/20	10.1	21.9	235.3	32.0	267.30	Ŷ	Dedicated Transducer	
LCS- 5B	5/14/20	12.0	21.9	235.3	33.9	269.20	Ý	Dedicated Transducer	
LCS- 5B	5/21/20	11.7	21.9	235.3	33.6	268.90	Y	Dedicated Transducer	
LCS- 5B	5/28/20	11.2	21.9	235.3	33.1	268.40	Y	Dedicated Transducer	
LCS- 5B	6/4/20	11.2	21.9	235.3	33.0	268.30	Y	Dedicated Transducer	
	6/4/20	11.1	21.9	235.3	33.0	268.30	Y Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B							ř Y		
LCS- 5B	6/18/20	9.3	21.9	235.3	31.2	266.50		Dedicated Transducer	
LCS- 5B	6/25/20	11.4	21.9	235.3	33.3	268.60	Y	Dedicated Transducer	
LCS-5B	7/2/20	8.9	21.9	235.3	30.8	266.10	Y	Dedicated Transducer	
LCS- 5B	7/9/20	10.0	21.9	235.3	31.9	267.20	Y	Dedicated Transducer	
	7/16/20	8.3	21.9	235.3	30.2	265.50	Y	Dedicated Transducer	
LCS- 5B			0/ -	007.7					
LCS- 5B LCS- 5B LCS- 5B	7/23/20 7/31/20	12.4 13.0	21.9 21.9	235.3 235.3	34.3 34.9	269.60 270.20	Y Y	Dedicated Transducer Dedicated Transducer	


LCS-5B Liquid Level Above Quarry Floor

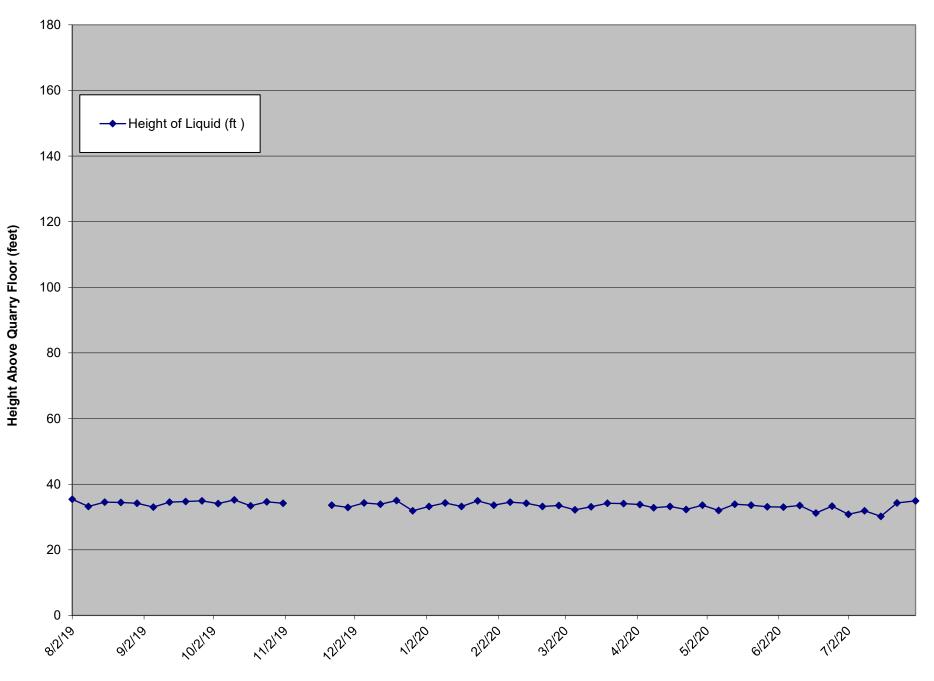

^{*}The transducer in LCS-5B was down from 11/6/19 to 11/19/19.

Los Martie Volume Description Project of Outwork (1) Description					D (0)					
L158 work v Gas (P)		Date		Transducer Height	Base of Sump	I I a last a de la de	Elevation of	Pump on during		
CDD 6279 8.8 9.4 4423 TV Decked Instance CDD 600 0.0 0.4 4292 10.4 4422 V Decked Instance CDD 0.00 0.1 4422 10.4 4422 V Decked Instance CDD 0.00 0.2 9.4 4292 10.4 4423 V Decked Instance CDD 0.00 0.2 9.4 4292 10.4 4477 V Decked Instance CDD 0.00 0.00 0.0 0.0 0.00 0.0 0.00 0.0	LCC Number									Commonte
L05.00 9717 0.07 6.4 4918 4019 7 Decision Transmission C15.00 9019 0.5 4.4 4919 1.0 44.0 V Decision Transmission C15.00 9019 0.5 4.4 4919 1.0 44.0 V Decision Transmission C15.00 9019 0.5 4.4 4919 1.0 44.0 V Decision Transmission C15.00 9019 0.5 4.4 4919 44.0 V Decision Transmission C15.00 90110 0.5 4.4 4919 44.0 V Decision Transmission C15.00 10110 0.4 4.4 4913 44.0 V Decision Transmission C15.00 10110 0.5 4.4 4913 V Decision Transmission C15.00 11110 0.5 4.4 4913 V Decision Transmission C15.00 11110 0.5 4.4 4913 V			-							Comments
Cho-See Print 6.9 6										
Co-Set PD370 PD2 PA 4400 PV Decided [Taskidor PV Decided [Taskidor PV <thdecided [taskidor<br="">PV</thdecided>										
LGE-88 BB/11 BB L4 42.0 18.7 44.77 V Declarating mattern V LGE-88 BB/11 BB L4 42.0 L4 42.0 V Declarating mattern V Declarating mattern V LGE-88 OP/11 L4 43.0 L8 44.07 V Declarating mattern V Declarating mattern V LGE-88 OP/11 L4 43.0 L8 44.07 V Declarating mattern V Declarating mattern LGE-88 OP/11 L4 43.0 L8 44.07 V Declarating mattern LGE-88 OP/11 L4 43.0 L4 44.03 V Declarating mattern LGE-88 OP/11 L4 44.03 L4 44.03 V Declarating mattern LGE-88 OP/11 L4 44.03 L4 V Declarating mattern LGE-88 OP/11 L4 44.03 L4 L4<0.0 V Declarating mattern LGE-88										
C35.88 9(1) 9.3 9.4 (42) 1.9 44.42 V Defined Transfer C45.88 9(3) 0.3 0.4 (42) 1.9 44.42 V Defined Transfer C45.88 9(3) 0.3 0.4 (42) 1.9 44.42 V Defined Transfer C45.88 9(3) 0.3 4.4 (43) 1.9 4.44.62 V Defined Transfer C45.88 9(0) 0.3 4.44 (43) V Defined Transfer C45.88 9(0) 0.3 4.4 (43) V Defined Transfer C45.88 9(0) 0.3 4.4 (43) 1.4 (44) V Defined Transfer C45.88 10(3) 0.4 (43) 1.8 4.43 V Defined Transfer C45.84 10(3) 0.4 (43) 1.8 4.44 V Defined Transfer C45.84 10(3) 0.4 (43) 1.8 4.44 </td <td></td>										
105.68 97370 173 94 4742 Y Designed Transform 105.68 96070 13 94 4252 133 4462 Y Designed Transform 105.68 19479 53 94 4252 133 4462 Y Designed Transform 105.68 19479 53 94 4252 133 4462 Y Designed Transform 105.68 19719 64 4252 133 4462 Y Designed Transform 105.68 19719 64 4252 135 4462 Y Designed Transform 105.68 19729 34 64 4252 135 4462 Y Designed Transform 105.68 19779 53 64 4252 165 4462 Y Designed Transform 105.68 19779 63 64 4252 165 4462 Y Designed Transform 105.68 19779 64 4252										
Clos Ba 96/07 10.1 94.4 4932 11.5 448.2 Y Decision Transform Clos Ba 90/07 5 5 4.4 4232 11.1 44.6 Y Decision Transform Clos Ba 90/07 5 6.4 4232 11.8 44.8 Y Decision Transform Clos Ba 90/07 10 9.4 4232 11.8 44.82 Y Decision Transform Clos Ba 90/07 10 9.4 4232 11.8 44.82 Y Decision Transform Clos Ba 10/07 10 9.4 4232 11.8 44.82 Y Decision Transform Clos Ba 10/07 10 9.4 4232 11.8 44.82 Y Decision Transform Clos Ba 10/07 10.4 4232 11.8 44.21 Y Decision Transform Clos Ba 10/07 10.4 4232 11.8 44.92 Y Decision Transform										
125.86 9270 6.7 9.4 4252 13. 444.2 Y Decision Transform 125.86 9070 5.7 9.4 4252 13. 444.2 Y Decision Transform 125.86 10070 7.0 0.4 445.3 18.4 444.32 Y Decision Transform 125.86 10070 0.4 445.3 18.4 444.32 Y Decision Transform 125.86 10070 0.4 445.2 18.3 444.2 Y Decision Transform 125.86 110700 0.5 8.4 425.2 18.2 445.2 Y Decision Transform 125.86 110700 0.4 425.2 18.2 445.2 Y Decision Transform 125.86 110700 0.4 425.2 18.5 441.2 Y Decision Transform 125.86 11070 6.4 425.2 Y Decision Transform The IC-28 Transform Transform 125.86 11070 6										
108-08 104/19 9.8 9.4 49.82 18.3 44.82 Y Decided Timabour 125-68 10/19 9.4 40.82 18.3 44.82 Y Decided Timabour 125-68 10/19 9.7 9.4 40.82 18.1 44.82 Y Decided Timabour 125-68 10/18 0.1 4.4 40.82 18.3 44.82 Y Decided Timabour 125-68 10/18 0.1 4.4 40.82 18.3 44.82 Y Decided Timabour 125-68 10/29 8.8 4.4 40.82 18.3 44.82 Y Decided Timabour 125-68 10/29 8.8 4.4 40.82 Y Decided Timabour 125-68 10/29 8.1 4.4 40.82 Y Decided Timabour 126-68 10/29 8.1 4.4 40.82 Y Decided Timabour 126-68 10/29 9.1 4.4 40.82 Y <td></td>										
C65-68 107819 116.0 5.4 4932 118.4 448.22 Y Decideal Transboar C65-68 102519 37 5.4 4032 113.1 448.22 Y Decideal Transboar C65-68 102519 37 5.4 4032 113.3 448.24 Y Decideal Transboar C65-68 117219 5.8 5.4 4032 113.4 448.24 Y Decideal Transboar C65-68 117219 5.8 5.4 4032 113.4 448.24 Y Decideal Transboar C65-68 10719 10.2 5.4 4032 114.4 449.22 Y Decideal Transboar C65-68 10739 10.1 5.4 4032 Y Decideal Transboar 116.1 116.2 116.2 116.2 116.2 116.2 116.2 116.2 116.2 116.2 116.2 116.2 116.2 116.2 116.2 116.2 117.2 Decideal Transboar 117.2 117.2 <td></td>										
LGS-68 10/2511 9.7 9.4 449.22 10.1 448.82 Y Decisional Transitional LGS-68 11/101 0.3 9.4 420.32 10.8 444.42 Y Decisional Transitional LGS-68 11/101 0.3 9.4 420.32 10.8 444.42 Y Decisional Transitional LGS-68 11/2017 0.8 9.4 420.32 10.8 444.72 Y Decisional Transitional LGS-68 11/2017 0.8 9.4 420.52 10.8 447.62 Y Decisional Transitional LGS-68 10/2017 0.1 6.4 420.52 10.8 440.62 Y Decisional Transitional LGS-68 10/2017 0.1 6.4 420.52 10.8 440.22 Y Decisional Transitional LGS-68 10/102 0.4 420.52 10.8 440.22 Y Decisional Transitional LGS-68 11/102 0.4 420.52 10.8 N										
LGS. 68 11/179 18/1 9.4 49.92 18/8 44.022 V Obcided Trendozer Decision Trendozer LGS. 68 11/2971 0.3 0.4 425.2 15.2 448.2 V Decision Trendozer LGS. 68 11/2971 0.3 0.4 425.2 15.3 448.2 V Decision Trendozer LGS. 68 12/2715 0.3 0.4 425.2 15.8 449.2 V Decision Trendozer LGS. 68 12/2715 0.3 0.4 425.2 15.8 440.22 V Decision Trendozer LGS. 68 12/2719 0.3 9.4 425.2 15.8 440.22 V Decision Trendozer LGS. 68 12/2719 0.3 9.4 425.2 15.8 440.22 V Decision Trendozer The LGS dB tranducer was descreted to an operational or 173/0. Tranducer rejoarner LGS. 68 12/262 9.4 429.52 N Decision Trendozer The LGS dB tranducer was descreted to an operational or 173/0. Tranducer rejoarner LGS. 68 12/420 9.4 429.52 N N Decision										
LCS-68 11979 99 94 449.22 103 448.82 Y Dedicate Transform LCS-68 111179 0.5 9.4 429.2 10 Dedicate Transform LCS-68 111179 0.5 9.4 429.2 Y Dedicate Transform LCS-68 102915 0.3 9.4 429.2 Y Dedicate Transform LCS-68 102915 0.3 9.4 429.2 Y Dedicate Transform LCS-68 102915 0.1 9.4 429.2 19.8 449.22 Y Dedicate Transform LCS-68 10300 0.1 9.4 429.2 18.8 449.22 Y Dedicate Transform LCS-68 10302 0.2 9.4 429.2 N Dedicate Transform The LCS-68 transform and any transform any transform any transform and any transform any transform any tra										
LGS 68 11/15/10 6.5 6.4 429 2 16.5 44.82 Y Decklast Transdoor LGS 68 11/210 6.3 4.4 429 2 10.3 443.72 Y Decklast Transdoor LGS 68 12/210 0.3 6.4 429 2 10.3 449.72 Y Decklast Transdoor LGS 68 12/210 0.3 6.4 429 2 10.3 449.12 Y Decklast Transdoor LGS 68 12/210 0.3 6.4 429 2 10.5 449.12 Y Decklast Transdoor LGS 68 10/20 0.4 429 2 10.5 449.12 Y Decklast Transdoor LGS 68 10/20 0.4 429 2 N Decklast Transdoor The LS 68 Irandoor we channed to incomparison on 10.3 The LS 68 Irandoor we channed to incomparison on 10.3 The LS 68 Irandoor we channed to incomparison on 10.3 The LS 68 Irandoor we channed to incomparison on 10.3 The LS 68 Irandoor we channed to incomparison on 10.3 The LS 68 Irandoor we channed to incomparison on 10.3 The LS 68 Irandoor we channed to incomparison on 10.3 The										
LGS-68 11/2010 8.8 9.4 4493 2 V Decideat Transduer LGS-68 11/2010 6.3 6.4 439 2 V Decideat Transduer LGS-68 12/2010 0.1 6.4 439 2 V Decideat Transduer LGS-68 12/2010 0.1 6.4 439 2 V Decideat Transduer LGS-68 12/2010 0.3 6.4 439 2 V Decideat Transduer LGS-68 12/2010 0.3 6.4 439 2 V Decideat Transduer LGS-68 11/200 0.4 429 2 Image: Transduer value of transduer value										
LGS-88 11/2010 8.8 9.4 4/29.2 18.3 4/7.22 Y Dedicate Transducer LGS-88 7/2017 0.4 4.4 4/29.2 18.3 4/49.2 Y Dedicate Transducer LGS-88 7/2017 0.3 0.4 4/29.2 18.3 4/49.2 Y Dedicate Transducer LGS-68 1/202 0.3 4.4 4/29.2 18.7 4/49.2 Y Dedicate Transducer LGS-68 1/202 0.4 4/29.2 18.8 4/49.2 Y Dedicate Transducer LGS-68 1/1020 0.4 4/29.2 18.8 4/49.2 Y Dedicate Transducer LGS-68 1/1020 0.4 4/29.2 18.8 Molecular Transducer The LGS-68 Transducer wes beared be non-operational on 1/30.0 Transducer regionment is perioding regionement part arrival LGS-68 1/1020 0.4 4/29.2 18.8 Molecular Transducer LGS-68 1/1020 0.4 4/29.2 17.8 N Dedicate Transducer <td></td>										
LGS-68 12919 10.4 9.4 443.2 Y Dedicated Transduor LGS-68 1/2019 0.1 9.4 423.2 18.3 448.2 Y Dedicated Transduor LGS-68 1/2019 0.1 9.4 423.2 18.3 448.2 Y Dedicated Transduor LGS-68 1/1020 9.1 9.4 423.2 18.3 448.2 Y Dedicated Transduor LGS-68 1/1020 9.4 423.2 18.3 448.12 Y Dedicated Transduor LGS-68 1/1720 9.4 423.2 18.5 448.12 Y Dedicated Transduor LGS-68 1/1720 9.4 423.52 L N Dedicated Transduor The LGS-68 transduor was obseved to be non-operational or 11/320. Transduor replacement is a bree operational or 11/320. Transduor replacement is a bree operatere operational or 11/320. Transduor replacement is a										
LCS-66 12/319 10.2 9.4 429.52 19.8 448.02 Y Dedicated Transduer LCS-68 12/2019 9.1 9.4 429.52 18.7 448.62 Y Dedicated Transduer LCS-68 12/2019 9.3 9.4 429.52 18.7 448.62 Y Dedicated Transduer LCS-68 10/000 9.2 9.4 429.52 18.7 448.72 Y Dedicated Transduer LCS-68 11/202 9.4 429.52 18.8 448.12 Y Dedicated Transduer LCS-68 11/202 9.4 429.52 18.8 Dedicated Transduer The LCS-68 transducre was observed to be non-operational on 11/300. Transducr registrament LCS-68 11/202 9.4 429.52 1.4 N Dedicated Transduer LCS-68 2/120 9.4 429.52 1.4 N Dedicated Transduer LCS-68 2/120 NA NA 429.52 2.8 N Dedicated Transduer LCS										
LOS-68 122019 9.1 9.4 442.52 115.5 446.02 Y Dedicated Transduer LOS-68 13200 10.1 6.4 425.52 16.7 446.22 Y Dedicated Transduer LOS-68 13200 10.1 6.4 425.22 16.8 440.02 Y Dedicated Transduer LOS-68 117020 2 8.4 425.22 16.8 440.02 Y Dedicated Transduer LOS-68 117020 9.4 425.52 16.8 N Dedicated Transduer The LC5-68 transduer was observed to be non-operational on 11320. Transduer replacement LOS-68 172420 9.4 425.52 1 N Dedicated Transduer The LC5-68 transduer was observed to be non-operational on 11320. Transduer replacement LOS-68 172420 9.4 425.52 1 N Dedicated Transduer The LC5-68 transduer was observed to be non-operational on 11320. Transduer replacement LOS-68 27120 NA NA 425.52 17.8 457.32 N Heron Diport <td< td=""><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td></td<>										
LOS-68 1227/10 9.3 9.4 429.52 18.7 448.22 Y Deckade Transboor LOS-68 1/020 0.1 9.4 429.52 16.6 448.02 Y Deckade Transboor LOS-68 1/020 9.2 9.4 429.52 16.6 448.02 Y Deckade Transboor LOS-68 1/020 9.4 429.52 16.6 448.02 Y Deckade Transboor LOS-68 1/020 9.4 429.52 16.6 N Deckade Transboor The LOS-68 fransboor was observed to be non-operational on 11320. Transboor mails period in the comparison on 11320. Transboor mai										
LOS-68 17/20 10.1 9.4 429.22 110.5 44.8.02 Y Decical Transducer LOS-68 1/17/20 2 9.4 429.52 16.6 44.8.12 Y Decical Transducer The LOS-68 Instructure was observed to be non-operational on 11/202 Transducer replacement LOS-68 1/17/20 9.4 429.52 1.6 N Decical Transducer The LOS-68 Instructure was observed to be non-operational on 11/202 Transducer replacement LOS-68 1/12/0 9.4 429.52 1.6 N Decical Transducer The LOS-68 Instructure was observed to be non-operational on 11/202 Transducer replacement LOS-68 1/12/0 9.4 429.52 1.6 N Decical Transducer The LOS-68 Instructure was observed to be non-operational on 11/302 Transducer replacement LOS-68 2/12/0 NA NA 429.52 27.8 N Hercs Dipper T The LOS-68 Instructure was observed to be non-operational on 11/302 Transducer replacement LOS-68 2/12/0 NA NA 429.52 27.8 457.2 N Hercs Dipper T The LOS-68 Instructure was observed					429.52					
LCS-68 11/100 9.2 9.4 428 52 18.6 44.81.2 Y Dedicated Transducer The LCS-68 transducer was observed to be non-operational on 1/13/20. Transducer replacement is pending replacement parts artival. LCS-68 1/17/20 9.4 429 52 N N Dedicated Transducer LCS-68 1/13/20 9.4 429 52 N N Dedicated Transducer LCS-68 1/13/20 9.4 429 52 N N Dedicated Transducer LCS-68 1/13/20 9.4 429 52 N N Dedicated Transducer LCS-68 2/14/20 9.4 429 52 N N Dedicated Transducer LCS-68 2/14/20 9.4 429 52 N N Dedicated Transducer LCS-68 2/14/20 9.4 429 52 27.8 457.32 N Heron Diper T LCS-68 3/15/20 NA NA 429 52 28.3 457.82 N Heron Diper T LCS-68 3/15/20 LQ <td< td=""><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td></td<>										
LCS-68 IT720 9.4 429.52 N Dedicated Transducer The LCS-88 transducer was observed to be non-operational on 11/320. Transducer replacement is pending replacement parts anival. LCS-68 11/24/20 0.4 429.52 N Dedicated Transducer LCS-68 11/320 9.4 429.52 N Dedicated Transducer LCS-68 11/320 9.4 429.52 N Dedicated Transducer LCS-68 27/20 NA NA 429.52 N Dedicated Transducer LCS-68 27/20 NA NA 429.52 27.8 457.32 N Hern Dipper T LCS-68 36/20 NA NA 429.52 N <td></td>										
LCS-68 117/20 9.4 429.52 Image: Constraint of the constraint of t	LCS- 6B	1/10/20	9.2	9.4	429.52	18.6	448.12	Y	Dedicated Transducer	
LCS-68 12/20 9.4 429.2 N Decicate Transducer is pending replacement parts annual. LCS-68 13120 9.4 429.2 N Decicate Transducer The LCS-68 transducer was observed to be non-operational on 1/320. Transducer replacement is pending replacement parts annual. LCS-68 2/1420 9.4 429.52 N Decicate Transducer The LCS-68 transducer was observed to be non-operational on 1/320. Transducer replacement is transducer was observed to be non-operational on 1/320. Transducer replacement is transducer was observed to be non-operational on 1/320. Transducer replacement is transducer was observed to be non-operational on 1/320. Transducer replacement is transducer was observed to be non-operational on 1/320. Transducer replacement is transducer was observed to be non-operational on 1/320. Transducer replacement is transducer was observed to be non-operational on 1/320. Transducer replacement is transducer was observed to be non-operational on 1/320. Transducer replacement is transducer was observed to be non-operational on 1/320. Transducer replacement is transducer was observed to be non-operational on 1/320. Transducer replacement is transducer was observed to be non-operational on 1/320. Transducer replacement is transducer was observed to be non-operational on 1/320. Transducer replacement is transducer was observed to be non-operational on 1/320. Transducer replacement is transducer was observed to be non-operational on 1/320. Transducer replacement is transducer was observed to be non-operational on 1/320. Transducer replacement is transducer was observed to be non-operational on 1/320. Transducer replacement is transducer was observ	LCS-6B	1/17/20		9.4	429.52			N	Dedicated Transducer	is pending replacement parts arrival.
LCS-68 1/3/20 9.4 4.29.62 N N Dedicated Transducer Dedicated Transducer Dedicated Transducer LCS-68 27/20 9.4 429.52 N N Dedicated Transducer The LCS-68 transducer was observed to be non-operatication on 11/320. Transducer replacement LCS-68 21/420 9.4 429.52 27.8 457.32 N Pedicated Transducer The LCS-68 transducer was observed to be non-operatication on 11/320. Transducer replacement LCS-68 22120 N/A N/A 429.52 27.8 457.32 N Henon Dipper T It CS-68 transducer was observed to be non-operatication on 11/320. Transducer replacement LCS-68 22820 N/A N/A 429.52 28.0 457.82 N Henon Dipper T Its CS-68 transducer was observed to be non-operatication on 11/320. Transducer replacement LCS-68 39.20 N/A N/A 429.52 29.0 457.52 N Henon Dipper T Its CS-68 transducer was observed to be non-operatication on 11/320. Transducer replacement LCS-68 39.20 N/A N/A 429.52 21.9	LCS- 6B	1/24/20		9.4	429.52			N	Dedicated Transducer	
LCS-68 27720 9.4 429.52 N N Dedicated Transduor The LCS-88 transduor was observed to be non-operational on 1/13/20. Transduor replacement is pending replacement parts arrival. LCS-68 2/14/20 N/A 0.4 429.52 27.8 457.32 N The LCS-88 transduor was observed to be non-operational on 1/13/20. Transduor replacement is pending replacement parts arrival. LCS-68 2/21/20 N/A N/A 429.52 27.8 457.32 N Heron Dipper T The LCS-88 transduor was observed to be non-operational on 1/13/20. Transduor replacement is pending replacement parts arrival. Image: construction of the parts of the pa		1/21/20		0.4	420.52			N	Dedicated Transducer	The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement
LCS-68 2/14/20 9.4 429.52 N Dedicated Transducer The LCS-8B transducer was observed to be non-operational on 1/13/20. Transducer replacement is penditively scheduled free was observed to be non-operational on 1/13/20. Transducer replacement is penditively scheduled free was observed to be non-operational on 1/13/20. Transducer replacement is transducer was observed to be non-operational on 1/13/20. Transducer replacement is transducer was observed to be non-operational on 1/13/20. Transducer replacement is transducer was observed to be non-operational on 1/13/20. Transducer replacement is transducer was observed to be non-operational on 1/13/20. Transducer replacement is transducer was observed to be non-operational on 1/13/20. Transducer replacement is scheduled for water. LCS-68 3/820 N/A N/A 429.52 28.0 457.52 N Heron Dipper T The LCS-86 transducer was observed to be non-operational on 1/13/20. Transducer replacement is scheduled for 3/11/20. Liquid level was measured manually. The LCS-86 transducer was observed to be non-operational on 1/13/20. Transducer replacement is scheduled for 3/11/20. Liquid level was measured manually. LCS-68 3/13/20 12.5 9.4 429.52 21.9 451.42 Y Dedicated Transducer The LCS-86 transducer was observed to be non-operational on 3/13/20. The MED No 3/12/20. Liquid level was measured manually. LCS-68 4/10/20 12.0 9.4 429.52 21.7										The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement
LCS-6B 22120 N/A N/A 429.52 27.8 457.32 N Heron Dipper T The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is tentatively scheduled the week of 39/20. Liquid level was measured manually. LCS-6B 22820 N/A N/A 429.52 28.3 457.82 N Heron Dipper T The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is tentatively scheduled the week of 39/20. Liquid level was measured manually. LCS-6B 36/20 N/A N/A 429.52 28.0 457.52 N Heron Dipper T The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is tentatively scheduled for 31/120. Liquid level was measured manually. LCS-6B 3/12/20 12.5 9.4 429.52 21.7 451.42 Y Dedicated Transducer The LCS-6B transducer was observed to be non-operational on 3/12/20. The LCS-6B pump was replaced on 3/13/20. LCS-6B 3/27/20 11.5 9.4 429.52 21.8 451.32 Y Dedicated Transducer LCS-6B <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td>The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement</td>										The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement
LCS-6B 221/20 N/A H23.22 27.8 457.32 N Heron Dipper T is pending replacement parts arrival. Liquid level was measured manually. LCS-6B 2282/20 N/A N/A 429.52 28.8 457.82 N Heron Dipper T The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement LCS-6B 3/62/20 N/A N/A 429.52 28.0 457.82 N Heron Dipper T The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement LCS-6B 3/62/20 N/A N/A 429.52 21.9 451.42 Y Dedicated Transducer was replaced on 3/11/20 and the pump beasemed manually. LCS-6B 3/13/20 12.5 9.4 429.52 21.9 451.42 Y Dedicated Transducer CS-68 pump was observed to be non-operational on 3/13/20. The LCS-68 transducer was replaced on 3/13/20. The	LCS- 6B	2/14/20		9.4	429.52			N	Dedicated Transducer	
LCS-6B 2/28/20 N/A N/A 429.52 28.3 47.82 N Heron Dipper T is tentatively scheduled five week of 39/20, Liquid level was measured manually. LCS-6B 3/6/20 N/A N/A 429.52 28.0 457.52 N Heron Dipper T The LCS-6B transducer was beared to be non-operational on 17/20. Transducer replacement lity operational on 37/120. The LCS-6B transducer was replaced on 37/120. Liquid level was measured manually. LCS-6B 3/13/20 12.5 9.4 429.52 21.9 451.22 Y Dedicated Transducer on 37/320. LCS-6B became fully operational on 37/320. LCS-6B 3/20/20 12.3 9.4 429.52 21.3 450.82 Y Dedicated Transducer on 37/320. LCS-6B became fully operational on 37/320. LCS-6B 3/20/20 11.5 9.4 429.52 21.4 450.92 Y Dedicated Transducer LCS-6B 4/10/20 12.0 9.4 429.52 21.8 451.32 Y Dedicated Transducer LCS-6B 4/10/20 12.0 9.4 429.52 18.4 451.32	LCS- 6B	2/21/20	N/A	N/A	429.52	27.8	457.32	N	Heron Dipper T	
LCS-6B 2/28/20 N/A N/A 429.52 28.3 47.82 N Heron Dipper T is tentatively scheduled five week of 39/20, Liquid level was measured manually. LCS-6B 3/6/20 N/A N/A 429.52 28.0 457.52 N Heron Dipper T The LCS-6B transducer was beared to be non-operational on 17/20. Transducer replacement lity operational on 37/120. The LCS-6B transducer was replaced on 37/120. Liquid level was measured manually. LCS-6B 3/13/20 12.5 9.4 429.52 21.9 451.22 Y Dedicated Transducer on 37/320. LCS-6B became fully operational on 37/320. LCS-6B 3/20/20 12.3 9.4 429.52 21.3 450.82 Y Dedicated Transducer on 37/320. LCS-6B became fully operational on 37/320. LCS-6B 3/20/20 11.5 9.4 429.52 21.4 450.92 Y Dedicated Transducer LCS-6B 4/10/20 12.0 9.4 429.52 21.8 451.32 Y Dedicated Transducer LCS-6B 4/10/20 12.0 9.4 429.52 18.4 451.32										The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement
LCS-6B 3/6/20 NA NA 429.52 28.0 457.52 N Heron Dipper T is scheduled for 3/1/20. Liquid level was measured munually. LCS-6B 3/13/20 12.5 9.4 429.52 21.9 451.42 Y Dedicated Transducer Incle-56B pump was observed to be non-operational on 3/13/20. ICS-6B pump was replaced on 3/13/20. ICS-6B pump was replaced on 3/13/20. ICS-6B pump was replaced non-3/13/20. ICS-6B pump was replaced non-3/13/20. ICS-6B pump was replaced non-3/13/20. ICS-6B pump was observed to be non-operational on 3/13/20. LCS-6B 3/20/20 11.9 9.4 429.52 21.9 450.42 Y Dedicated Transducer LCS-6B 4/30/20 11.9 9.4 429.52 21.8 450.42 Y Dedicated Transducer LCS-6B 4/10/20 12.0 9.4 429.52 21.8 451.32 Y Dedicated Transducer LCS-6B 4/16/20 12.4 9.4 429.52 18.4 447.82 Y Dedicated Transducer LCS-6B 4/30/20 8.9 9.4 429.52 18.4 447.82 Y Dedicated Transducer<	LCS- 6B	2/28/20	N/A	N/A	429.52	28.3	457.82	N	Heron Dipper T	
LCS-68 3/13/20 12.5 9.4 429.52 21.9 451.42 Y Dedicated Transducer Dedicated Transducer The LCS-68 transducer was replaced on 3/11/20 and the pump became fully operational. The LCS-68 3/27/20 11.9 9.4 429.52 21.7 451.22 Y Dedicated Transducer on 3/13/20. LCS-68 became fully operational on 3/13/20. LCS-68 3/27/20 11.9 9.4 429.52 21.3 450.42 Y Dedicated Transducer LCS-68 4/10/20 12.0 9.4 429.52 21.8 450.42 Y Dedicated Transducer LCS-68 4/10/20 12.4 9.4 429.52 21.8 451.32 Y Dedicated Transducer LCS-68 4/10/20 12.4 9.4 429.52 21.8 451.32 Y Dedicated Transducer LCS-68 4/30/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer LCS-68 5/7/20 9.0 9.4 429.52 18.4 447.92 Y Dedicated Transducer </td <td>LCS- 6B</td> <td>3/6/20</td> <td>N/A</td> <td>N/A</td> <td>429.52</td> <td>28.0</td> <td>457.52</td> <td>N</td> <td>Heron Dipper T</td> <td>The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is scheduled for 3/11/20. Liquid level was measured manually.</td>	LCS- 6B	3/6/20	N/A	N/A	429.52	28.0	457.52	N	Heron Dipper T	The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is scheduled for 3/11/20. Liquid level was measured manually.
LCS-6B 3/13/20 12.5 9.4 429.52 21.9 451.42 Y Dedicated Transducer on 3/13/20. LCS-6B became fully operational on 3/13/20. LCS-6B 3/20/20 11.9 9.4 429.52 21.7 451.22 Y Dedicated Transducer LCS-6B 3/27/20 11.9 9.4 429.52 21.3 450.82 Y Dedicated Transducer LCS-6B 4/10/20 11.5 9.4 429.52 20.8 450.42 Y Dedicated Transducer LCS-6B 4/10/20 12.4 9.4 429.52 21.8 451.32 Y Dedicated Transducer LCS-6B 4/10/20 12.4 9.4 429.52 21.8 451.32 Y Dedicated Transducer LCS-6B 4/10/20 12.4 9.4 429.52 18.8 447.82 Y Dedicated Transducer LCS-6B 4/23/20 12.4 447.82 Y Dedicated Transducer The LCS-6B VFD was observed to be non-operational on 4/23/20. The VFD was replaced on 4/23/20. The										
LCS-6B 3/20/20 12.3 9.4 429.52 21.7 451.22 Y Dedicated Transducer LCS-6B 3/27/20 11.9 9.4 429.52 21.3 450.82 Y Dedicated Transducer LCS-6B 4//20 11.5 9.4 429.52 20.9 450.42 Y Dedicated Transducer LCS-6B 4//10/20 12.0 9.4 429.52 21.4 450.92 Y Dedicated Transducer LCS-6B 4//10/20 12.4 9.4 429.52 21.8 451.32 Y Dedicated Transducer LCS-6B 4/23/20 9.4 429.52 18.3 447.82 Y Dedicated Transducer LCS-6B 4/23/20 9.4 429.52 18.3 447.82 Y Dedicated Transducer LCS-6B 5///20 9.0 9.4 429.52 18.4 447.92 Y Dedicated Transducer LCS-6B 5///20 13.3 9.4 429.52 27.7 452.22 Y <td></td> <td></td> <td></td> <td></td> <td></td> <td>_</td> <td>l</td> <td></td> <td></td> <td></td>						_	l			
LCS-6B 3/27/20 11.9 9.4 429.52 21.3 450.82 Y Dedicated Transducer LCS-6B 4/3/20 11.5 9.4 429.52 20.9 450.42 Y Dedicated Transducer LCS-6B 4/10/20 12.0 9.4 429.52 21.4 450.92 Y Dedicated Transducer LCS-6B 4/16/20 12.4 9.4 429.52 21.8 451.32 Y Dedicated Transducer LCS-6B 4/16/20 12.4 9.4 429.52 21.8 451.32 Y Dedicated Transducer LCS-6B 4/30/20 9.4 429.52 18.3 447.82 Y Dedicated Transducer LCS-6B 5/1/20 9.0 9.4 429.52 18.3 447.82 Y Dedicated Transducer LCS-6B 5/1/20 13.3 9.4 429.52 18.4 447.92 Y Dedicated Transducer LCS-6B 5/1/20 13.3 9.4 429.52 17.2 452.22 Y Dedicated Transducer LCS-6B 5/21/20 13.3										on 3/13/20. LCS-6B became fully operational on 3/13/20.
LCS-6B 4/3/20 11.5 9.4 4/29.52 20.9 4/50.42 Y Dedicated Transducer LCS-6B 4/10/20 12.0 9.4 4/29.52 21.4 450.92 Y Dedicated Transducer LCS-6B 4/16/20 12.4 9.4 4/29.52 21.8 451.32 Y Dedicated Transducer LCS-6B 4/23/20 9.4 4/29.52 21.8 451.32 Y Dedicated Transducer LCS-6B 4/23/20 9.4 4/29.52 18.3 447.82 Y Dedicated Transducer LCS-6B 4/30/20 8.9 9.4 4/29.52 18.3 447.82 Y Dedicated Transducer LCS-6B 5/1/20 9.0 9.4 4/29.52 18.4 447.92 Y Dedicated Transducer LCS-6B 5/1/20 13.3 9.4 4/29.52 22.7 452.22 Y Dedicated Transducer LCS-6B 5/21/20 13.3 9.4 4/29.52 17.2 446.72										
LCS-6B 4/10/20 12.0 9.4 429.52 21.4 450.92 Y Dedicated Transducer LCS-6B 4/16/20 12.4 9.4 429.52 21.8 451.32 Y Dedicated Transducer LCS-6B 4/23/20 9.4 429.52 21.8 451.32 Y Dedicated Transducer LCS-6B 4/23/20 9.4 429.52 18.3 447.82 Y Dedicated Transducer LCS-6B 4/30/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer LCS-6B 5/7/20 9.0 9.4 429.52 18.4 447.92 Y Dedicated Transducer LCS-6B 5/7/20 13.3 9.4 429.52 22.7 452.22 Y Dedicated Transducer LCS-6B 5/21/20 13.3 9.4 429.52 12.7 452.22 Y Dedicated Transducer LCS-6B 6/14/20 8.9 9.4 429.52 17.2 446.72 Y Dedicated Transducer LCS-6B 6/14/20 8.9 9.4 <										
LCS-6B 4/16/20 12.4 9.4 429.52 21.8 451.32 Y Dedicated Transducer LCS-6B 4/23/20 9.4 429.52 18.3 447.82 Y Dedicated Transducer LCS-6B 4/30/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer LCS-6B 5/7/20 9.0 9.4 429.52 18.3 447.92 Y Dedicated Transducer LCS-6B 5/7/20 9.0 9.4 429.52 18.3 447.92 Y Dedicated Transducer LCS-6B 5/7/20 9.0 9.4 429.52 22.7 452.22 Y Dedicated Transducer LCS-6B 5/2/120 13.3 9.4 429.52 22.7 452.22 Y Dedicated Transducer LCS-6B 6/2/20 7.8 9.4 429.52 17.2 446.72 Y Dedicated Transducer LCS-6B 6/4/20 8.9 9.4 429.52 17.3 446.72										
LCS-68 4/23/20 9.4 429.52 Y Dedicated Transducer LCS-68 4/23/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer LCS-68 5/7/20 9.0 9.4 429.52 18.4 447.92 Y Dedicated Transducer LCS-68 5/7/20 9.0 9.4 429.52 18.4 447.92 Y Dedicated Transducer LCS-68 5/14/20 13.3 9.4 429.52 22.7 452.22 Y Dedicated Transducer LCS-68 5/28/20 7.8 9.4 429.52 17.2 446.72 Y Dedicated Transducer LCS-68 6/4/20 8.9 9.4 429.52 17.2 446.72 Y Dedicated Transducer LCS-68 6/4/20 8.9 9.4 429.52 17.3 446.72 Y Dedicated Transducer LCS-68 6/4/20 8.9 9.4 429.52 17.3 446.72 Y Dedicated Transduc										
LCS-68 4/3/2 9.4 429.52 18.3 447.82 Y Dedicated Transducer LCS-68 4/30/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer LCS-68 5/7/20 9.0 9.4 429.52 18.3 447.92 Y Dedicated Transducer LCS-68 5/7/20 9.0 9.4 429.52 22.7 452.22 Y Dedicated Transducer LCS-68 5/14/20 13.3 9.4 429.52 22.7 452.22 Y Dedicated Transducer LCS-68 5/28/20 7.8 9.4 429.52 22.7 452.22 Y Dedicated Transducer LCS-68 5/28/20 7.8 9.4 429.52 17.2 446.72 Y Dedicated Transducer LCS-68 6/1/20 8.9 9.4 429.52 17.3 446.72 Y Dedicated Transducer LCS-68 6/1/20 8.9 9.4 429.52 18.3 447.82	LCS- 6B	4/16/20	12.4	9.4	429.52	21.8	451.32	Ý	Dedicated Transducer	
LCS-6B 4/30/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer LCS-6B 5/7/20 9.0 9.4 429.52 18.4 447.92 Y Dedicated Transducer LCS-6B 5/1/120 13.3 9.4 429.52 22.7 452.22 Y Dedicated Transducer LCS-6B 5/21/20 13.3 9.4 429.52 22.7 452.22 Y Dedicated Transducer LCS-6B 5/28/20 7.8 9.4 429.52 17.2 446.72 Y Dedicated Transducer LCS-6B 6/11/20 7.9 9.4 429.52 17.3 446.82 Y Dedicated Transducer LCS-6B 6/18/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer LCS-6B 6/18/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer LCS-6B 6/18/20 8.7 9.4 429.52 18.1										4/23/20 and LCS-6B became fully operational. A level sensor reading was not collected during the
LCS-6B 5/7/20 9.0 9.4 429.52 18.4 447.92 Y Dedicated Transducer LCS-6B 5/14/20 13.3 9.4 429.52 22.7 452.22 Y Dedicated Transducer LCS-6B 5/21/20 13.3 9.4 429.52 22.7 452.22 Y Dedicated Transducer LCS-6B 5/21/20 13.3 9.4 429.52 22.7 452.22 Y Dedicated Transducer LCS-6B 5/28/20 7.8 9.4 429.52 17.2 446.72 Y Dedicated Transducer LCS-6B 6/4/20 8.9 9.4 429.52 17.3 446.72 Y Dedicated Transducer LCS-6B 6/1/120 7.9 9.4 429.52 17.3 446.72 Y Dedicated Transducer LCS-6B 6/18/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer LCS-6B 6/25/20 8.7 9.4 429.52 18.1 447.62 Y Dedicated Transducer LCS-6B 7/2/20 <td< td=""><td></td><td></td><td></td><td></td><td></td><td></td><td>1</td><td></td><td></td><td>weekly reporting period due to VFD communication loss with the site's SCADA system.</td></td<>							1			weekly reporting period due to VFD communication loss with the site's SCADA system.
LCS-68 5/14/20 13.3 9.4 429.52 22.7 452.22 Y Dedicated Transducer LCS-68 5/21/20 13.3 9.4 429.52 22.7 452.22 Y Dedicated Transducer LCS-68 5/21/20 7.8 9.4 429.52 17.2 446.72 Y Dedicated Transducer LCS-68 6/4/20 8.9 9.4 429.52 17.3 446.72 Y Dedicated Transducer LCS-68 6/1/1/20 7.9 9.4 429.52 17.3 446.82 Y Dedicated Transducer LCS-68 6/18/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer LCS-68 6/18/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer LCS-68 6/18/20 8.9 9.4 429.52 18.1 447.62 Y Dedicated Transducer LCS-68 7/202 9.2 9.4 429.52 18.6 447.92 Y Dedicated Transducer LCS-68 7/9/20										
LCS-6B 5/21/20 13.3 9.4 429.52 22.7 452.22 Y Dedicated Transducer LCS-6B 6/28/20 7.8 9.4 429.52 17.2 446.72 Y Dedicated Transducer LCS-6B 6/4/20 8.9 9.4 429.52 17.3 446.72 Y Dedicated Transducer LCS-6B 6/11/20 7.9 9.4 429.52 17.3 446.82 Y Dedicated Transducer LCS-6B 6/18/20 8.9 9.4 429.52 17.3 446.82 Y Dedicated Transducer LCS-6B 6/18/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer LCS-6B 6/18/20 8.7 9.4 429.52 18.1 447.82 Y Dedicated Transducer LCS-6B 7/2/20 9.2 9.4 429.52 18.6 448.12 Y Dedicated Transducer LCS-6B 7/9/20 9.0 9.4 429.52 18.4 447.92 Y Dedicated Transducer LCS-6B 7/9/20 9.										
LCS-6B 5/28/20 7.8 9.4 429.52 17.2 446.72 Y Dedicated Transducer LCS-6B 6/4/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer LCS-6B 6/1/120 7.9 9.4 429.52 17.3 446.82 Y Dedicated Transducer LCS-6B 6/1/120 7.9 9.4 429.52 17.3 446.82 Y Dedicated Transducer LCS-6B 6/1/8/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer LCS-6B 6/25/20 8.7 9.4 429.52 18.1 447.62 Y Dedicated Transducer LCS-6B 7/2/20 9.2 9.4 429.52 18.6 448.12 Y Dedicated Transducer LCS-6B 7/9/20 9.0 9.4 429.52 18.4 447.92 Y Dedicated Transducer LCS-6B 7/9/20 9.0 9.4 429.52 18.1										
LCS-6B 6/4/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer LCS-6B 6/11/20 7.9 9.4 429.52 17.3 446.82 Y Dedicated Transducer LCS-6B 6/18/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer LCS-6B 6/18/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer LCS-6B 6/25/20 8.7 9.4 429.52 18.1 447.62 Y Dedicated Transducer LCS-6B 7/2/20 9.2 9.4 429.52 18.6 448.12 Y Dedicated Transducer LCS-6B 7/9/20 9.0 9.4 429.52 18.4 447.92 Y Dedicated Transducer LCS-6B 7/16/20 8.7 9.4 429.52 18.4 447.92 Y Dedicated Transducer LCS-6B 7/16/20 8.7 9.4 429.52 18.1										
LCS-6B 6/11/20 7.9 9.4 429.52 17.3 446.82 Y Dedicated Transducer LCS-6B 6/18/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer LCS-6B 6/25/20 8.7 9.4 429.52 18.1 447.82 Y Dedicated Transducer LCS-6B 6/25/20 8.7 9.4 429.52 18.1 447.62 Y Dedicated Transducer LCS-6B 7/2/20 9.2 9.4 429.52 18.6 448.12 Y Dedicated Transducer LCS-6B 7/9/20 9.0 9.4 429.52 18.6 448.12 Y Dedicated Transducer LCS-6B 7/9/20 9.0 9.4 429.52 18.4 447.92 Y Dedicated Transducer LCS-6B 7/16/20 8.7 9.4 429.52 18.1 447.62 Y Dedicated Transducer LCS-6B 7/23/20 8.6 9.4 429.52 18.0										
LCS-6B 6/18/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer LCS-6B 6/25/20 8.7 9.4 429.52 18.1 447.62 Y Dedicated Transducer LCS-6B 7/2/20 9.2 9.4 429.52 18.6 448.12 Y Dedicated Transducer LCS-6B 7/9/20 9.2 9.4 429.52 18.6 448.12 Y Dedicated Transducer LCS-6B 7/9/20 9.0 9.4 429.52 18.4 447.92 Y Dedicated Transducer LCS-6B 7/16/20 8.7 9.4 429.52 18.1 447.62 Y Dedicated Transducer LCS-6B 7/23/20 8.6 9.4 429.52 18.1 447.62 Y Dedicated Transducer LCS-6B 7/23/20 8.6 9.4 429.52 18.0 447.52 Y Dedicated Transducer										
LCS-6B 6/25/20 8.7 9.4 429.52 18.1 447.62 Y Dedicated Transducer LCS-6B 7/2/20 9.2 9.4 429.52 18.6 448.12 Y Dedicated Transducer LCS-6B 7/9/20 9.0 9.4 429.52 18.4 447.92 Y Dedicated Transducer LCS-6B 7/9/20 8.7 9.4 429.52 18.4 447.92 Y Dedicated Transducer LCS-6B 7/16/20 8.7 9.4 429.52 18.1 447.62 Y Dedicated Transducer LCS-6B 7/12/02 8.6 9.4 429.52 18.1 447.52 Y Dedicated Transducer										
LCS-6B 7/2/0 9.2 9.4 429.52 18.6 448.12 Y Dedicated Transducer LCS-6B 7/9/20 9.0 9.4 429.52 18.4 447.92 Y Dedicated Transducer LCS-6B 7/16/20 8.7 9.4 429.52 18.1 447.62 Y Dedicated Transducer LCS-6B 7/12/3/20 8.6 9.4 429.52 18.0 447.52 Y Dedicated Transducer										
LCS-6B 7/9/20 9.0 9.4 429.52 18.4 447.92 Y Dedicated Transducer LCS-6B 7/16/20 8.7 9.4 429.52 18.1 447.62 Y Dedicated Transducer LCS-6B 7/23/20 8.6 9.4 429.52 18.0 447.52 Y Dedicated Transducer										
LCS-6B 7/16/20 8.7 9.4 429.52 18.1 447.62 Y Dedicated Transducer LCS-6B 7/23/20 8.6 9.4 429.52 18.0 447.52 Y Dedicated Transducer										
LCS-6B 7/23/20 8.6 9.4 429.52 18.0 447.52 Y Dedicated Transducer								Y	Dedicated Transducer	
LCS- 6B 7/31/20 8.6 9.4 429.52 18.0 447.52 Y Dedicated Transducer								Y		
	LCS- 6B	7/31/20	8.6	9.4	429.52	18.0	447.52	Y	Dedicated Transducer	

LCS-6B Liquid Level Above Quarry Floor

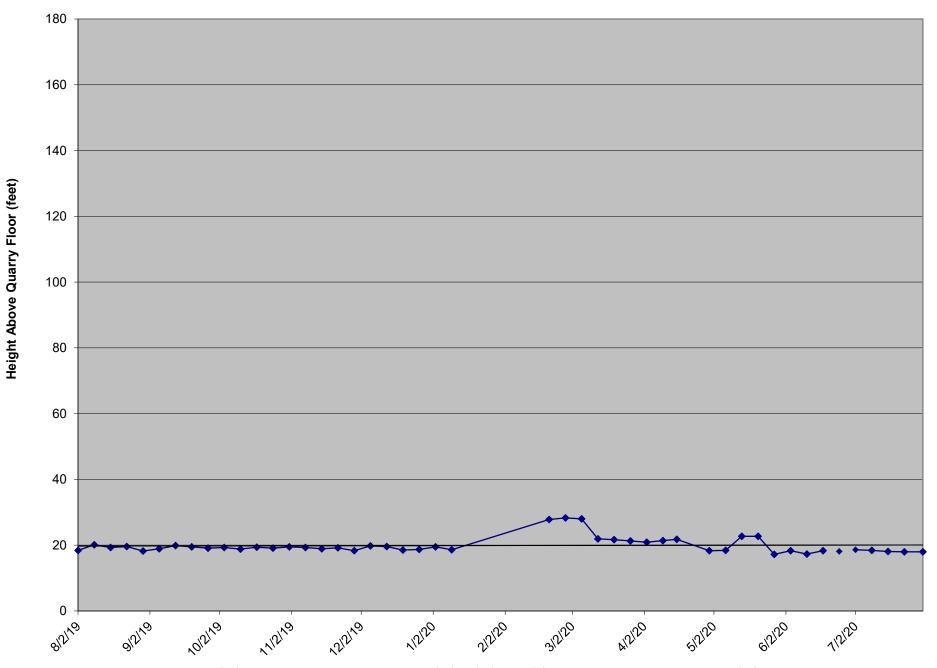

The transducer became non-operational on 1/13/20. Liquid level was measured manually on 2/21/20, 2/28/20 and 3/6/20. The transducer became operational on 3/13/20. The VFD was observed to be non-operational on 4/23/20, it was replaced on 4/23/20, however the level sensor reading was not taken due to VFD communication loss with SCADA.