
_	_			_			
	200	Resolution of last februaries and	Tenner ten terrestran	Bass Floring Street	200		
10.7	H		===	818	T	NAME TO AND	
10.5	60		-	22	Н	No. of Contract	
MA N	Ē		1	94	т	New York	
	Ш		H	H	Н		
-	Ш		-		H		
10.5	Ш	-	-	20	H	No. of Contract	
MA N	ı		1	94	Н	New York	
175.70	H		-	00		DOM: TOTAL	
10.5	No.	-	-	00	H	NAME AND ADDRESS OF	
10.5	Ш	-	-	00	H	NAME AND ADDRESS OF	
==	Ш	-	-	Ш	Н		
-	Н			2	t	DOM: TODAY	
MAN	w			ma.		NAME THANKS	tag Alak dalam a kada ata kada tagtakan gar
-	Ш		-		H		
- 153	H			ä	t		
MA N	î		1	94	т	New York	
10.5	i			ł	H		
-	Ш				H		
	Н						Top offer restorate they are taken a challed the representation of the contract of the contrac
	Н		-	-	H		Any Ph. selector for extractor operations, and con-
UKW	ì			-	,	NAMES AND ADDRESS OF THE PARTY	They of the made beams from a coloration region and an industrial for some
	Н		H		Н		For Pin serious Top estandor observing popular car for Pin serious Top estandor observing popular car
MAN	wer			es a	,	NAME AND ADDRESS OF	Any after received they enhance replaced proposition on Any after received they enhance replaced proposition on
	Н		H		Н		For Pin serious Top estandor observing popular car for Pin serious Top estandor observing popular car
100.00	-		-	- 000		NAME AND ADDRESS OF	Any after recise and they estimated in operand project for the second control of the sec
W	-		-	-		New Total	
10.7	100		-	93	÷	DESCRIPTION OF	
	10			-	Ħ		
	E				Ė		
100.00	-		-	-	-	NAME AND ADDRESS OF	
W	E		-	-		New Total	
US N	-		-	-	÷	NAME AND ADDRESS OF	hap represent the good format of the Work and constraint the being to Any open control of the property of the control of the c
	П		H		Н		The property separately required about
	Н		ł	H	ł		
			1		ŀ		
	Н		ł	H	ł		
100.00	8			-		NAME AND ADDRESS OF	
	П		-	-	1		
100.00	ı			8	1	NAME OF TAXABLE PARTY.	Mark you within super-solves Angeling and product and Mark you within super-solves Angeling and product and
	-		-	-		NAME OF TAXABLE PARTY.	West had make an interesting the section has the
US W	200		-	-	-	NAME AND ADDRESS OF THE PARTY O	Mark you within super-server Property and provide and
	П		-	-		NAME OF TAXABLE PARTY.	Note had make an interest, by the continuent of
	Н						Married State Committee Co
100.00	ı			80	٠.		
	Н		-	-			Mark you within super-city of August and an area.
	ı			Н			
	111					2007004	
	-			11111			
						DESCRIPTION OF THE PROPERTY OF	
10 A						Marine Ma	
						Marine Ma	
						MONTON MARKETON MARKE	
						MARCON MA	
100 M						Married Marrie	
						Marie Color	
						MARKETON MAR	
						DESCRIPTION OF THE PROPERTY OF	
133 133 133 133 133 133 133 133 133 133							
133 133 133 133 133 133 133 133 133 133							
133 133 133 133 133 133 133 133 133 133							
133 133 133 133 133 133 133 133 133 133							
133 133 133 133 133 133 133 133 133 133							
333							

	Date	Measured Liquid	Transducer Height	Base of Sump	Elevation of	Pump on during		
	Reading	Level Above	above Floor of	Elevation	Leachate	measurement?		
LCS Number	Collected	Transducer (Ft.)	Quarry (Ft.)	(Ft. MSL)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 2D	9/6/19	N/A	14.4	235.92	,	N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/13/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/20/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/27/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	10/4/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	10/11/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	10/18/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	10/25/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	11/1/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	11/8/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	11/15/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	11/29/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/6/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/13/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/20/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/27/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/3/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/10/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/17/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/24/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/31/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/7/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/14/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/21/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/28/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/6/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/13/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/20/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/27/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/3/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/10/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/16/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	4/23/20 4/30/20	N/A N/A	14.4 14.4	235.92 235.92		N N	Dedicated Transducer Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
								PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/7/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/14/20	N/A	14.4	235.92		N N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	5/21/20 5/28/20	N/A N/A	14.4 14.4	235.92 235.92		N N	Dedicated Transducer Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	6/4/20	N/A N/A	14.4	235.92		N N	Dedicated Transducer Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/11/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/18/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/25/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/2/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/9/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/16/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/23/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/31/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/7/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/14/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/21/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/28/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/4/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
						•••		


				Well Total Depth				
	Date	Measured Liquid	Transducer Depth	from Top of	Elevation of	Pump on during		
	Reading	Level Below Ground	from Top of Casing	Casing (Ft.)	Leachate	measurement?		
LCS Number	Collected	Surface (ft)	(Ft.)	(Ft. MSL)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS-3D	9/6/19	32.1	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/13/19	32.5	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/20/19	35.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/27/19	37.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/4/19	42.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/11/19	43.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/18/19	44.5	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/25/19	48.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/1/19	49.5	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/8/19	51.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/15/19	52.0	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/22/19	52.1	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/27/19	51.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	12/6/19	52.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	12/13/19	51.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	12/20/19	52.0	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	12/27/19	51.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/3/20	49.9	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/10/20	49.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/17/20	46.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/24/20	41.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/31/20	41.2	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/7/20	43.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/14/20	47.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/21/20	48.6	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/28/20	48.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/6/20	49.9	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/13/20	47.3	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/20/20	62.1	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/27/20	50.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/3/20	45.9	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/10/20	49.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/16/20	52.2	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/23/20	51.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/1/20	55.6	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/7/20	50.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/14/20	54.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/21/20	40.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/28/20	50.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/4/20	50.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/11/20	54.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/19/20	52.5	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/26/20	52.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/2/20	60.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/9/20	60.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/17/20	61.1	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/23/20	60.5	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/31/20	60.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/7/20	59.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/14/20	51.2	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/21/20	59.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/28/20	48.2	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/4/20	52.1	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually

LCS-3D Liquid Level Below Ground Surface

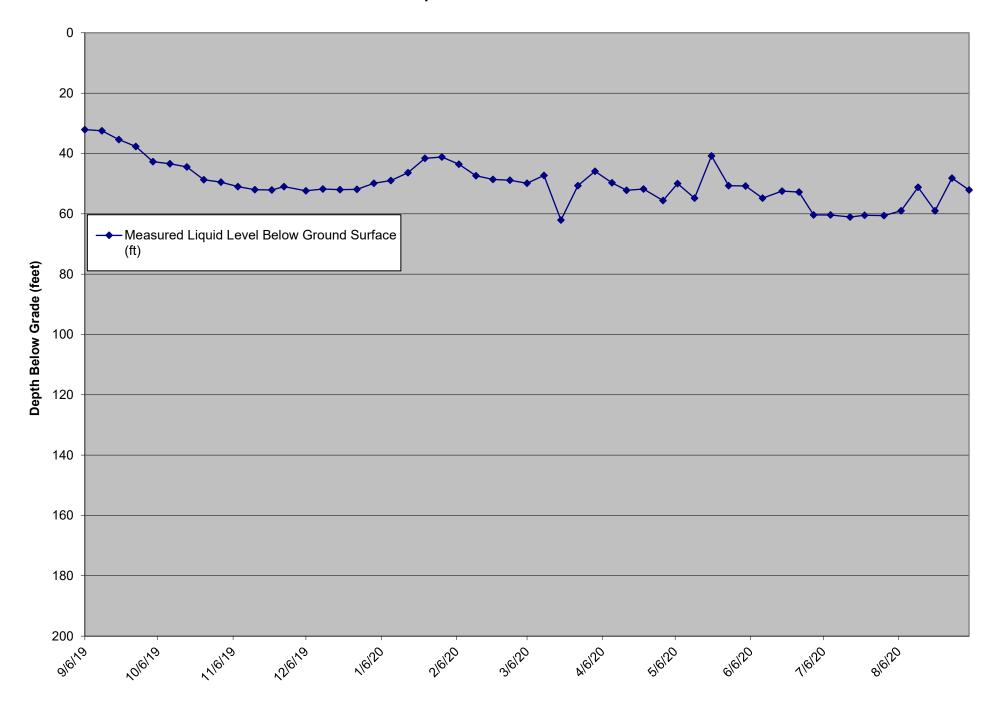


	Date	Measured Liquid	Transducer Depth	Base of Sump	Pump on during		
	Reading	Level Below Ground	from Top of Casing	Elevation	measurement?		
LCS Number	Collected	Surface (ft)	(Ft.)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 4B	9/6/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/13/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/20/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/27/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/4/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/11/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/18/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/25/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/1/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/8/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/15/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/22/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/29/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/6/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/13/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/20/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/27/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/3/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/10/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/17/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/24/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/31/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/7/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/14/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/21/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/28/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/6/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/13/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/20/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/27/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/3/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/10/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/16/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/23/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/30/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/7/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/14/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/21/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/28/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/4/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/11/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/18/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/26/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/2/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/9/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/16/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/23/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/31/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/7/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/14/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/21/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/28/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/4/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS

LCS-4B Liquid Level Below Ground Surface

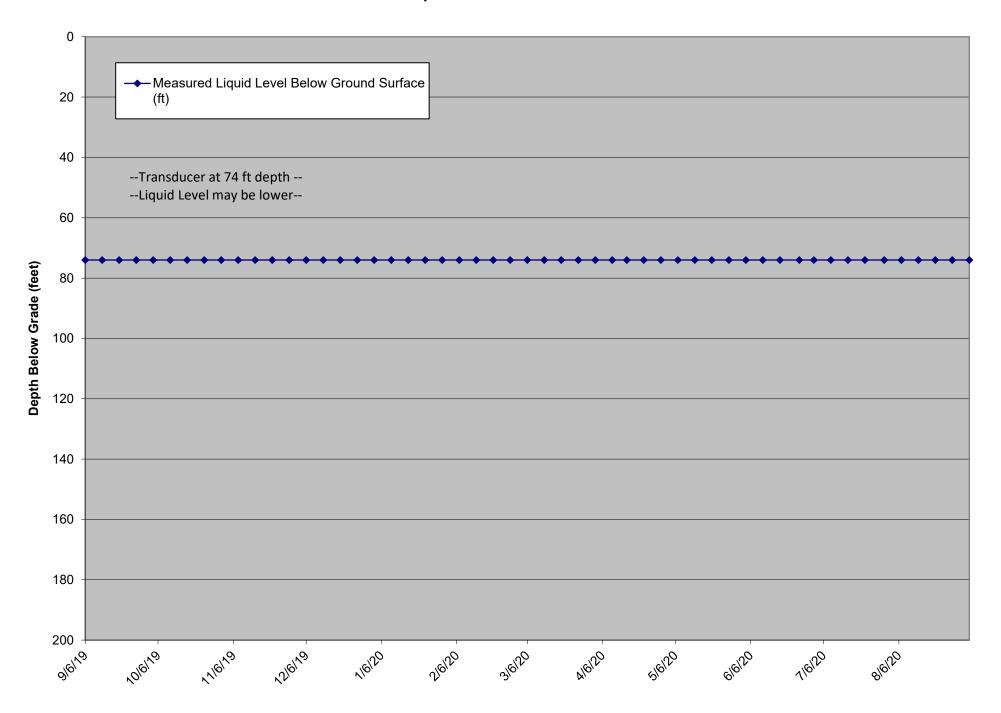

	D-4-	Manager at Decide	Towns down a Halada	D		Florestion	D		
	Date Reading	Measured Liquid Level Above	Transducer Height above Floor of	Base of Sump Elevation	Height of	Elevation of Leachate	Pump on during measurement?		
LCS Number	Collected	Transducer (Ft.)	Quarry (Ft.)	(Ft. MSL)	Liquid (ft)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS-5B	9/6/19	11.1	21.9	235.3	33.0	268.30	Y (1/1N)	Dedicated Transducer	Confinents
LCS- 5B	9/13/19	12.6	21.9	235.3	34.5	269.80	Y Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	9/20/19	12.8	21.9	235.3	34.7	270.00	Ϋ́	Dedicated Transducer	
LCS- 5B	9/27/19	13.0	21.9	235.3	34.9	270.20	Y	Dedicated Transducer	
LCS- 5B	10/4/19	12.2	21.9	235.3	34.1	269.40	Ϋ́	Dedicated Transducer	
LCS- 5B	10/11/19	13.3	21.9	235.3	35.2	270.50	Y	Dedicated Transducer	
LCS- 5B	10/18/19	11.5	21.9	235.3	33.4	268.70	Υ	Dedicated Transducer	
LCS- 5B	10/25/19	12.7	21.9	235.3	34.6	269.90	Υ	Dedicated Transducer	
LCS- 5B	11/1/19	12.3	21.9	235.3	34.2	269.50	Υ	Dedicated Transducer	
									The transducer was observed to be non-operational on 11/6/19.
LCS- 5B	11/8/19		21.9	235.3		235.30	N	Dedicated Transducer	Transducer replacement is scheduled on 11/13/19.
LCS- 5B	11/15/19		21.9	235.3		235.30	N	Dedicated Transducer	The transducer was observed to be non-operational on 11/6/19 and was replaced on 11/13/19. After transducer replacement, pump was non-operational due to suspected frozen forcemain section. Troubleshooting will continue the week of 11/18/19.
LCS- 5B	11/22/19	11.7	21.9	235.3	33.6	268.90	Y	Dedicated Transducer	The transducer was observed to be non-operational on 11/6/19 and was replaced on 11/13/19. After transducer replacement, pump was non-operational due to suspected frozen forcemain section. The pump and motor were replaced on 11/19/19 and LCS-5B became fully operational.
LCS- 5B	11/29/19	11.0	21.9	235.3	32.9	268.20	Υ	Dedicated Transducer	
LCS- 5B	12/6/19	12.4	21.9	235.3	34.3	269.60	Υ	Dedicated Transducer	
LCS- 5B	12/13/19	12.0	21.9	235.3	33.9	269.20	Υ	Dedicated Transducer	
LCS- 5B	12/20/19	13.1	21.9	235.3	35.0	270.30	Υ	Dedicated Transducer	
LCS- 5B	12/27/19	10.0	21.9	235.3	31.9	267.20	Υ	Dedicated Transducer	
LCS- 5B	1/3/20	11.3	21.9	235.3	33.2	268.50	Υ	Dedicated Transducer	
LCS- 5B	1/10/20	12.4	21.9	235.3	34.3	269.60	Υ	Dedicated Transducer	
LCS- 5B	1/17/20	11.3	21.9	235.3	33.2	268.50	Υ	Dedicated Transducer	
LCS- 5B	1/24/20	13.0	21.9	235.3	34.9	270.20	Y	Dedicated Transducer	
LCS- 5B	1/31/20	11.7	21.9	235.3	33.6	268.90	Y	Dedicated Transducer	
LCS- 5B	2/7/20	12.6	21.9	235.3	34.5	269.80	Y	Dedicated Transducer	
LCS- 5B	2/14/20	12.3	21.9	235.3	34.2	269.50	Y	Dedicated Transducer	
LCS- 5B	2/21/20	11.3	21.9	235.3	33.2	268.50	Y	Dedicated Transducer	
LCS- 5B	2/28/20	11.6	21.9 21.9	235.3	33.5	268.80	Y	Dedicated Transducer	
LCS- 5B	3/6/20 3/13/20	10.3 11.2	21.9	235.3 235.3	32.2 33.1	267.50 268.40	Y	Dedicated Transducer	
LCS- 5B LCS- 5B	3/13/20	12.3	21.9	235.3	34.2	269.50	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	3/27/20	12.2	21.9	235.3	34.2	269.50	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	4/3/20	11.9	21.9	235.3	33.8	269.40	Y		
LCS- 5B	4/9/20	10.9	21.9	235.3	32.8	268.10	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	4/16/20	11.3	21.9	235.3	33.2	268.50	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	4/10/20	10.4	21.9	235.3	32.3	267.60	Y	Dedicated Transducer	
LCS- 5B	4/23/20	11.7	21.9	235.3	33.6	268.90	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	5/7/20	10.1	21.9	235.3	32.0	267.30	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	5/14/20	12.0	21.9	235.3	33.9	269.20	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	5/21/20	11.7	21.9	235.3	33.6	268.90	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	5/28/20	11.2	21.9	235.3	33.1	268.40	Ý	Dedicated Transducer	
LCS- 5B	6/4/20	11.1	21.9	235.3	33.0	268.30	Υ	Dedicated Transducer	
LCS- 5B	6/11/20	11.6	21.9	235.3	33.5	268.80	Y	Dedicated Transducer	
LCS- 5B	6/18/20	9.3	21.9	235.3	31.2	266.50	Υ	Dedicated Transducer	
LCS- 5B	6/25/20	11.4	21.9	235.3	33.3	268.60	Υ	Dedicated Transducer	
LCS- 5B	7/2/20	8.9	21.9	235.3	30.8	266.10	Y	Dedicated Transducer	
LCS- 5B	7/9/20	10.0	21.9	235.3	31.9	267.20	Y	Dedicated Transducer	
LCS- 5B	7/16/20	8.3	21.9	235.3	30.2	265.50	Y	Dedicated Transducer	
LCS- 5B	7/23/20	12.4	21.9	235.3	34.3	269.60	Υ	Dedicated Transducer	
LCS- 5B	7/31/20	13.0	21.9	235.3	34.9	270.20	Υ	Dedicated Transducer	
LCS- 5B	8/7/20	11.1	21.9	235.3	33.0	268.30	Υ	Dedicated Transducer	
LCS- 5B	8/14/20	14.0	21.9	235.3	35.9	271.20	Υ	Dedicated Transducer	
LCS- 5B	8/21/20	14.1	21.9	235.3	36.0	271.30	Υ	Dedicated Transducer	
LCS- 5B	8/28/20	13.1	21.9	235.3	35.0	270.30	Υ	Dedicated Transducer	
LCS- 5B	9/4/20	82.1	21.9	235.3	104.0	339.30	N	Dedicated Transducer	The LCS-5B pump was turned off on 8/31/20 for forcemain repairs. Forcemain repairs are anticipated to be completed the week of 9/7/20.


LCS-5B Liquid Level Above Quarry Floor

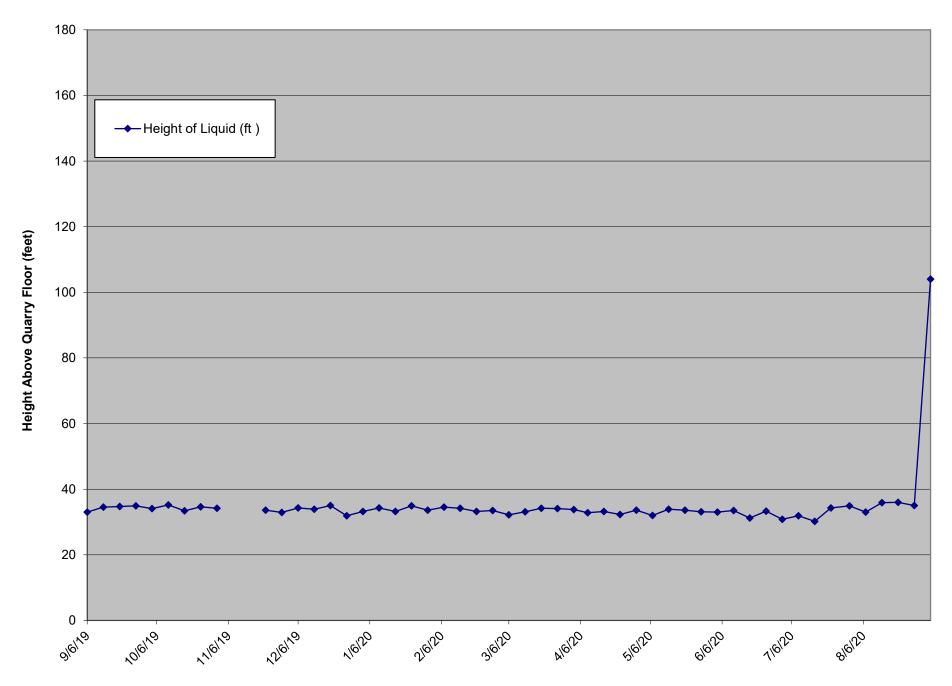

^{*}The transducer in LCS-5B was down from 11/6/19 to 11/19/19 The LCS-5B pump was turned on 8/31/20 for forecmain repairs leading to an increase in liquid level.

	, ,		1						
	Date		Transducer Height	Base of Sump		Elevation of	Pump on during		
	Reading		above Floor of	Elevation	Height of	Leachate	measurement?		
LCS Number	Collected	V	Quarry (Ft.)	(Ft. MSL)	Liquid (ft)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 6B	9/6/19	9.5	9.4	429.52	18.9	448.42	Y	Dedicated Transducer	
LCS- 6B	9/13/19	10.5	9.4	429.52	19.9	449.42	Υ	Dedicated Transducer	
LCS- 6B	9/20/19	10.1	9.4	429.52	19.5	449.02	Y	Dedicated Transducer	
LCS- 6B	9/27/19	9.7	9.4	429.52	19.1	448.62	Ϋ́	Dedicated Transducer	
LCS- 6B	10/4/19	9.9	9.4	429.52	19.3	448.82	Y	Dedicated Transducer	
LCS- 6B	10/11/19	9.4	9.4	429.52	18.8	448.32	Y	Dedicated Transducer	
LCS- 6B	10/18/19	10.0	9.4	429.52	19.4	448.92	Y	Dedicated Transducer	
LCS- 6B	10/25/19	9.7	9.4	429.52	19.1	448.62	Υ	Dedicated Transducer	
LCS- 6B	11/1/19	10.1	9.4	429.52	19.5	449.02	Υ	Dedicated Transducer	
LCS- 6B	11/8/19	9.9	9.4	429.52	19.3	448.82	Υ	Dedicated Transducer	
LCS- 6B	11/15/19	9.5	9.4	429.52	18.9	448.42	Υ	Dedicated Transducer	
LCS- 6B	11/22/19	9.8	9.4	429.52	19.2	448.72	Υ	Dedicated Transducer	
LCS- 6B	11/29/19	8.9	9.4	429.52	18.3	447.82	Ý	Dedicated Transducer	
LCS- 6B	12/6/19	10.4	9.4	429.52	19.8	449.32	Y		
							Y	Dedicated Transducer	
LCS- 6B	12/13/19	10.2	9.4	429.52	19.6	449.12		Dedicated Transducer	
LCS- 6B	12/20/19	9.1	9.4	429.52	18.5	448.02	Y	Dedicated Transducer	
LCS- 6B	12/27/19	9.3	9.4	429.52	18.7	448.22	Y	Dedicated Transducer	
LCS- 6B	1/3/20	10.1	9.4	429.52	19.5	449.02	Υ	Dedicated Transducer	
LCS- 6B	1/10/20	9.2	9.4	429.52	18.6	448.12	Y	Dedicated Transducer	
	1					İ			The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is
LCS- 6B	1/17/20		9.4	429.52	l	1	N	Dedicated Transducer	pending replacement parts arrival.
200-00	1/11/20		J. -1	723.32	l	1	ı V	Dedicated Hansducel	The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is
1.00.00	4/04/00			400.50				B. F. M. I.T.	
LCS- 6B	1/24/20		9.4	429.52			N	Dedicated Transducer	pending replacement parts arrival.
									The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is
LCS- 6B	1/31/20		9.4	429.52			N	Dedicated Transducer	pending replacement parts arrival.
									The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is
LCS- 6B	2/7/20		9.4	429.52			N	Dedicated Transducer	pending replacement parts arrival.
			***						The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is
LCS- 6B	2/14/20		9.4	429.52			N	Dedicated Transducer	pending replacement parts arrival.
LCS- 6B	2/14/20		9.4	429.52			IN	Dedicated Transducer	
									The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is
LCS- 6B	2/21/20	N/A	N/A	429.52	27.8	457.32	N	Heron Dipper T	pending replacement parts arrival. Liquid level was measured manually.
									The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is
LCS- 6B	2/28/20	N/A	N/A	429.52	28.3	457.82	N	Heron Dipper T	tentatively scheduled the week of 3/9/20. Liquid level was measured manually.
									The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is
LCS- 6B	3/6/20	N/A	N/A	429.52	28.0	457.52	N	Heron Dipper T	scheduled for 3/11/20. Liquid level was measured manually.
E00- 0B	0/0/20	1973	19/73	420.02	20.0	401.0Z		Ticron Dipper 1	The LCS-6B transducer was replaced on 3/11/20 and the pump became fully operational. The LCS-
	0//0/00			100 50			.,		6B pump was observed to be non-operational on 3/12/20. The LCS-6B pump was replaced on
LCS- 6B	3/13/20	12.5	9.4	429.52	21.9	451.42	Y	Dedicated Transducer	3/13/20. LCS-6B became fully operational on 3/13/20.
LCS- 6B	3/20/20	12.3	9.4	429.52	21.7	451.22	Υ	Dedicated Transducer	
LCS- 6B	3/27/20	11.9	9.4	429.52	21.3	450.82	Υ	Dedicated Transducer	
LCS- 6B	4/3/20	11.5	9.4	429.52	20.9	450.42	Υ	Dedicated Transducer	
LCS- 6B	4/10/20	12.0	9.4	429.52	21.4	450.92	Y	Dedicated Transducer	
LCS- 6B	4/16/20	12.4	9.4	429.52	21.8	451.32	Υ	Dedicated Transducer	
200 05	17 10/20	12.1	0.1	120.02	21.0	101.02		Douloutou Tranoutou	
									The LCC CR VED was absented to be an acceptance of A/O2/O2. The VED was acceptanced as
									The LCS-6B VFD was observed to be non-operational on 4/23/20. The VFD was replaced on
	1		۱	100 50	1	1	.,		4/23/20 and LCS-6B became fully operational. A level sensor reading was not collected during the
LCS- 6B	4/23/20		9.4	429.52			Y	Dedicated Transducer	weekly reporting period due to VFD communication loss with the site's SCADA system.
LCS- 6B	4/30/20	8.9	9.4	429.52	18.3	447.82	Y	Dedicated Transducer	
LCS- 6B	5/7/20	9.0	9.4	429.52	18.4	447.92	Y	Dedicated Transducer	
LCS- 6B	5/14/20	13.3	9.4	429.52	22.7	452.22	Υ	Dedicated Transducer	
LCS- 6B	5/21/20	13.3	9.4	429.52	22.7	452.22	Y	Dedicated Transducer	
LCS- 6B	5/28/20	7.8	9.4	429.52	17.2	446.72	Υ	Dedicated Transducer	
LCS- 6B	6/4/20	8.9	9.4	429.52	18.3	447.82	v	Dedicated Transducer	
LCS- 6B	6/11/20	7.9	9.4	429.52	17.3	446.82	, V	Dedicated Transducer Dedicated Transducer	
LCS- 6B	6/11/20	8.9	9.4	429.52 429.52	18.3	446.82	Y	Dedicated Transducer Dedicated Transducer	
LCS- 6B	6/25/20	8.7	9.4	429.52	18.1	447.62	Y	Dedicated Transducer	
LCS- 6B	7/2/20	9.2	9.4	429.52	18.6	448.12	Υ	Dedicated Transducer	
LCS- 6B	7/9/20	9.0	9.4	429.52	18.4	447.92	Υ	Dedicated Transducer	
LCS- 6B	7/16/20	8.7	9.4	429.52	18.1	447.62	Υ	Dedicated Transducer	
LCS- 6B	7/23/20	8.6	9.4	429.52	18.0	447.52	Υ	Dedicated Transducer	
LCS- 6B	7/31/20	8.6	9.4	429.52	18.0	447.52	Ϋ́	Dedicated Transducer	
LCS- 6B	8/7/20	8.4	9.4	429.52	17.8	447.32	Ϋ́	Dedicated Transducer	
LCS- 6B	8/14/20	8.7	9.4	429.52	18.1	447.62	Y	Dedicated Transducer	
							Y		
LCS- 6B	8/21/20	7.2	9.4	429.52	16.6	446.12		Dedicated Transducer	
LCS- 6B	8/28/20	8.5	9.4	429.52	17.9	447.42	Y	Dedicated Transducer	
Ī	1		1		1	1			The LCS-6B pump was turned off on 8/31/20 for forcemain repairs. Forcemain repairs are
LCS- 6B	9/4/20	15.5	9.4	429.52	24.9	454.42	N	Dedicated Transducer	anticipated to be completed the week of 9/7/20.
									-

LCS-6B Liquid Level Above Quarry Floor

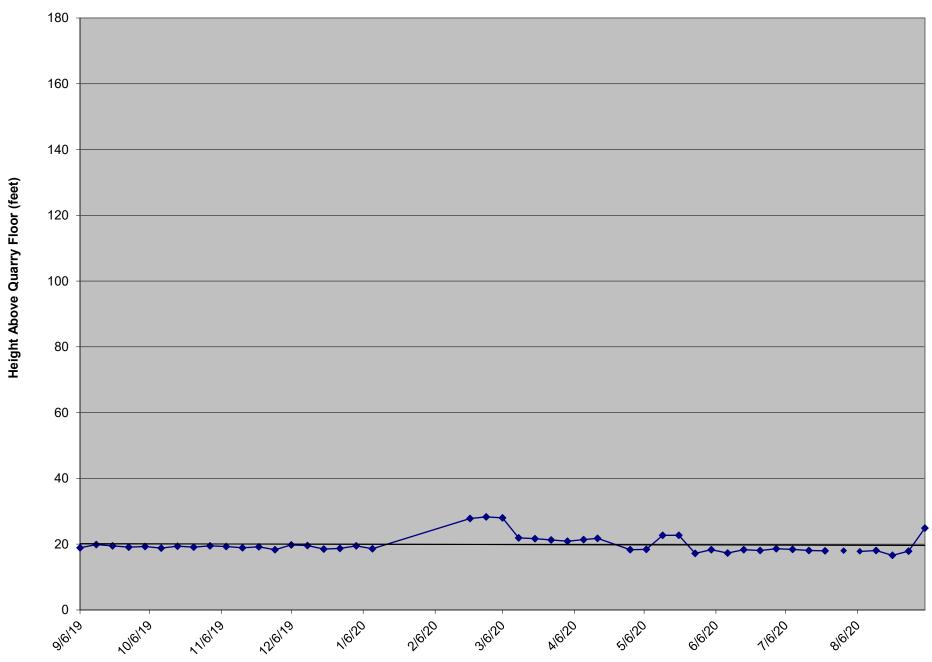

The transducer became non-operational on 1/13/20. Liquid level was measured manually on 2/21/20, 2/28/20 and 3/6/20. The transducer became operational on 3/13/20. The VFD was observed to be non-operational on 4/23/20, it was replaced on 4/23/20, however the level sensor reading was not taken due to VFD communication loss with SCADA. The LCS-6B pump was turned off on 8/31/20 for forcemain repairs leading to an increase in liquid level.