
	£	State of the latest and the latest a	Transport Traffic Son Transforming	Result Plants Products	transp.		
				Ш	ı		
	=		=:	Н	-		
-	=		-	Н	-		
	Ш	I	-		Ш		
-	=		-		-	****	
-	=	Ш	-	Ш	-	-	
			-	Н			
	Ш			Ш	ш		
	Ξ		=:	Н	-	****	
-	Ш	H	-	H	H		
				Ш	ŀ		
10.5	į	ı	20	ı		Separation at	
-	=		-	1		Separate and a	
-	=		- 11	Ш	:	-	
	Ш		Ш	Ш	Ш		
			-	Ш	÷		
-	=		-		-		
	Ш		4	Н	+		
ULX			- 21	ALC:	÷	NAME TO AN	
				Н			Top En terrors by articles specialistic or determined
				Н			Acquire services high principle procedure of a re-
			-				Any Pin retries by anticolor operations in Any Pin retries by anticolor operations in
			-				Any after names and part tendor special popularities. Any after names and part tendor special popularities.
100.0	NAME OF		90	80		Temporary Temporary	Any Ph. Services And an electric systematical parties. Any Ph. Services And an electric systematical parties.
MAR.	100		90	AN AN		Telephone Telephone	No. Pr. william For all times special popular.
10.0	100		- 10	20	-	NAME AND ADDRESS OF	Ang Pile services fire or motive apparation per la Ang Pile services fire or motive apparation per la
_	=			Н			Top Fit returns for principle operationals to annual to a forest annual top of the Log and white an
10.7	-		- 61	-		Mechan	
	E				E		
			E		E		
MA.W	Ξ		974	may.		NAME AND ADDRESS OF THE PARTY O	Appendix and a part of the second
10.0	100		90	20	-	TATAL TATAL	To your depth at 700 to a read
10.0	E		- 10	_	Ε.	NAME AND ADDRESS OF THE PARTY O	Top come department of the second
	Ē	Ē		Ē	E		THE PERSON NAMED IN COLUMN TWO IS NOT THE OWNER.
E	Е	E	E	E	E		The particular and the particula
-	-	I	-	l			Mark you works happy about hopey party and
_	-		-	-	-		Mark you with the same of the frequency of the same of the frequency of the same of the sa
10.3	-		- 21	ı	-	total total	Mark you with the second of the second
10.3	-		**	ě		Telephone .	
	=			Н	-		Mark you work to be a series of the series o
			-				Married work registering from the control
			-				Mark you would be seen and the forest party and the second
			-				Mark you would be seen and the forest party and the second
100.00	1000		90	80		Temperature Temperature	Mark you will be been about 1878 for the property of the
MAR.	100		90	AN AN		Telephone Telephone	Marie party maries conservatives frequency and an activative frequency and a servative and a servative frequency and a ser
100.00	100		- 20	-		NAME AND ADDRESS OF	Marie party maries conservatives frequency and an activative frequency and a servative and a servative frequency and a ser
_	=			Н			Marin year marker recognitive for the service of th
_	_			Н			Mark you work supplied TV for the contract of
_	=			Н			Mark you within some order for party or and
	_		_	Н			Married State of the Control of the
175.70	-		10	2		NAME AND ADDRESS OF THE PARTY NAME A	Mark you work to be about the first time of the same o
10.3	Ξ		- 21	ı	-	bractota.	Mark you with the second of the second
	_			Н	-		Mark programme and the second district of the
	_			Н			Mark you work to pay come from the pay of the con-
	_			Н	-		Married water story over 5 to be a construction
			-				Mark you would be seen and the forest party and the second
US.W	-00		90	82		Separation of the Contract of	Mark you would never named for the street ground
100.00	100		90	80		Temperature Temperature	Mark you will be been about 1878 for the property of the
100.00	-		- 20	-		NAME AND ADDRESS OF	Marie party market sections of the Property and the State of the State
			-	-			Mark you work to pass about August and and
	_		-	-	-		Mark you widow began about Area and an attended
			-	-			National applications to an additional and additional additional and additional addit
-	-	I	-	l			Mark you works happy about hopey party and
10.0	-		- 20	-		Name Tools	Mark you work separately financial and the second
10.0	-		- 10	20	-	NAME AND ADDRESS OF	Mark you would never not the frequency of the
	_						Mark you will be supply and the foreign process.
==	F		-		⊨		
=	F		-	=	Ė		
==	F		-		⊨		
10.0	-		97	-		NAME AND ADDRESS OF THE PARTY NAME A	Marie para materia de para a forma de la constitución de la constituci
10.0			97	=	-	Mariotal Mariotal	Mark you work to have a local frequency or pro-
	_		-		⊨	Anna Contra	Mark you work to have a local frequency or pro-
=	F		=	=	⊨		According to the Control of the Cont
=	F		=		⊏	_	Married Williams Street Co.
=	F		=		⊏	_	Mark you will be supply to the first force of the
10.0	Ε		W.	=	-	NAME TO AN	Mark you with the same of the foreign and
10.0	=		97	=	-	Mariotal Mariotal	Mark you work to have a local frequency or pro-
	=		-		⊨	Anna Contra	Mary pay and the same of the following property of the same of the
	E			=	=		Annual Control of the
	E						Maryon was supplied to the supplied to
	E						Married water separative frequency and
	=		-	-	-	Total Total	Note that were printed by the section in the
10.0	Ē	Ē	W1	-	E	Total Total	Manager water superstant frequency and
10.0 10.0			90	-	-	NAME AND ADDRESS OF	Mark you with the same of the following of the
Ē	Ē	E	LΞ	E	ĿΞ		Mark you with the service of the ser
E	Е	E		E	E		Mark you work regarded to be required to the second
E	Е	E	E	E	E		Mark you would be seen and the forest party of the second
E	E		E	E	E		Married works represented the second
113.75	-		-	-		totactooler 	Mark yell middle began of VS Arquirique design
10.0	Ξ		- 10	-	-	teractions.	Mark you wish super about for the party of the same
	_		-		Ė		Mark you work when a love to be a proper price
=	F		=	=	⊨		Annual Contract Contr
	E			=	=		Marine was some over the forest property
	=						Married water topic of the following of the
					ᄩ		Mark you window service and the frequency of the service and t
10.0 10.0			90	-	-	NAME AND ADDRESS OF	Mark you with the same of the following of the
115.70 115.70	E	E	90	-	LΞ	MARCHAN MARCHAN	Mark you with the second of the second
E	Е	E	E	E	E		Mark yet Marks annea and a fingular party and a fin
E	E		E	E	E		Maryon with Spin 1972 Property and
					-		Mark you with the second of the frequency of the second of
	╒			=	-		Mark you window service of the Property of Street,
					_		NAME AND ADDRESS OF TAXABLE PARTY.
10.0	=	_	97	-		Telephone States	
10.7			W	22	÷	Territorian Territorian Territorian	Make you will be about the or the found by a digital of the or the order of the ord

	Date	Measured Liquid	Transducer Height	Base of Sump	Elevation of	Pump on during		
	Reading	Level Above	above Floor of	Elevation	Leachate	measurement?		
LCS Number	Collected	Transducer (Ft.)	Quarry (Ft.)	(Ft. MSL)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 2D	1/3/20	N/A	14.4	235.92	,	N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/10/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/17/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/24/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/31/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/7/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/14/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/21/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/28/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/6/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/13/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/20/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/27/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/3/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/10/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/16/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/23/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/30/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/7/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/14/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/21/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/28/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/4/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/11/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/18/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/25/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/2/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/9/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/16/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/23/20 7/31/20	N/A N/A	14.4 14.4	235.92		N N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	8/7/20	N/A N/A	14.4	235.92 235.92		N N	Dedicated Transducer Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/14/20	N/A N/A	14.4	235.92		N N	Dedicated Transducer Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/21/20	N/A	14.4	235.92		N N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/28/20	N/A	14.4	235.92		N N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/4/20	N/A	14.4	235.92		N N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/11/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/18/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/25/20	N/A	14.4	235.92		N N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	10/1/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	10/1/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	10/15/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	10/13/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	10/29/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	11/5/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	11/12/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	11/25/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/3/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/10/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/18/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/24/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/31/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
=== ==								


				Well Total Depth				
	Date	Measured Liquid	Transducer Depth	from Top of	Elevation of	Pump on during		
	Reading	Level Below Ground	from Top of Casing	Casing (Ft.)	Leachate	measurement?		
LCS Number	Collected	Surface (ft)	(Ft.)	(Ft. MSL)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS-3D	1/3/20	49.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/10/20	49.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/17/20	46.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/24/20	41.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/31/20	41.2	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/7/20	43.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/14/20	47.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/21/20	48.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/28/20	48.9	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/6/20	49.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/13/20	47.3	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/20/20	62.1	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/27/20	50.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/3/20	45.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/10/20	49.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/16/20	52.2	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/23/20	51.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/1/20	55.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/7/20	50.0	N/A	140		Ϋ́	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/14/20	54.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/21/20	40.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/28/20	50.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/4/20	50.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/11/20	54.8	N/A	140		Ý	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/19/20	52.5	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/26/20	52.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/2/20	60.4	N/A	140		Ϋ́	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/9/20	60.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/17/20	61.1	N/A	140		Ý	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/23/20	60.5	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/31/20	60.6	N/A	140		Ϋ́	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/7/20	59.0	N/A	140		Ý	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/14/20	51.2	N/A	140		Ϋ́	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/21/20	59.0	N/A	140		Ÿ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/28/20	48.2	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/4/20	52.1	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/11/20	50.3	N/A	140		Ý	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/18/20	58.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/25/20	59.7	N/A	140		Ý	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/1/20	59.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/1/20	48.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/5/20	57.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/13/20	57.3	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/5/20	62.5	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/12/20	59.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/12/20	58.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/19/20	57.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	12/3/20	58.2	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LU3-3D	12/3/20	JU.Z	IN/A	140		'	Tieron Dibber 1	The pump in LCS-3D was non-operational on 12/10/20 after the liquid level
LCS-3D	12/10/20	59.2	N/A	140		Y	Heron Dipper T	measurement. Pump repairs are scheduled to be completed on 12/14/20.
LUJ-3D	12/10/20	J3.Z	IN/A	140		ī	петоп пірреі т	The pump in LCS-3D was non-operational on 12/10/20 after the liquid level
								measurement. Pump repairs were completed on 12/14/20. The pump was fully
LCS-3D	12/18/20	62.9	N/A	140		Y	Heron Dipper T	operational for the rest of the reporting period.
LCS-3D	12/16/20	66.0	N/A N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	12/24/20	67.7	N/A N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
เดอ-งก	12/31/20	1.10	IN/A	140		į r	петоп піррег і	rump operational, liquid level measured manually

LCS-3D Liquid Level Below Ground Surface

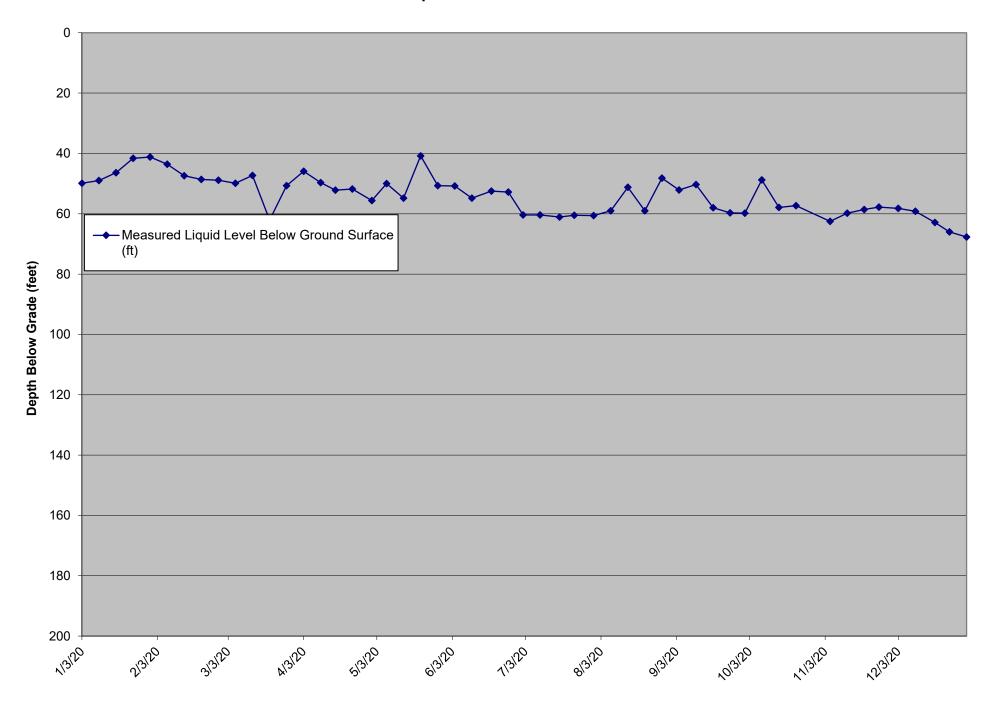


	Date	Measured Liquid	Transducer Depth	Base of Sump	Pump on during		
	Reading	Level Below Ground	from Top of Casing	Elevation	measurement?		
LCS Number	Collected	Surface (ft)	(Ft.)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 4B	1/3/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/10/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/17/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/24/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/31/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/7/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/14/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/21/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/28/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/6/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/13/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/20/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/27/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/3/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/10/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/16/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/23/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/30/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/7/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/14/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/21/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/28/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/4/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/11/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/18/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/26/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/2/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/9/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/16/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/23/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/31/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/7/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/14/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/21/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/28/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/4/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/11/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/18/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/25/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/1/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/8/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/15/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/22/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/29/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/5/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/12/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/19/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/25/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/3/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/10/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/18/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/24/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/31/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS

LCS-4B Liquid Level Below Ground Surface

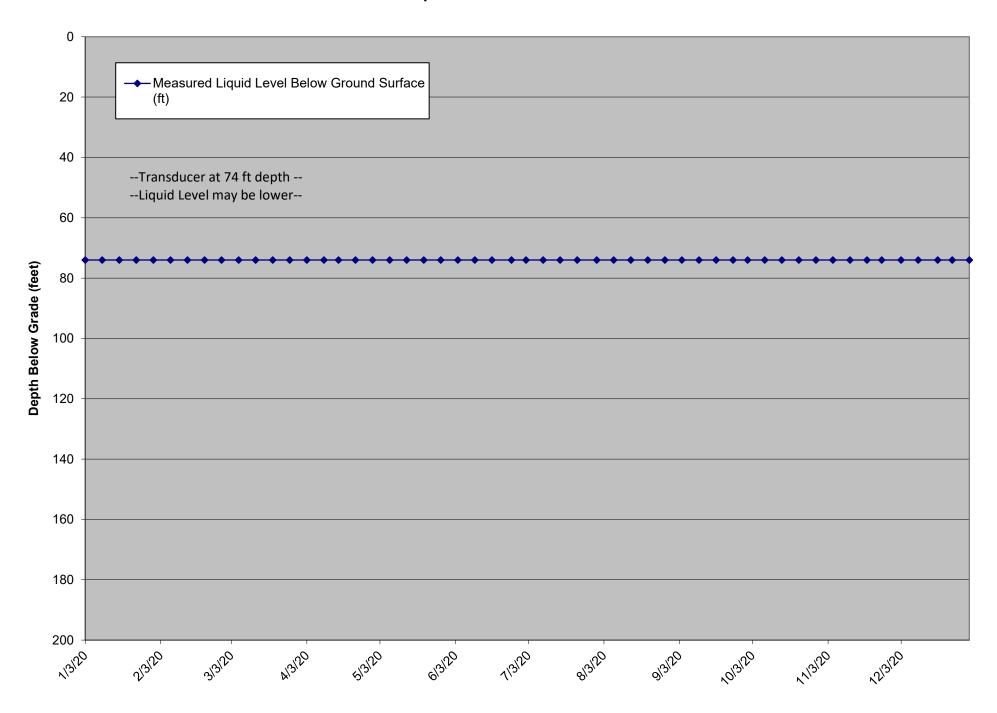

	D-4-	Manager	Tanandoran Hainbé	Df C			D		
	Date Reading	Measured Liquid Level Above	Transducer Height above Floor of	Base of Sump Elevation	Height of	Elevation of Leachate	Pump on during measurement?		
LCS Number	Collected	Transducer (Ft.)	Quarry (Ft.)	(Ft. MSL)	Liquid (ft)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 5B	1/3/20	11.3	21.9	235.3	33.2	268.50	Y	Dedicated Transducer	Comments
LCS- 5B	1/10/20	12.4	21.9	235.3	34.3	269.60	Ý	Dedicated Transducer	
LCS- 5B	1/17/20	11.3	21.9	235.3	33.2	268.50	Y	Dedicated Transducer	
LCS- 5B	1/24/20	13.0	21.9	235.3	34.9	270.20	Y	Dedicated Transducer	
LCS- 5B	1/31/20	11.7	21.9	235.3	33.6	268.90	Y	Dedicated Transducer	
LCS- 5B	2/7/20	12.6	21.9	235.3	34.5	269.80	Y	Dedicated Transducer	
LCS- 5B	2/14/20	12.3	21.9	235.3	34.2	269.50	Y	Dedicated Transducer	
LCS- 5B	2/21/20	11.3	21.9	235.3	33.2	268.50	Y	Dedicated Transducer	
LCS- 5B	2/28/20	11.6	21.9	235.3	33.5	268.80	Y	Dedicated Transducer	
LCS- 5B	3/6/20	10.3	21.9	235.3	32.2	267.50	Y	Dedicated Transducer	
LCS- 5B	3/13/20	11.2	21.9	235.3	33.1	268.40	Υ	Dedicated Transducer	
LCS- 5B	3/20/20	12.3	21.9	235.3	34.2	269.50	Y	Dedicated Transducer	
LCS- 5B	3/27/20	12.2	21.9	235.3	34.1	269.40	Y	Dedicated Transducer	
LCS- 5B	4/3/20	11.9	21.9	235.3	33.8	269.10	Υ	Dedicated Transducer	
LCS- 5B	4/9/20	10.9	21.9	235.3	32.8	268.10	Y	Dedicated Transducer	
LCS- 5B	4/16/20	11.3	21.9	235.3	33.2	268.50	Y	Dedicated Transducer	
LCS- 5B	4/23/20	10.4	21.9	235.3	32.3	267.60	Y	Dedicated Transducer	
LCS- 5B	4/30/20	11.7	21.9	235.3	33.6	268.90	Y	Dedicated Transducer	
LCS- 5B	5/7/20	10.1	21.9	235.3	32.0	267.30	Y	Dedicated Transducer	
LCS- 5B	5/14/20	12.0	21.9	235.3	33.9	269.20	Y	Dedicated Transducer	
LCS- 5B	5/21/20	11.7	21.9	235.3	33.6	268.90	Y	Dedicated Transducer	
LCS- 5B	5/28/20	11.2	21.9	235.3	33.1	268.40	Y	Dedicated Transducer	
LCS- 5B	6/4/20	11.1	21.9	235.3	33.0	268.30	Y	Dedicated Transducer	
LCS- 5B	6/11/20	11.6	21.9	235.3	33.5	268.80	Y	Dedicated Transducer	
LCS- 5B	6/18/20	9.3	21.9	235.3	31.2	266.50	Y	Dedicated Transducer	
LCS- 5B	6/25/20	11.4	21.9	235.3	33.3	268.60	Y	Dedicated Transducer	
LCS- 5B	7/2/20	8.9	21.9	235.3	30.8	266.10	Y	Dedicated Transducer	
LCS- 5B LCS- 5B	7/9/20 7/16/20	10.0 8.3	21.9 21.9	235.3 235.3	31.9 30.2	267.20 265.50	Y	Dedicated Transducer	
LCS- 5B	7/16/20	12.4	21.9	235.3	34.3	269.60	Y	Dedicated Transducer	
LCS- 5B	7/31/20	13.0	21.9	235.3	34.3	270.20	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	8/7/20	11.1	21.9	235.3	33.0	268.30	Y	Dedicated Transducer	
LCS- 5B	8/14/20	14.0	21.9	235.3	35.9	271.20	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	8/21/20	14.1	21.9	235.3	36.0	271.30	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	8/28/20	13.1	21.9	235.3	35.0	270.30	Y	Dedicated Transducer Dedicated Transducer	
LCG- 3B	0/20/20	10.1	21.0	200.0	33.0	210.50	<u>'</u>	Dedicated Transducer	The LCS-5B pump was turned off on 8/31/20 for forcemain
									repairs. Forcemain repairs are anticipated to be completed the
LCS- 5B	9/4/20	82.1	21.9	235.3	104.0	339.30	N	Dedicated Transducer	week of 9/7/20.
E00 0B	5/4/20	02.1	21.0	200.0	104.0	000.00	.,	Dedicated Transactor	The LCS-5B pump was turned off on 8/31/20 for forcemain
									repairs. Forcemain repairs are anticipated to be completed the
LCS- 5B	9/11/20	84.7	21.9	235.3	106.6	341.90	N	Dedicated Transducer	week of 9/7/20.
									The LCS-5B pump was replaced on 9/17/20 and was fully
LCS- 5B	9/18/20	15.0	21.9	235.3	36.9	272.20	Y	Dedicated Transducer	operational.
						1	1		The LCS-5B transducer was found to be non-operational on
						1	ĺ		9/21/20. The transducer was replaced on 9/24/20 and was fully
LCS- 5B	9/25/20	14.1	21.9	235.3	36.0	271.30	Y	Dedicated Transducer	operational.
LCS- 5B	10/1/20	13.9	21.9	235.3	35.8	271.10	Y	Dedicated Transducer	·
LCS- 5B	10/8/20	14.0	21.9	235.3	35.9	271.20	Y	Dedicated Transducer	
LCS- 5B	10/15/20	14.1	21.9	235.3	36.0	271.30	Y	Dedicated Transducer	
LCS- 5B	10/22/20	14.8	21.9	235.3	36.7	272.00	Y	Dedicated Transducer	
LCS- 5B	10/29/20	14.2	21.9	235.3	36.1	271.40	Υ	Dedicated Transducer	
LCS- 5B	11/5/20	14.1	21.9	235.3	36.0	271.30	Υ	Dedicated Transducer	
LCS- 5B	11/12/20	14.1	21.9	235.3	36.0	271.30	Υ	Dedicated Transducer	
LCS- 5B	11/19/20	14.2	21.9	235.3	36.1	271.40	Υ	Dedicated Transducer	
LCS- 5B	11/25/20	14.1	21.9	235.3	36.0	271.30	Υ	Dedicated Transducer	
LCS- 5B	12/3/20	14.2	21.9	235.3	36.1	271.40	Y	Dedicated Transducer	
LCS- 5B	12/10/20	14.0	21.9	235.3	35.9	271.20	Y	Dedicated Transducer	
LCS- 5B	12/18/20	13.9	21.9	235.3	35.8	271.10	Y	Dedicated Transducer	
LCS- 5B	12/24/20	14.0	21.9	235.3	35.9	271.20	Y	Dedicated Transducer	
LCS- 5B	12/31/20	13.9	21.9	235.3	35.8	271.10	Υ	Dedicated Transducer	


LCS-5B Liquid Level Above Quarry Floor

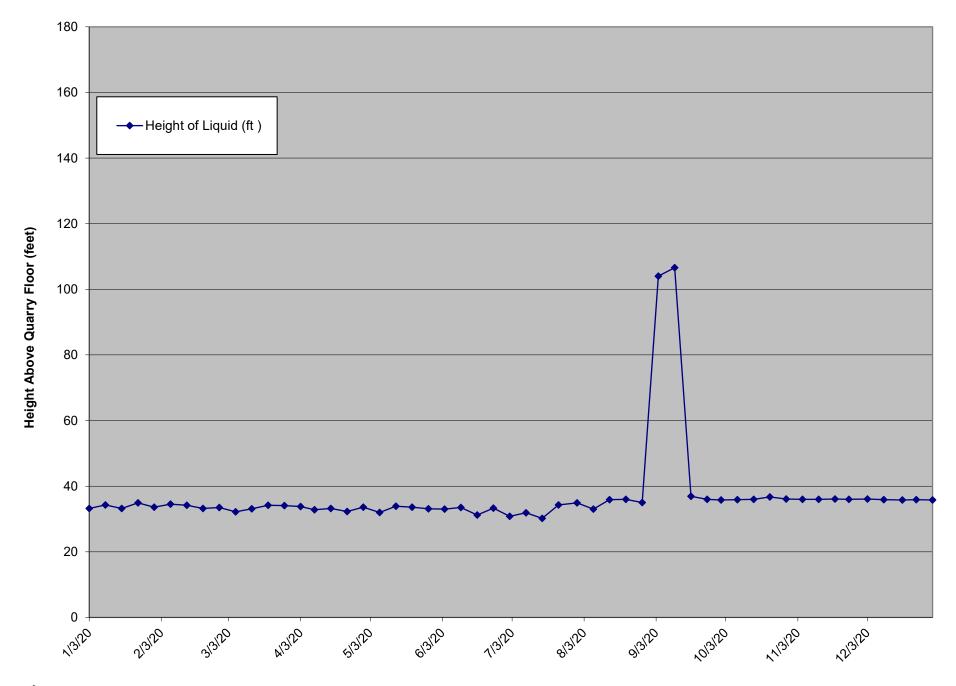

^{*}The LCS-5B pump was turned off on 8/31/20 for forecmain repairs leading to an increase in liquid level. The pump was replaced on 9/17/20.

1					ı				
	Date		Transducer Height	Base of Sump		Elevation of	Pump on during		
LCS Number	Reading Collected	v	above Floor of Quarry (Ft.)	Elevation (Ft. MSL)	Height of Liquid (ft)	Leachate (Ft. MSL)	measurement? (Y/N)	Liquid level meter used	Comments
LCS Number	1/3/20	10.1	9.4	429.52	19.5	449.02	(1/N) Y		Confinents
LCS- 6B	1/10/20	9.2	9.4	429.52 429.52	19.5	449.02 448.12	Y	Dedicated Transducer Dedicated Transducer	
LCS- 0B	1/10/20	9.2	9.4	429.52	10.0	440.12	T	Dedicated Transducer	The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is
LCS- 6B	1/17/20		9.4	429.52			N	Dedicated Transducer	pending replacement parts arrival.
LCS- 0B	1/1//20		9.4	429.52		1	IN	Dedicated Transducer	The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is
LCS- 6B	1/24/20		9.4	429.52			N	Dedicated Transducer	pending replacement parts arrival.
LCS- 0B	1/24/20		9.4	429.52		1	IN	Dedicated Transducer	
LCS- 6B	1/31/20		9.4	429.52			N	Dedicated Transducer	The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is
LCS- 6B	1/31/20		9.4	429.52			N	Dedicated Fransducer	pending replacement parts arrival. The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is
100.00	0/7/00		9.4	429.52			N	Dedicated Taxas duran	pending replacement parts arrival.
LCS- 6B	2/7/20		9.4	429.52			N	Dedicated Transducer	
100.00	0/44/00			100 50					The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is
LCS- 6B	2/14/20		9.4	429.52			N	Dedicated Transducer	pending replacement parts arrival.
100.00	0/04/00			100 50		457.00			The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is
LCS- 6B	2/21/20	N/A	N/A	429.52	27.8	457.32	N	Heron Dipper T	pending replacement parts arrival. Liquid level was measured manually.
									The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is
LCS- 6B	2/28/20	N/A	N/A	429.52	28.3	457.82	N	Heron Dipper T	tentatively scheduled the week of 3/9/20. Liquid level was measured manually.
									The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is
LCS- 6B	3/6/20	N/A	N/A	429.52	28.0	457.52	N	Heron Dipper T	scheduled for 3/11/20. Liquid level was measured manually.
	1 1					1			The LCS-6B transducer was replaced on 3/11/20 and the pump became fully operational. The LCS
									6B pump was observed to be non-operational on 3/12/20. The LCS-6B pump was replaced on
LCS- 6B	3/13/20	12.5	9.4	429.52	21.9	451.42	Υ	Dedicated Transducer	3/13/20. LCS-6B became fully operational on 3/13/20.
LCS- 6B	3/20/20	12.3	9.4	429.52	21.7	451.22	Y	Dedicated Transducer	
LCS- 6B	3/27/20	11.9	9.4	429.52	21.3	450.82	Υ	Dedicated Transducer	
LCS- 6B	4/3/20	11.5	9.4	429.52	20.9	450.42	Υ	Dedicated Transducer	
LCS- 6B	4/10/20	12.0	9.4	429.52	21.4	450.92	Y	Dedicated Transducer	
LCS- 6B	4/16/20	12.4	9.4	429.52	21.8	451.32	Υ	Dedicated Transducer	
									The LCS-6B VFD was observed to be non-operational on 4/23/20. The VFD was replaced on
									4/23/20 and LCS-6B became fully operational. A level sensor reading was not collected during the
LCS- 6B	4/23/20		9.4	429.52			Υ	Dedicated Transducer	weekly reporting period due to VFD communication loss with the site's SCADA system.
LCS- 6B	4/30/20	8.9	9.4	429.52	18.3	447.82	Υ	Dedicated Transducer	
LCS- 6B	5/7/20	9.0	9.4	429.52	18.4	447.92	Υ	Dedicated Transducer	
LCS- 6B	5/14/20	13.3	9.4	429.52	22.7	452.22	Υ	Dedicated Transducer	
LCS- 6B	5/21/20	13.3	9.4	429.52	22.7	452.22	Υ	Dedicated Transducer	
LCS- 6B	5/28/20	7.8	9.4	429.52	17.2	446.72	Υ	Dedicated Transducer	
LCS- 6B	6/4/20	8.9	9.4	429.52	18.3	447.82	Υ	Dedicated Transducer	
LCS- 6B	6/11/20	7.9	9.4	429.52	17.3	446.82	Υ	Dedicated Transducer	
LCS- 6B	6/18/20	8.9	9.4	429.52	18.3	447.82	Υ	Dedicated Transducer	
LCS- 6B	6/25/20	8.7	9.4	429.52	18.1	447.62	Y	Dedicated Transducer	
LCS- 6B	7/2/20	9.2	9.4	429.52	18.6	448.12	Υ	Dedicated Transducer	
LCS- 6B	7/9/20	9.0	9.4	429.52	18.4	447.92	Υ	Dedicated Transducer	
LCS- 6B	7/16/20	8.7	9.4	429.52	18.1	447.62	Υ	Dedicated Transducer	
LCS- 6B	7/23/20	8.6	9.4	429.52	18.0	447.52	Υ	Dedicated Transducer	
LCS- 6B	7/31/20	8.6	9.4	429.52	18.0	447.52	Υ	Dedicated Transducer	
LCS- 6B	8/7/20	8.4	9.4	429.52	17.8	447.32	Υ	Dedicated Transducer	
LCS- 6B	8/14/20	8.7	9.4	429.52	18.1	447.62	Υ	Dedicated Transducer	
LCS- 6B	8/21/20	7.2	9.4	429.52	16.6	446.12	Υ	Dedicated Transducer	
LCS- 6B	8/28/20	8.5	9.4	429.52	17.9	447.42	Υ	Dedicated Transducer	
	1							-	The LCS-6B pump was turned off on 8/31/20 for forcemain repairs. Forcemain repairs are
LCS- 6B	9/4/20	15.5	9.4	429.52	24.9	454.42	N	Dedicated Transducer	anticipated to be completed the week of 9/7/20.
									The LCS-6B pump was turned off on 8/31/20 for forcemain repairs. Forcemain repairs are
LCS- 6B	9/11/20	19.4	9.4	429.52	28.8	458.32	N	Dedicated Transducer	anticipated to be completed the week of 9/7/20.
									· · · · · ·
									The LCS-6B pump was turned off on 8/31/20 for forcemain repairs. Forcemain repairs were
									completed on 9/9/20. The pump in LCS-6B was non-operational when attempts were made to turn i
LCS- 6B	9/18/20	20.1	9.4	429.52	29.5	459.02	N	Dedicated Transducer	back on after forcemain repairs. Pump repairs are tentatively scheduled for the week of 9/21/20.
	0, 10, 20		• • • • • • • • • • • • • • • • • • • •						The LCS-6B pump was turned off on 8/31/20 for forcemain repairs. Forcemain repairs were
									completed on 9/9/20. The pump in LCS-6B was non-operational when attempts were made to turn i
	j !					1			back on after forcemain repairs. The electric pump in LCS-6B will be converted to a pneumatic
LCS- 6B	9/25/20	N/A	N/A	429.52	24.1	453.62	N	Heron Dipper T	pump the week of 9/28/20. Liquid level was measured manually.
200 00	5,25,25	1971	14/1	120.02		.00.02		. Ioron Dippor 1	The electric pump in LCS-6B was converted to a pneumatic pump on 9/30/20. Liquid level was
LCS- 6B	10/1/20	N/A	N/A	429.52	14.3	443.82	· ·	Heron Dipper T	measured manually.
LCS- 6B	10/8/20	N/A	N/A	429.52	6.9	436.42	Ϋ́	Heron Dipper T	
LCS- 6B	10/0/20	N/A	N/A	429.52	7.1	436.62	Y	Heron Dipper T	
LCS- 6B	10/13/20	N/A	N/A	429.52	7.1	437.02	Y	Heron Dipper T	
LCS- 6B	10/29/20	N/A	N/A	429.52	8.0	437.52	Ÿ	Heron Dipper T	
LCS- 6B	11/5/20	N/A	N/A	429.52	5.3	434.82	Y	Heron Dipper T	
LCS- 6B	11/5/20	N/A N/A	N/A N/A	429.52	5.8	434.82	Y	Heron Dipper T	
LCS- 6B	11/12/20	N/A N/A	N/A N/A	429.52	5.8	435.32	Y	Heron Dipper T	
LCS- 6B	11/19/20	N/A N/A	N/A	429.52	5.3	434.82	Y	Heron Dipper T	
LU3- 0D			N/A N/A	429.52	5.0	434.52	Y	Heron Dipper T	
LCC CB					5.0	434.52	Y		1
LCS- 6B	12/3/20	N/A			5.0	12F 22	V	Horon Dinner T	
LCS- 6B	12/3/20 12/10/20	N/A	N/A	429.52	5.8	435.32	Y	Heron Dipper T	
LCS- 6B LCS- 6B	12/3/20 12/10/20 12/18/20	N/A N/A	N/A N/A	429.52 429.52	5.2	434.72	· Y	Heron Dipper T	
LCS- 6B	12/3/20 12/10/20	N/A	N/A	429.52					Pump operational; liquid level measured manually

LCS-6B Liquid Level Above Quarry Floor

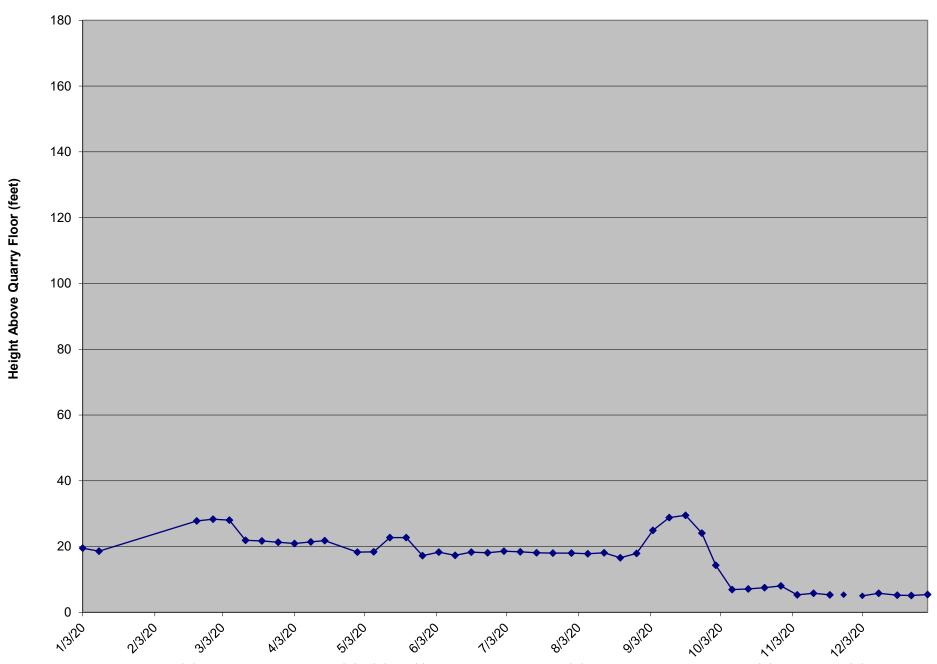

The transducer became non-operational on 1/13/20. Liquid level was measured manually on 2/21/20, 2/28/20 and 3/6/20. The transducer became operational on 3/13/20. The VFD was observed to be non-operational on 4/23/20, it was replaced on 4/23/20, however the level sensor reading was not taken due to VFD communication loss with SCADA. The LCS-6B pump was turned off on 8/31/20 for forcemain repairs leading to an increase in liquid level. The electric pump was converted to a pneumatic pump on 9/30/20.