
	na.	Secret oper	Translater Bugli	Name of Street	tupo sary		
-	Ш			Н	-	****	
i	Ш		i	H	4		
	Ш						
-	ı		-	ı	ŀ	*****	
	Ш		H	Ш	Н		
Ħ	Ш	H	H	Н	Н		
	Ш						
	ı	H		Н			
Ħ	Ш	Н		Н	+		
ľ	Ш	ľ	i	H			
	ı		-		-		
	Ш	H	H	Ш	Н		
10.5	100		- 27		1	Name Control	
100.00	w		974	-	1	Named Tarabase	for the barriers of the forest about the for the plants of
	Ш						
-	Ш			Н	-		
Н	Ш						
H	Ш		H	Ш	1		
	ı			H	+		
100.00	i		97	2		NAME AND ADDRESS OF	Top the selection began to be shall always the
	ı						Top Fix servers began to the approximate a real
							Any Pin remain Inguistable specialistic countries of the Pin remain Inguistable special state in the
	ı						Any Pin removes from extensive operant characteristic for Any Pin removes from an installed operant polymerous
100.0	Name of		101	-		Temporary	Any Pir remova has an earlier special paper and Any Pir remova has an earlier special paper and
10.0	Name of		-	-		Name Tools	They are not to be an executive part of the land of th
100.00	B	I	90			NAME AND ADDRESS OF	Ang Pin samura Fagusi kantan apamatanjan kat Ang Pin samura Fagusi kantan apamatanjan kat
	1			Н	-		They are not to the second property of the last of the second points of
	1						The second secon
	ш		-		Ė		
	E		Ē	E	Ė	-	
==	Ħ		-		▆	-	
MAX.	100		W/ W/	=	=	NAME AND ADDRESS OF	The same department of the same of
175.76 175.76	100		97 97	200	-	TATAL TATAL	Top open department and the bound
							No observation to an investment of the
ᄐ	Ē	E	ᄐ	E	ĿΞ		THE PROPERTY OF THE PROPERTY OF THE
ᄐ	Ē	E	ᄐ	E	ĿΞ		Mark you wishes below a first from the common of the first party with the common of the first party and the common of the first party with the common of the common of the first party with the common of the common
Œ	Е		E	E	E		Married State Control of the Control
10.0	10			×		NAME AND ADDRESS OF	Mark you will be seen about 1977 Francisco and
10.0	1		i	ı	-	bractota.	Mark you was a super of the Topics of the San Annual Conference of the San
100.00	H			1	-	Name To Add	Mark part and the second second frequency of the
	Н			Н	-		Maria per antico alcono del Control de Contr
	П						Not you work to be a first to
	Н						Mark park makes before and the forest particular
10.0	I		-	1		NAME AND ADDRESS OF	Mark you washe some order frequency or grown
MAX.	100		90	AN AN		Telephone Telephone	Mark party and the second second Property and the second s
MAX.	100		90	AN AN		Telephone Telephone	Mark party and the second second Property and the second s
1	Н	I		l			Marie party maries and an artist for the first special con-
	Н			Н			Married with high, chief from the same
	Н			Н			Mark you with the second of the following of the
	Н			Н			Mark you with the second of the following of the
10.0	8			×		NAME AND ADDRESS OF	Mark you will be seen about 1977 Francisco and
10.7	ī		90	N.		NAME AND ADDRESS OF THE PARTY NAME A	Mark part and the second second frequency of the
100.0	ш			1	-	Name To Add	Mark part and the second second frequency of the
	Н						AND DESCRIPTION OF THE PARTY OF
	Н						Not you wish to be a selected for the selected from
	Н			Н			Mark print makes before and "The Particular and makes
10.0	10		-	1		NAME AND ADDRESS OF	Mark you washe some order from the property or grown
MAX.	100		90	AN AN		Telephone Telephone	Mark party material sections and the Property of State of
MAX.	100		90	AN AN		Telephone Telephone	Mark party material sections and the Property of State of
	П		-	-			Mark party and the second active of Party Control of States of Sta
	Н		-	-			Not you was a supply of the foreign services.
1	ı	I		l			Mark you within below of the frequency of the same
	Н			Н			Mark you with the second of the following of the
10.0	ř			×		NAME AND ADDRESS OF	Mark you will be seen about 1977 Francisco and
10.0	í		i	ı	-	bractota.	Mark you was a super of the Topics of the San Annual Conference of the San
-	н		ı	Н	-		Mark you was a super of the Topics of the San Annual Conference of the San
=	F		=		⊨		Mark you within supply and it is not to be a second
=	F		=		⊨		
=	F		=		⊨		
10.0	-		-	=	-	NAME TO AN	
10.0	100		97	=	-	Mariotal Mariotal	Mark you work to have a love to be a love of the love
US N	-		W)	=	-	terectore:	Mark you work to provide the foreign of the control
=	F			=	⊨		Mary and the same of the same
	E			=	=		The second secon
=	F			=	⊨		Market and Market Street Control of the Control of
=	F			=	⊨		Mark you within the part of the first property of the same of the
10.0	7		W/	-		NAME AND ADDRESS OF THE PARTY NAME A	Mark park and the control of the con
10.0	1		97	=	-	Mariotal Mariotal	Mark you work to have a love to be a love of the love
_	E						Mary and the same of the same
_	E						NAME AND ADDRESS OF THE OWNER, WHEN PERSONS ADDRESS
	E			=	=		Marine with the second state of the second sta
_	E						Manager and the same of the sa
100 N	Ε		W.	-	-	TATAL TATAL	Mary and the second back of the second
15 N	-		W	20	-	TATAL TATAL	Market and the same of the sam
10.0	E		-	_	Ε.	NAME AND ADDRESS OF THE PARTY O	Mary and white superior of the second
Ξ	Ē	Ē	Ξ	Ē	E		Market State
	Ë				ᆮ		Mark you within suggest of CE Annual Confession of Center of Cente
Ξ	Ē	Ē	Ξ	Ē	E		Markey while the service of the serv
10.7	=	-	-	-	ΗĒ	bearing -	Market and refer to the particular to
MA.W	=		97	AV.	÷	handon.	Mark you with course of the free best production.
	į		-	-	-	NAME TO AN	Mark you with course of the free best production.
100.00			=	=	Ė		And the second second
	Ε				⊨		Act of the last of
			_		_		Mark you within the part of the first property of the same of the
				Н			
							Married States and Company of the Co
					÷	terestone terestone	Manager white water bright to be a series of the series of
				111111	-	honertone honertone honertone	
						Total Total	And the party of the control of the
						Total Yorks Separation Separation Separation Separation	And a second sec
			***************************************			TOTAL TOTAL STREET, ST	
						TOTAL TOTAL	
			2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2				
						TOTAL TOTAL STATE OF THE STATE	

	Date	Measured Liquid	Transducer Height	Base of Sump	Elevation of	Pump on during		
	Reading	Level Above	above Floor of	Elevation	Leachate	measurement?		
LCS Number	Collected	Transducer (Ft.)	Quarry (Ft.)	(Ft. MSL)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 2D	1/17/20	N/A	14.4	235.92	, ,	N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/24/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/31/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/7/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/14/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/21/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/28/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/6/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/13/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/20/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/27/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/3/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/10/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/16/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/23/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/30/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/7/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/14/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/21/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/28/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/4/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/11/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/18/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/25/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/2/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/9/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/16/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/23/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/31/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/7/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/14/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/21/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/28/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/4/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/11/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/18/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/25/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	10/1/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	10/8/20	N/A	14.4 14.4	235.92 235.92		N N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	10/15/20 10/22/20	N/A N/A	14.4	235.92		N N	Dedicated Transducer Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
	10/22/20		14.4	235.92		N N		PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	10/29/20	N/A N/A	14.4	235.92		N N	Dedicated Transducer Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	11/5/20	N/A N/A	14.4	235.92		N N	Dedicated Transducer Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	11/12/20	N/A N/A	14.4	235.92		N N	Dedicated Transducer Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/3/20	N/A N/A	14.4	235.92		N N	Dedicated Transducer Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/3/20	N/A N/A	14.4	235.92		N N	Dedicated Transducer Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/10/20	N/A N/A	14.4	235.92		N N	Dedicated Transducer Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/16/20	N/A N/A	14.4	235.92		N N	Dedicated Transducer Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/24/20	N/A N/A	14.4	235.92		N N	Dedicated Transducer Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/7/21	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/1/21	N/A N/A	14.4	235.92		N N	Dedicated Transducer Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LU3- ZD	1/14/21	IN/A	14.4	233.92		IN	Dedicated Hallsducer	r or installed to depth of 02 1003, falled stator, fleeds replacement


				Well Total Depth				
	Date	Measured Liquid	Transducer Depth	from Top of	Elevation of	Pump on during		
	Reading	Level Below Ground	from Top of Casing	Casing (Ft.)	Leachate	measurement?		
LCS Number	Collected	Surface (ft)	(Ft.)	(Ft. MSL)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS-3D	1/17/20	46.4	N/A	140	(I t. IVIOL)	Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/24/20	41.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/31/20	41.2	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/7/20	43.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/14/20	47.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/21/20	48.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/21/20	48.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/6/20	49.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/13/20	47.3	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/20/20	62.1	N/A	140		Y		
						· ·	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/27/20	50.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/3/20	45.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/10/20	49.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/16/20	52.2	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/23/20	51.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/1/20	55.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/7/20	50.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/14/20	54.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/21/20	40.8	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/28/20	50.7	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/4/20	50.8	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/11/20	54.8	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/19/20	52.5	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/26/20	52.8	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/2/20	60.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/9/20	60.4	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/17/20	61.1	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/23/20	60.5	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/31/20	60.6	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/7/20	59.0	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/14/20	51.2	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/21/20	59.0	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/28/20	48.2	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/4/20	52.1	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/11/20	50.3	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/18/20	58.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/25/20	59.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/1/20	59.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/8/20	48.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/15/20	57.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/22/20	57.3	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/5/20	62.5	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/12/20	59.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/19/20	58.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/25/20	57.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	12/3/20	58.2	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
200 00	, 5,	55.2	. 4/13	. 10		<u>'</u>		The pump in LCS-3D was non-operational on 12/10/20 after the liquid level
LCS-3D	12/10/20	59.2	N/A	140		Y	Heron Dipper T	measurement. Pump repairs are scheduled to be completed on 12/14/20.
LUG-3D	12/10/20	J3.2	111/71	140		<u>'</u>	Heloli Dibbei 1	The pump in LCS-3D was non-operational on 12/10/20 after the liquid level
								measurement. Pump repairs were completed on 12/10/20. The pump was fully
LCS-3D	12/18/20	62.9	N/A	140		Y	Heron Dipper T	operational for the rest of the reporting period.
LCS-3D LCS-3D	12/18/20	62.9	N/A N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D LCS-3D			N/A N/A	140		Y		
しいろ-3D	12/31/20	67.7	IN/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
1.00.00	4/7/04	46.4	N1/A	440		ļ ,.		The pump in LCS-3D was non-operational from 1/3/21 - 1/7/21. The pump was
LCS-3D	1/7/21	49.4	N/A	140		N	Heron Dipper T	repaired and became fully operational on 1/8/21.
	4/4.4/07	540		440			5: -	The pump in LCS-3D was non-operational from 1/11/21 - 1/13/21. The pump was
LCS-3D	1/14/21	54.8	N/A	140		Y	Heron Dipper T	repaired and became fully operational on 1/14/21.

LCS-3D Liquid Level Below Ground Surface

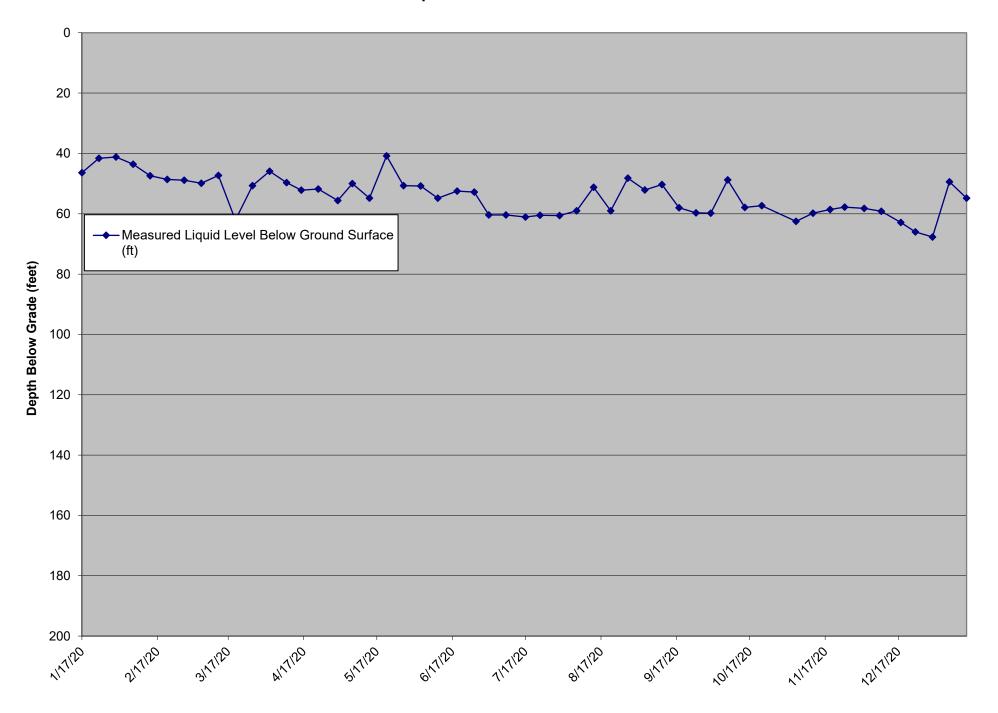


	Date	Measured Liquid	Transducer Depth	Base of Sump	Pump on during		
	Reading	Level Below Ground	from Top of Casing	Elevation	measurement?		
LCS Number	Collected	Surface (ft)	(Ft.)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 4B	1/17/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/24/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/31/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/7/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/14/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/21/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/28/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/6/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/13/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/20/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/27/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/3/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/10/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/16/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/23/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/30/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/7/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/14/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/21/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/28/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/4/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/11/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/18/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/26/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/2/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/9/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/16/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/23/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/31/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/7/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/14/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/21/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/28/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/4/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/11/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/18/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/25/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/1/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/8/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
	10/15/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
	10/22/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
	10/29/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/5/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
	11/12/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
	11/19/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
	11/25/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/3/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/10/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/18/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/24/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/31/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/7/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/14/21	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS

LCS-4B Liquid Level Below Ground Surface

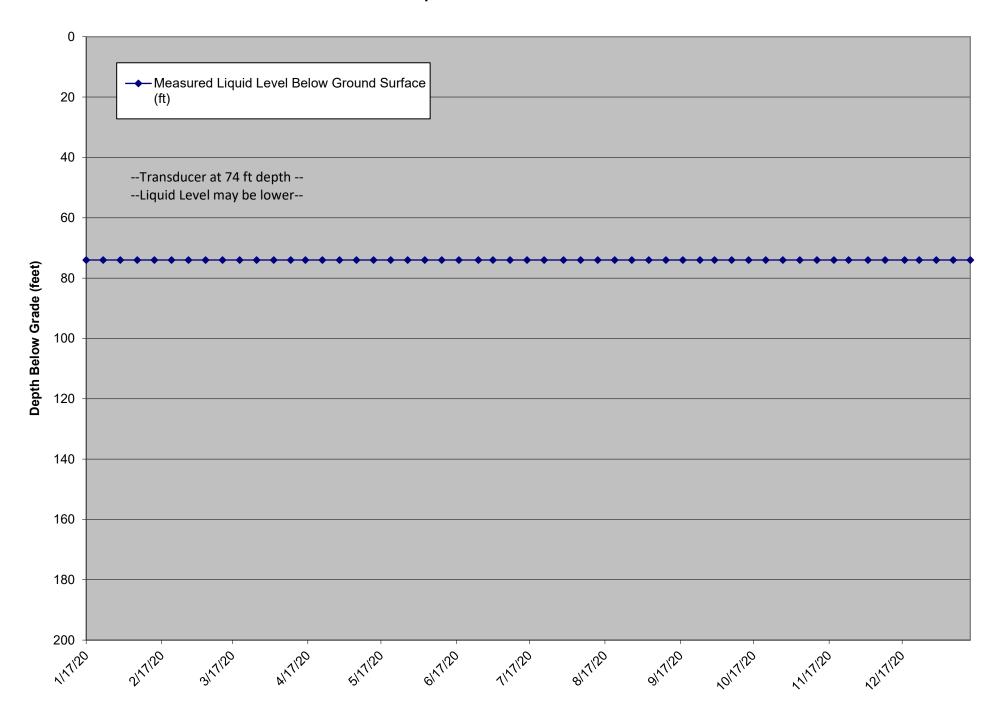

	D-4-	Manageral Linesia	Tanandoran Hainbé	D			Donas an donica		
	Date Reading	Measured Liquid Level Above	Transducer Height above Floor of	Base of Sump Elevation	Height of	Elevation of Leachate	Pump on during measurement?		
LCS Number	Collected	Transducer (Ft.)	Quarry (Ft.)	(Ft. MSL)	Liquid (ft)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 5B	1/17/20	11.3	21.9	235.3	33.2	268.50	Y	Dedicated Transducer	
LCS- 5B	1/24/20	13.0	21.9	235.3	34.9	270.20	Y	Dedicated Transducer	
LCS- 5B	1/31/20	11.7	21.9	235.3	33.6	268.90	Y	Dedicated Transducer	
LCS- 5B	2/7/20	12.6	21.9	235.3	34.5	269.80	Υ	Dedicated Transducer	
LCS- 5B	2/14/20	12.3	21.9	235.3	34.2	269.50	Υ	Dedicated Transducer	
LCS- 5B	2/21/20	11.3	21.9	235.3	33.2	268.50	Υ	Dedicated Transducer	
LCS- 5B	2/28/20	11.6	21.9	235.3	33.5	268.80	Υ	Dedicated Transducer	
LCS- 5B	3/6/20	10.3	21.9	235.3	32.2	267.50	Y	Dedicated Transducer	
LCS- 5B	3/13/20	11.2	21.9	235.3	33.1	268.40	Y	Dedicated Transducer	
LCS- 5B	3/20/20	12.3	21.9	235.3	34.2	269.50	Y	Dedicated Transducer	
LCS- 5B	3/27/20	12.2	21.9	235.3	34.1	269.40	Y	Dedicated Transducer	
LCS- 5B	4/3/20	11.9	21.9	235.3	33.8	269.10	Y	Dedicated Transducer	
LCS- 5B LCS- 5B	4/9/20 4/16/20	10.9 11.3	21.9 21.9	235.3 235.3	32.8 33.2	268.10 268.50	Y	Dedicated Transducer	
LCS- 5B	4/16/20	10.4	21.9	235.3	32.3	267.60	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	4/30/20	11.7	21.9	235.3	33.6	268.90	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	5/7/20	10.1	21.9	235.3	32.0	267.30	Y	Dedicated Transducer	
LCS- 5B	5/14/20	12.0	21.9	235.3	33.9	269.20	Y	Dedicated Transducer	
LCS- 5B	5/21/20	11.7	21.9	235.3	33.6	268.90	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	5/28/20	11.2	21.9	235.3	33.1	268.40	Ϋ́	Dedicated Transducer	
LCS- 5B	6/4/20	11.1	21.9	235.3	33.0	268.30	Y	Dedicated Transducer	
LCS- 5B	6/11/20	11.6	21.9	235.3	33.5	268.80	Y	Dedicated Transducer	
LCS- 5B	6/18/20	9.3	21.9	235.3	31.2	266.50	Y	Dedicated Transducer	
LCS- 5B	6/25/20	11.4	21.9	235.3	33.3	268.60	Y	Dedicated Transducer	
LCS- 5B	7/2/20	8.9	21.9	235.3	30.8	266.10	Y	Dedicated Transducer	
LCS- 5B	7/9/20	10.0	21.9	235.3	31.9	267.20	Y	Dedicated Transducer	
LCS- 5B	7/16/20	8.3	21.9	235.3	30.2	265.50	Υ	Dedicated Transducer	
LCS- 5B	7/23/20	12.4	21.9	235.3	34.3	269.60	Y	Dedicated Transducer	
LCS- 5B	7/31/20	13.0	21.9	235.3	34.9	270.20	Υ	Dedicated Transducer	
LCS- 5B	8/7/20	11.1	21.9	235.3	33.0	268.30	Y	Dedicated Transducer	
LCS- 5B	8/14/20	14.0	21.9	235.3	35.9	271.20	Y	Dedicated Transducer	
LCS- 5B	8/21/20	14.1	21.9	235.3	36.0	271.30	Y	Dedicated Transducer	
LCS- 5B	8/28/20	13.1	21.9	235.3	35.0	270.30	Y	Dedicated Transducer	The LCC FD
									The LCS-5B pump was turned off on 8/31/20 for forcemain repairs. Forcemain repairs are anticipated to be completed the
LCS- 5B	9/4/20	82.1	21.9	235.3	104.0	339.30	N	Dedicated Transducer	week of 9/7/20.
LOO- 3D	3/4/20	02.1	21.0	200.0	104.0	339.30	IN .	Dedicated Transducer	The LCS-5B pump was turned off on 8/31/20 for forcemain
									repairs. Forcemain repairs are anticipated to be completed the
LCS- 5B	9/11/20	84.7	21.9	235.3	106.6	341.90	N	Dedicated Transducer	week of 9/7/20.
									The LCS-5B pump was replaced on 9/17/20 and was fully
LCS- 5B	9/18/20	15.0	21.9	235.3	36.9	272.20	Υ	Dedicated Transducer	operational.
									The LCS-5B transducer was found to be non-operational on
									9/21/20. The transducer was replaced on 9/24/20 and was fully
LCS- 5B	9/25/20	14.1	21.9	235.3	36.0	271.30	Υ	Dedicated Transducer	operational.
LCS- 5B	10/1/20	13.9	21.9	235.3	35.8	271.10	Y	Dedicated Transducer	
LCS- 5B	10/8/20	14.0	21.9	235.3	35.9	271.20	Υ	Dedicated Transducer	
LCS- 5B	10/15/20	14.1	21.9	235.3	36.0	271.30	Y	Dedicated Transducer	
LCS- 5B	10/22/20	14.8	21.9	235.3	36.7	272.00	Y	Dedicated Transducer	
LCS- 5B	10/29/20	14.2	21.9	235.3	36.1	271.40	Y	Dedicated Transducer	
LCS- 5B	11/5/20	14.1	21.9	235.3	36.0	271.30	Y	Dedicated Transducer	
LCS- 5B LCS- 5B	11/12/20 11/19/20	14.1 14.2	21.9 21.9	235.3 235.3	36.0 36.1	271.30 271.40	Y	Dedicated Transducer	
LCS- 5B	11/19/20	14.2	21.9	235.3	36.0	271.40	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	12/3/20	14.1	21.9	235.3	36.1	271.40	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	12/3/20	14.0	21.9	235.3	35.9	271.20	Y	Dedicated Transducer	
LCS- 5B	12/18/20	13.9	21.9	235.3	35.8	271.10	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	12/24/20	14.0	21.9	235.3	35.9	271.20	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	12/31/20	13.9	21.9	235.3	35.8	271.10	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	1/7/21	13.9	21.9	235.3	35.8	271.10	Y	Dedicated Transducer	
LCS- 5B	1/14/21	13.8	21.9	235.3	35.7	271.00	Ϋ́	Dedicated Transducer	
							· · · · · · · · · · · · · · · · · · ·		


LCS-5B Liquid Level Above Quarry Floor

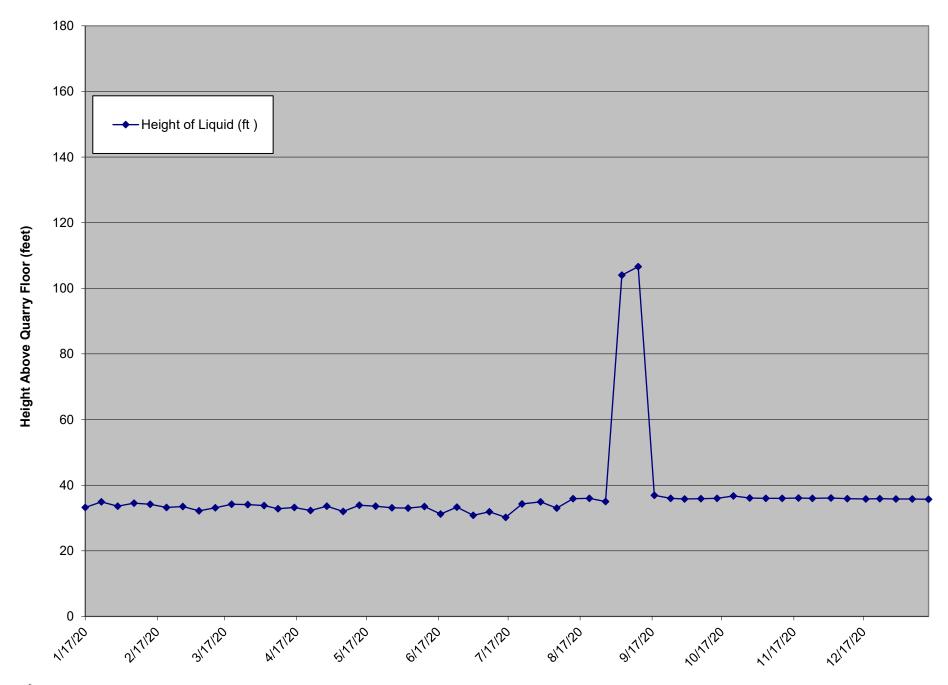

^{*}The LCS-5B pump was turned off on 8/31/20 for forecmain repairs leading to an increase in liquid level. The pump was replaced on 9/17/20.

	Date		Transducer Height above Floor of	Base of Sump	Height of	Elevation of Leachate	Pump on during measurement?		
LCS Number	Reading Collected	v	Quarry (Ft.)	(Ft. MSL)	Liquid (ft)	(Ft. MSL)	measurement? (Y/N)	Liquid level meter used	Comments
LCS- 6B	1/17/20		9.4	429.52			N	Dedicated Transducer	The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is pending replacement parts arrival.
LCS- 6B	1/24/20		9.4	429.52			N	Dedicated Transducer	The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is pending replacement parts arrival.
LCS- 6B	1/31/20		9.4	429.52			N	Dedicated Transducer	The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is pending replacement parts arrival.
LCS- 6B	2/7/20		9.4	429.52			N N	Dedicated Transducer	The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is pending replacement parts arrival.
LCS- 6B	2/14/20		9.4	429.52			N	Dedicated Transducer	The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is pending replacement parts arrival.
LCS- 6B	2/14/20			429.52	27.8	457.32	N	Heron Dipper T	The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is pending replacement parts arrival. Liquid level was measured manually.
LCS- 6B	2/21/20	N/A	N/A	429.52	27.8	457.32	N	Heron Dipper I	
LCS- 6B	2/28/20	N/A	N/A	429.52	28.3	457.82	N	Heron Dipper T	The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is tentatively scheduled the week of 3/9/20. Liquid level was measured manually.
LCS- 6B	3/6/20	N/A	N/A	429.52	28.0	457.52	N	Heron Dipper T	The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is scheduled for 3/11/20. Liquid level was measured manually.
LCS- 6B	3/13/20	12.5	9.4	429.52	21.9	451.42	v	Dedicated Transducer	The LCS-6B transducer was replaced on 3/11/20 and the pump became fully operational. The LCS-6B pump was observed to be non-operational on 3/12/20. The LCS-6B pump was replaced on 3/13/20. LCS-6B became fully operational on 3/13/20.
LCS- 6B	3/20/20	12.3	9.4	429.52	21.7	451.22	Ϋ́	Dedicated Transducer	G 10/20. 200 00 bosanio lany operational on G 10/20.
LCS- 6B	3/27/20	11.9	9.4	429.52	21.3	450.82	Y	Dedicated Transducer	
LCS- 6B	4/3/20	11.5	9.4	429.52	20.9	450.42	Y	Dedicated Transducer	
LCS- 6B	4/10/20	12.0	9.4	429.52	21.4	450.92	Y	Dedicated Transducer	
LCS- 6B	4/16/20	12.4	9.4	429.52	21.8	451.32	Y	Dedicated Transducer	
LCS- 6B	4/22/20		9.4	429.52			V	Dedicated Transduces	The LCS-6B VFD was observed to be non-operational on 4/23/20. The VFD was replaced on 4/23/20 and LCS-6B became fully operational. A level sensor reading was not collected during the weekly reporting period due to VFD communication loss with the site's SCADA system.
LCS- 6B	4/23/20 4/30/20	8.9	9.4	429.52	18.3	447.82	Y	Dedicated Transducer Dedicated Transducer	weekly reporting period due to VFD communication loss with the site's SCADA system.
LCS- 6B	5/7/20	9.0	9.4	429.52	18.4	447.92	Ý	Dedicated Transducer	
LCS- 6B	5/14/20	13.3	9.4	429.52	22.7	452.22	Ϋ́	Dedicated Transducer	
LCS- 6B	5/21/20	13.3	9.4	429.52	22.7	452.22	Υ	Dedicated Transducer	
LCS- 6B	5/28/20	7.8	9.4	429.52	17.2	446.72	Y	Dedicated Transducer	
LCS- 6B	6/4/20	8.9	9.4	429.52	18.3	447.82	Υ	Dedicated Transducer	
LCS- 6B	6/11/20	7.9	9.4	429.52	17.3	446.82	Y	Dedicated Transducer	
LCS- 6B	6/18/20 6/25/20	8.9 8.7	9.4 9.4	429.52 429.52	18.3 18.1	447.82 447.62	Y	Dedicated Transducer	
LCS- 6B LCS- 6B	7/2/20	9.2	9.4	429.52	18.1	447.62	Y	Dedicated Transducer Dedicated Transducer	
LCS- 6B	7/9/20	9.0	9.4	429.52	18.4	447.92	Ý	Dedicated Transducer	
LCS- 6B	7/16/20	8.7	9.4	429.52	18.1	447.62	Y	Dedicated Transducer	
LCS- 6B	7/23/20	8.6	9.4	429.52	18.0	447.52	Υ	Dedicated Transducer	
LCS- 6B	7/31/20	8.6	9.4	429.52	18.0	447.52	Y	Dedicated Transducer	
LCS- 6B	8/7/20	8.4	9.4	429.52	17.8	447.32	Y	Dedicated Transducer	
LCS- 6B LCS- 6B	8/14/20 8/21/20	8.7 7.2	9.4 9.4	429.52 429.52	18.1 16.6	447.62 446.12	Y	Dedicated Transducer	
LCS- 6B	8/21/20	8.5	9.4	429.52 429.52	17.9	446.12	Y	Dedicated Transducer Dedicated Transducer	
LCS- 6B	9/4/20	15.5	9.4	429.52	24.9	454.42	N	Dedicated Transducer	The LCS-6B pump was turned off on 8/31/20 for forcemain repairs. Forcemain repairs are anticipated to be completed the week of 9/7/20.
LCS- 6B	9/11/20	19.4		429.52	28.8	454.42			The LCS-6B pump was turned off on 8/31/20 for forcemain repairs. Forcemain repairs are
LCS- 6B	9/11/20	19.4	9.4	429.52	28.8	458.32	N	Dedicated Transducer	anticipated to be completed the week of 9/7/20.
LCS- 6B	9/18/20	20.1	9.4	429.52	29.5	459.02	N	Dedicated Transducer	The LCS-6B pump was turned off on 8/31/20 for forcemain repairs. Forcemain repairs were completed on 9/9/20. The pump in LCS-6B was non-operational when attempts were made to turn it back on after forcemain repairs. Pump repairs are tentatively scheduled for the week of 9/21/20. The LCS-6B pump was turned off on 8/31/20 for forcemain repairs. Forcemain repairs were
LCS- 6B	9/25/20	N/A	N/A	429.52	24.1	453.62	N	Heron Dipper T	completed on 9/9/20. The pump in LCS-6B was non-operational when attempts were made to turn it back on after forcemain repairs. The electric pump in LCS-6B will be converted to a pneumatic pump the week of 9/28/20. Liquid level was measured manually.
LCS- 6B	10/1/20	N/A	N/A	429.52	14.3	443.82	Y	Heron Dipper T	The electric pump in LCS-6B was converted to a pneumatic pump on 9/30/20. Liquid level was measured manually.
LCS- 6B	10/1/20	N/A	N/A	429.52	6.9	436.42	Y	Heron Dipper T	measured manually.
LCS- 6B	10/15/20	N/A	N/A	429.52	7.1	436.62	Ϋ́	Heron Dipper T	İ
LCS- 6B	10/22/20	N/A	N/A	429.52	7.5	437.02	Υ	Heron Dipper T	
LCS- 6B	10/29/20	N/A	N/A	429.52	8.0	437.52	Υ	Heron Dipper T	
LCS- 6B	11/5/20	N/A	N/A	429.52	5.3	434.82	Y	Heron Dipper T	
LCS- 6B	11/12/20	N/A	N/A	429.52	5.8	435.32	Y	Heron Dipper T	
LCS- 6B LCS- 6B	11/19/20 11/25/20	N/A N/A	N/A N/A	429.52 429.52	5.3 5.3	434.82 434.82	Y	Heron Dipper T	
LCS- 6B	11/25/20	N/A N/A	N/A N/A	429.52 429.52	5.3	434.82	Y	Heron Dipper T Heron Dipper T	
LCS- 6B	12/10/20	N/A	N/A	429.52	5.8	435.32	Ϋ́	Heron Dipper T	
LCS- 6B	12/18/20	N/A	N/A	429.52	5.2	434.72	Y	Heron Dipper T	
LCS- 6B	12/24/20	N/A	N/A	429.52	5.1	434.62	Υ	Heron Dipper T	
LCS- 6B	12/31/20	N/A	N/A	429.52	5.4	434.92	Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS- 6B	1/7/21	N/A	N/A	429.52	5.5	435.02	Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS- 6B	1/14/21	N/A	N/A	429.52	7.5	437.02	Υ	Heron Dipper T	Pump operational; liquid level measured manually

LCS-6B Liquid Level Above Quarry Floor

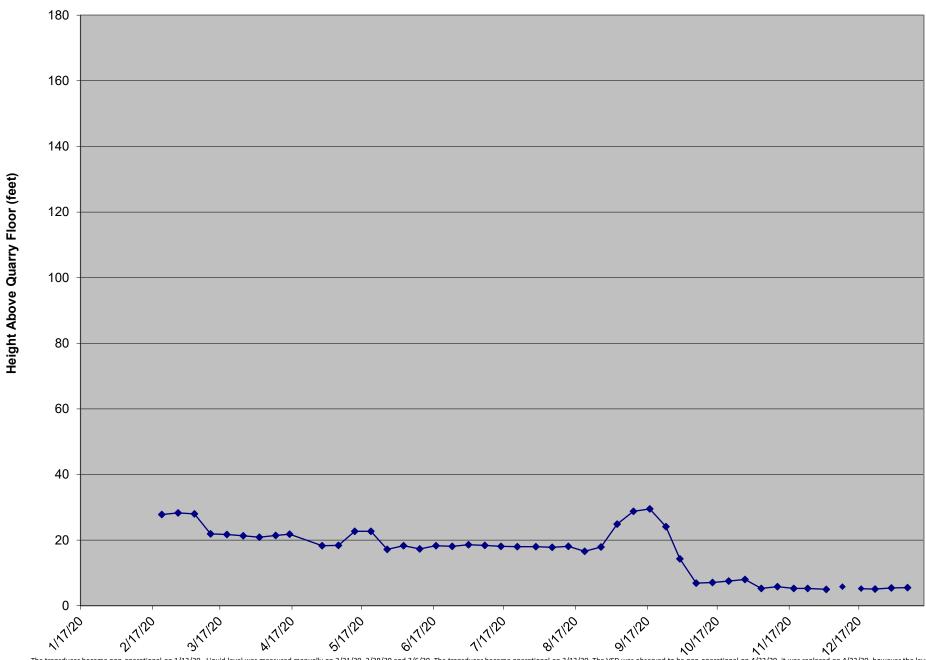

The transducer became non-operational on 1/13/20. Liquid level was measured manually on 2/21/20, 2/28/20 and 3/6/20. The transducer became operational on 3/13/20. The VFD was observed to be non-operational on 4/23/20, it was replaced on 4/23/20, however the level sensor reading was not taken due to VFD communication loss with SCADA. The LCS-6B pump was turned off on 8/31/20 for forcemain repairs leading to an increase in liquid level. The electric pump was converted to a pneumatic pump on 9/30/20.