


					Manager water serves all the forget being
	_		_		Manager water serves all the forget being
	_		_		Manager water serves and the forget barrier
			_		Manager water serves all the forget being
			-		then you with any such the foundation
103.70	100	104		Telephone Telephone	then you within anyon of the fourth of an
103.10	1000	174		Interview.	Mark pro white separative's frequencies
			_		Mark pro white separative's frequencies
	-		_		there prove and the second sector's foregrade and an
	_		_		show you wanted and an other to prove the other
	_		_		Manu para mander sergers salt of a forest for an an
	_		_		Manager water serves and the forget barrier


	Date	Measured Liquid	Transducer Height	Base of Sump	Elevation of	Pump on during		
	Reading	Level Above	above Floor of	Elevation	Leachate	measurement?	Linuid lovel meter ward	0
LCS Number LCS- 2D	Collected 5/7/20	Transducer (Ft.)	Quarry (Ft.)	(Ft. MSL) 235.92	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 2D LCS- 2D	5/120	N/A N/A	14.4 14.4	235.92		N N	Dedicated Transducer Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D			14.4			N		
LCS- 2D LCS- 2D	5/21/20 5/28/20	N/A N/A	14.4	235.92 235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	5/28/20 6/4/20	N/A N/A	14.4	235.92		N N	Dedicated Transducer Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/11/20	N/A N/A	14.4	235.92		N	Dedicated Transducer	PCP installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	6/18/20	N/A N/A	14.4	235.92		N	Dedicated Transducer	PCP installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/25/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/2/20	N/A N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/9/20	N/A N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/16/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	7/23/20	N/A N/A	14.4	235.92		N	Dedicated Transducer	PCP installed to depth of 62 BGS, failed stator, needs replacement
LCS- 2D	7/31/20	N/A N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/7/20	N/A N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/14/20	N/A N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/21/20	N/A N/A	14.4	235.92		N	Dedicated Transducer	PCP installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/28/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/4/20	N/A N/A	14.4	235.92		N	Dedicated Transducer	PCP installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	9/4/20	N/A N/A	14.4	235.92		N	Dedicated Transducer	PCP installed to depth of 62 BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	9/11/20	N/A N/A	14.4	235.92		N	Dedicated Transducer	PCP installed to depth of 62 BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	9/18/20	N/A N/A	14.4	235.92		N	Dedicated Transducer	PCP installed to depth of 62 BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	9/25/20	N/A N/A	14.4			N		, , ,
-				235.92			Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	10/8/20 10/15/20	N/A N/A	14.4 14.4	235.92 235.92		N N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D		N/A N/A	14.4			N	Dedicated Transducer Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	10/22/20 10/29/20	N/A N/A	14.4	235.92 235.92		N		PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	11/5/20	N/A N/A	14.4	235.92		N	Dedicated Transducer Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	11/12/20	N/A N/A	14.4	235.92		N	Dedicated Transducer	
LCS- 2D LCS- 2D	11/12/20	N/A N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/3/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/10/20	N/A N/A	14.4			N	Dedicated Transducer	
LCS- 2D LCS- 2D	12/10/20	N/A N/A	14.4	235.92 235.92		N		PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	12/18/20	N/A N/A	14.4	235.92		N	Dedicated Transducer Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	12/24/20	N/A N/A	14.4	235.92		N	Dedicated Transducer	
LCS- 2D LCS- 2D			14.4	235.92		N		PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	1/7/21 1/14/21	N/A N/A	14.4	235.92		N	Dedicated Transducer Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	1/14/21	N/A N/A	14.4	235.92		N	Dedicated Transducer Dedicated Transducer	PCP installed to depth of 62 BGS, failed stator, needs replacement PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	1/21/21	N/A N/A	14.4	235.92		N	Dedicated Transducer Dedicated Transducer	PCP installed to depth of 62 BGS, failed stator, needs replacement PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	2/4/21	N/A N/A	14.4	235.92		N	Dedicated Transducer Dedicated Transducer	PCP installed to depth of 62 BGS, failed stator, needs replacement PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	2/4/21	N/A N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	2/11/21	N/A N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	2/18/21	N/A N/A	14.4	235.92		N	Dedicated Transducer	PCP installed to depth of 62 BGS, failed stator, needs replacement PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	3/4/21	N/A N/A	14.4	235.92		N	Dedicated Transducer	
LCS- 2D LCS- 2D				235.92				PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	3/11/21 3/18/21	N/A N/A	14.4 14.4	235.92		N N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement PCP Installed to depth of 62' BGS, failed stator, needs replacement
-			14.4			N N	Dedicated Transducer	
LCS-2D	3/25/21	N/A	14.4	235.92			Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/1/21	N/A		235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/8/21	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/15/21	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/22/21	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/29/21	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/6/21	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement

				Well Total Depth				
	Date	Measured Liquid	Transducer Depth	from Top of	Elevation of	Pump on during		
	Reading	Level Below Ground	from Top of Casing	Casing (Ft.)	Leachate	measurement?		
LCS Number	Collected	Surface (ft)	(Ft.)	(Ft. MSL)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS-3D	5/7/20	50.0	N/A	140	(I L. MOL)	Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/14/20	54.8	N/A N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D		40.8	N/A N/A	140		Y		Pump operational; liquid level measured manually
LCS-3D LCS-3D	5/21/20 5/28/20	40.8 50.7	N/A N/A	140		Y Y	Heron Dipper T	Pump operational, liquid level measured manually Pump operational; liquid level measured manually
		50.7		140		Y Y	Heron Dipper T	
LCS-3D	6/4/20		N/A				Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/11/20	54.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/19/20	52.5	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/26/20	52.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/2/20	60.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/9/20	60.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/17/20	61.1	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/23/20	60.5	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/31/20	60.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/7/20	59.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/14/20	51.2	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/21/20	59.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/28/20	48.2	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/4/20	52.1	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/11/20	50.3	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/18/20	58.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/25/20	59.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/1/20	59.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/8/20	48.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/15/20	57.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/22/20	57.3	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/5/20	62.5	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/12/20	59.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/19/20	58.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/25/20	57.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	12/3/20	58.2	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
								The pump in LCS-3D was non-operational on 12/10/20 after the liquid level
LCS-3D	12/10/20	59.2	N/A	140		Y	Heron Dipper T	measurement. Pump repairs are scheduled to be completed on 12/14/20.
200 05	12/10/20	00.2		110			Hereit Bipper 1	The pump in LCS-3D was non-operational on 12/10/20 after the liquid level
								measurement. Pump repairs were completed on 12/14/20. The pump was fully
LCS-3D	12/18/20	62.9	N/A	140		Y	Heron Dipper T	operational for the rest of the reporting period.
LCS-3D	12/24/20	66.0	N/A	140		Ŷ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	12/31/20	67.7	N/A	140		Ŷ	Heron Dipper T	Pump operational; liquid level measured manually
L00-3D	12/31/20	01.1	IN/A	140		1	Theron Dipper 1	The pump in LCS-3D was non-operational from 1/3/21 - 1/7/21. The pump was
LCS-3D	1/7/21	49.4	N/A	140		N	Heron Dipper T	repaired and became fully operational on 1/8/21.
L00-3D	1/1/21	43.4	IN/A	140		in .	Theron Dipper 1	The pump in LCS-3D was non-operational from 1/11/21 - 1/13/21. The pump was
LCS-3D	1/14/21	54.8	N/A	140		Y	Heron Dipper T	repaired and became fully operational on 1/14/21.
LCS-3D LCS-3D	1/14/21	58.4	N/A N/A	140		Y		Pump operational; liquid level measured manually
LCS-3D LCS-3D	1/21/21	55.7	N/A N/A	140		Y	Heron Dipper T Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D LCS-3D	2/4/21	60.1	N/A N/A	140		f Y	Heron Dipper T	Pump operational; liquid level measured manually
LC3-3D	2/4/21	00.1	IN/A	140		Ť	Heron Dipper 1	
								Liquid level measured manually. The LCS-3D pump was non-operational on 2/12/2
	0/14/10/	50.0						due to a frozen forcemain. The forcemain was frozen the remainder of the weekly
LCS-3D	2/11/21	58.6	N/A	140		Y	Heron Dipper T	reporting period.
								Liquid level measured manually. The LCS-3D pump was non-operational since
								2/12/21 due to a frozen forcemain. The forcemain was frozen the entirety of the
LCS-3D	2/18/21	43.2	N/A	140		N	Heron Dipper T	weekly reporting period.
								Liquid level measured manually. The LCS-3D pump was non-operational on 2/12/2
LCS-3D	2/25/21	56.3	N/A	140		Y	Heron Dipper T	due to a frozen forcemain. The pump became operational again on 2/23/21.
LCS-3D	3/4/21	61.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/11/21	62.1	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/18/21	58.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/25/21	59.1	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/1/21	62.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/8/21	56.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/15/21	58.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/22/21	56.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/29/21	59.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
	5/6/21	61.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually

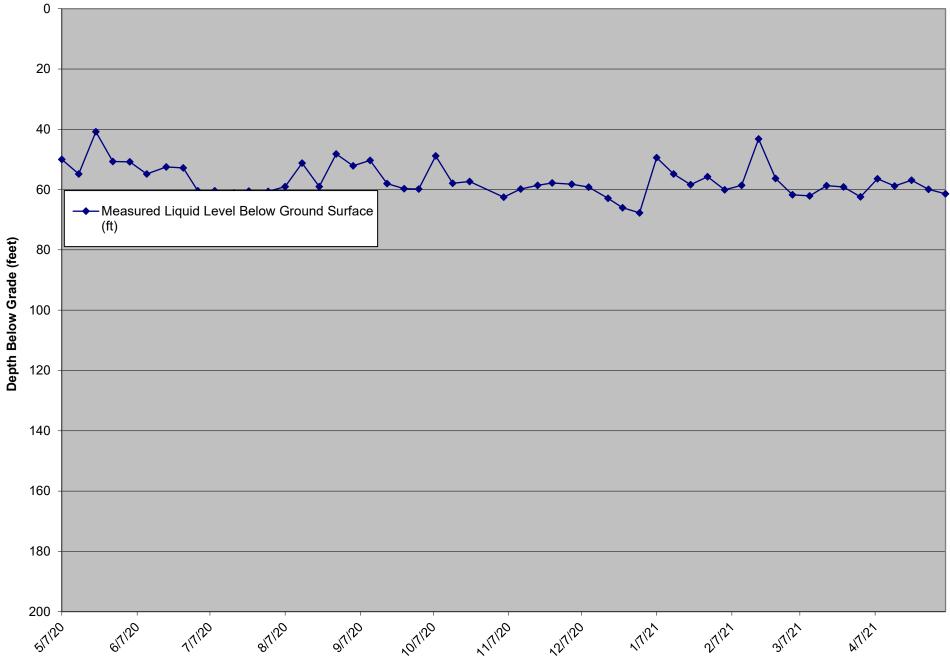


	Date	Measured Liquid	Transducer Depth	Base of Sump	Pump on during		
	Reading	Level Below Ground	from Top of Casing	Elevation	measurement?		
LCS Number	Collected	Surface (ft)	(Ft.)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 4B	5/7/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/14/20	74.0	81.0	244.00	Ŷ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/21/20	74.0	81.0	244.00	Ŷ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/28/20	74.0	81.0	244.00	Ŷ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/4/20	74.0	81.0	244.00	Ŷ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/11/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/18/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/26/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/2/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/9/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/16/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/23/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/31/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/7/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/14/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/21/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/28/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/4/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/11/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/18/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/25/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/1/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/8/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/15/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/22/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/29/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/5/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/12/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/19/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/25/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/3/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/10/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/18/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/24/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/31/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/7/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/14/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/21/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/28/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/4/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/11/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/18/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/25/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/4/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/11/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/18/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/25/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/1/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/8/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/15/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/22/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/29/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/6/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS

LCS-4B Liquid Level Below Ground Surface

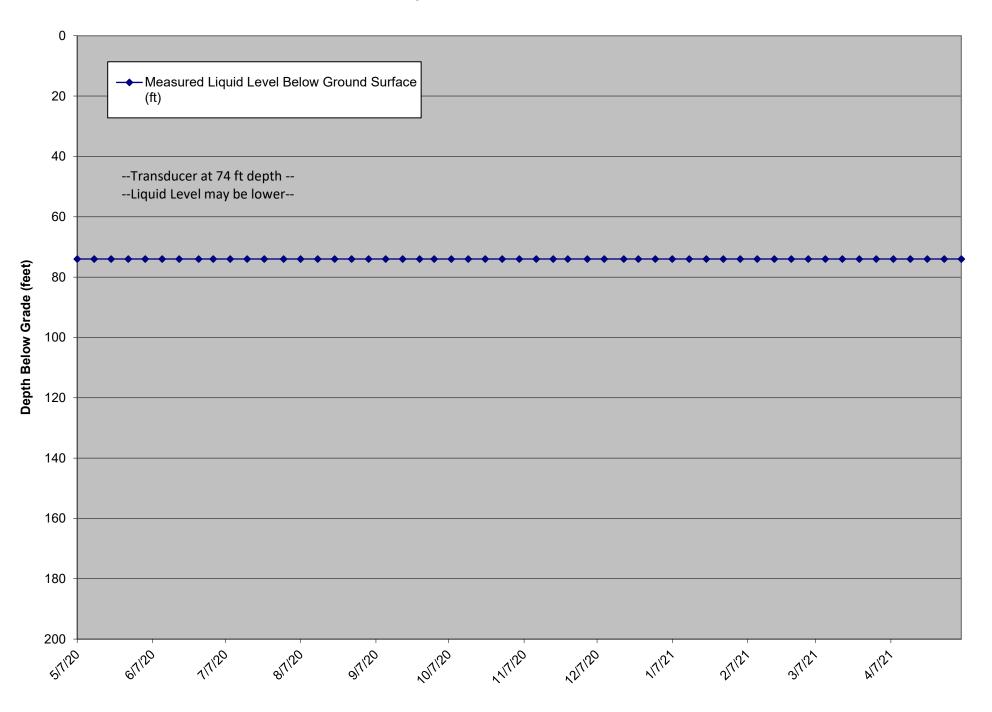

	Date	Measured Liquid	Transducer Height	Base of Sump		Elevation of	Pump on during		
	Reading	Level Above	above Floor of	Elevation	Height of	Leachate	measurement?		
LCS Number	Collected	Transducer (Ft.)	Quarry (Ft.)	(Ft. MSL)	Liquid (ft)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 5B	5/7/20	10.1	21.9	235.3	32.0	267.30	Y	Dedicated Transducer	
LCS- 5B	5/14/20	12.0	21.9	235.3	33.9	269.20	Y	Dedicated Transducer	
LCS- 5B	5/21/20	11.7	21.9	235.3	33.6	268.90	Y	Dedicated Transducer	
LCS- 5B	5/28/20	11.2	21.9	235.3	33.1	268.40	Y	Dedicated Transducer	
LCS- 5B	6/4/20	<u>11.1</u> 11.6	21.9 21.9	235.3	33.0	268.30 268.80	Y	Dedicated Transducer	
LCS- 5B	6/11/20	9.3		235.3	33.5	268.80		Dedicated Transducer	
LCS- 5B	6/18/20 6/25/20	9.3	21.9 21.9	235.3 235.3	31.2 33.3	266.50	Y Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	7/2/20	8.9	21.9	235.3	33.3	268.60	Ý Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B LCS- 5B	7/2/20	8.9	21.9	235.3	30.8	266.10	Y Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	7/16/20	8.3	21.9	235.3	31.9	265.50	f Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	7/23/20	12.4	21.9	235.3	34.3	269.60	Y	Dedicated Transducer	
LCS- 5B	7/31/20	12.4	21.9	235.3	34.3	269.60	Ť Y	Dedicated Transducer	
LCS- 5B	8/7/20	11.1	21.9	235.3	33.0	268.30	Y	Dedicated Transducer	
LCS- 5B	8/14/20	14.0	21.9	235.3	35.9	208.30	Y	Dedicated Transducer	
LCS- 5B	8/21/20	14.0	21.9	235.3	36.0	271.30	Y	Dedicated Transducer	
LCS- 5B	8/28/20	13.1	21.9	235.3	35.0	270.30	Y	Dedicated Transducer	
LC3- 3B	0/20/20	13.1	21.9	230.3	33.0	270.30	1	Dedicated Transducer	The LCS-5B pump was turned off on 8/31/20 for forcemain
									repairs. Forcemain repairs are anticipated to be completed the
LCS- 5B	9/4/20	82.1	21.9	235.3	104.0	339.30	N	Dedicated Transducer	week of 9/7/20.
LC3- 3B	9/4/20	02.1	21.9	230.3	104.0	339.30	IN	Dedicated Transducer	The LCS-5B pump was turned off on 8/31/20 for forcemain
						1			repairs. Forcemain repairs are anticipated to be completed the
LCS- 5B	9/11/20	84.7	21.9	235.3	106.6	341.90	N	Dedicated Transducer	week of 9/7/20.
200-00	5/11/20	04.1	21.0	200.0	100.0	041.00		Dedicated Hallbadeel	The LCS-5B pump was replaced on 9/17/20 and was fully
LCS- 5B	9/18/20	15.0	21.9	235.3	36.9	272.20	Y	Dedicated Transducer	operational.
200-00	0/10/20	10.0	21.0	200.0	00.0	212.20		Dedicated Hansadeer	The LCS-5B transducer was found to be non-operational on
									9/21/20. The transducer was replaced on 9/24/20 and was fully
LCS- 5B	9/25/20	14.1	21.9	235.3	36.0	271.30	Y	Dedicated Transducer	operational.
LCS- 5B	10/1/20	13.9	21.9	235.3	35.8	271.10	Ý	Dedicated Transducer	oporationali
LCS- 5B	10/8/20	14.0	21.9	235.3	35.9	271.20	Ŷ	Dedicated Transducer	
LCS- 5B	10/15/20	14.1	21.9	235.3	36.0	271.30	Ŷ	Dedicated Transducer	
LCS- 5B	10/22/20	14.8	21.9	235.3	36.7	272.00	Y	Dedicated Transducer	
LCS- 5B	10/29/20	14.2	21.9	235.3	36.1	271.40	Y	Dedicated Transducer	
LCS- 5B	11/5/20	14.1	21.9	235.3	36.0	271.30	Y	Dedicated Transducer	
LCS- 5B	11/12/20	14.1	21.9	235.3	36.0	271.30	Y	Dedicated Transducer	
LCS- 5B	11/19/20	14.2	21.9	235.3	36.1	271.40	Y	Dedicated Transducer	
LCS- 5B	11/25/20	14.1	21.9	235.3	36.0	271.30	Y	Dedicated Transducer	
LCS- 5B	12/3/20	14.2	21.9	235.3	36.1	271.40	Y	Dedicated Transducer	
LCS- 5B	12/10/20	14.0	21.9	235.3	35.9	271.20	Y	Dedicated Transducer	
LCS- 5B	12/18/20	13.9	21.9	235.3	35.8	271.10	Y	Dedicated Transducer	
LCS- 5B	12/24/20	14.0	21.9	235.3	35.9	271.20	Y	Dedicated Transducer	
LCS- 5B	12/31/20	13.9	21.9	235.3	35.8	271.10	Y	Dedicated Transducer	
LCS- 5B	1/7/21	13.9	21.9	235.3	35.8	271.10	Y	Dedicated Transducer	
LCS- 5B	1/14/21	13.8	21.9	235.3	35.7	271.00	Y	Dedicated Transducer	
LCS- 5B	1/21/21	13.8	21.9	235.3	35.7	271.00	Y	Dedicated Transducer	
LCS- 5B	1/28/21	13.8	21.9	235.3	35.7	271.00	Y	Dedicated Transducer	
LCS- 5B	2/4/21	13.9	21.9	235.3	35.8	271.10	Y	Dedicated Transducer	
LCS- 5B	2/11/21	13.6	21.9	235.3	35.5	270.80	Y	Dedicated Transducer	
LCS- 5B	2/18/21	48.2	21.9	235.3	70.1	305.40	N	Dedicated Transducer	The pump in LCS-5B was non-operational on 2/15/21 due to a frozen forcemain. The forcemain was frozen the entirety of the weekly reporting period.
1.00 50	0/05/04	40.0	01.0	005.0		070.00	X	De die de d'Energe dus en	The pump in LCS-5B was non-operational on 2/15/21 due to a frozen forcemain. The pump became operational again on 2/25/21.
LCS- 5B LCS- 5B	2/25/21 3/4/21	13.6 13.8	21.9 21.9	235.3 235.3	35.5 35.7	270.80 271.00	Y Y	Dedicated Transducer Dedicated Transducer	2/23/21.
LCS- 5B LCS- 5B	3/4/21	13.9	21.9	235.3	35.8	271.00	Ť Y	Dedicated Transducer	
LCS- 5B LCS- 5B	3/11/21 3/18/21	13.9	21.9	235.3	35.8	271.10	Y Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B LCS- 5B	3/18/21 3/25/21	13.5	21.9	235.3	35.4	270.70	Y Y	Dedicated Transducer Dedicated Transducer	
	3/25/21 4/1/21	13.5	21.9	235.3	35.4	270.70	Ý Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B LCS- 5B	4/1/21 4/9/21	13.5	21.9	235.3	35.4	270.70 271.00	Y Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B LCS- 5B	4/9/21	13.8	21.9	235.3	35.7	271.00	Y Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B LCS- 5B	4/15/21 4/22/21	13.8	21.9	235.3	35.7	271.00	Ý Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B LCS- 5B	4/22/21	13.8	21.9	235.3	35.7	271.00	Ý Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B LCS- 5B	5/6/21	13.3	21.9	235.3	35.2	270.50	Y Y	Dedicated Transducer Dedicated Transducer	
LCO- 3D	J/0/21	13.3	21.9	200.0	33.4	210.10	ſ	Deuloaleu Hansuucer	l


*The LCS-5B pump was turned off on 8/31/20 for forecmain repairs leading to an increase in liquid level. The pump was replaced on 9/17/20.

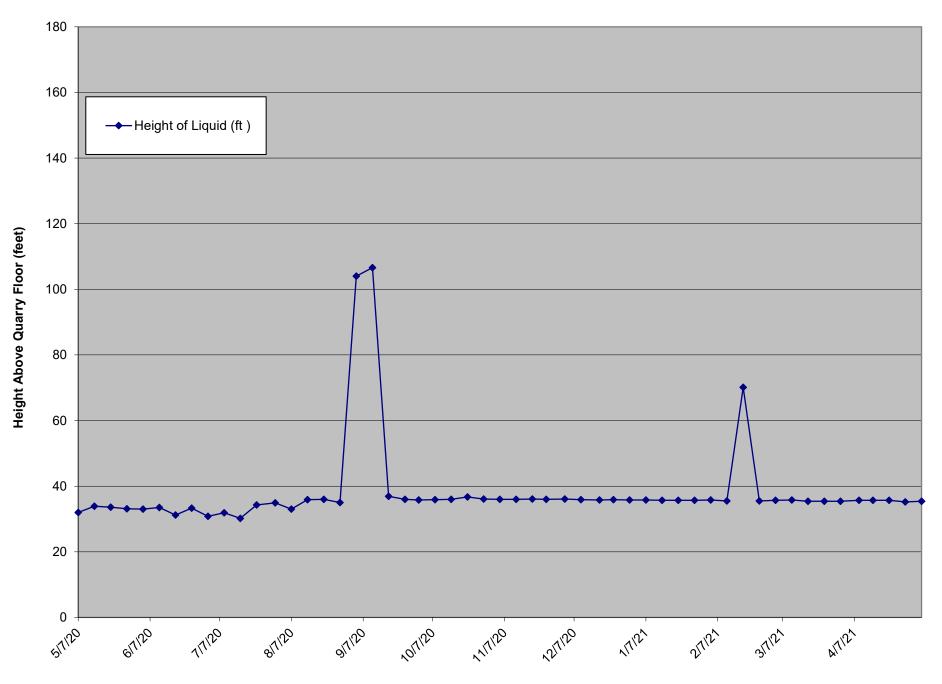

LCS-5B Liquid Level Above Quarry Floor

	Date		Transducer Height	Base of Sump		Elevation of	Pump on during		
	Reading		above Floor of	Elevation	Height of	Leachate	measurement?		
LCS Number	Collected	V	Quarry (Ft.)	(Ft. MSL)	Liquid (ft)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 6B	5/7/20	9.0	9.4	429.52	18.4	447.92	Y	Dedicated Transducer	
LCS- 6B	5/14/20	13.3	9.4	429.52	22.7	452.22	Y	Dedicated Transducer	
LCS- 6B	5/21/20	13.3	9.4	429.52	22.7	452.22	Y	Dedicated Transducer	
LCS- 6B	5/28/20	7.8	9.4	429.52	17.2	446.72	Y	Dedicated Transducer	
LCS- 6B	6/4/20	8.9	9.4	429.52	18.3	447.82	Y	Dedicated Transducer	
LCS- 6B	6/11/20	7.9	9.4	429.52	17.3	446.82	Y	Dedicated Transducer	
LCS- 6B	6/18/20	8.9	9.4	429.52	18.3	447.82	Y	Dedicated Transducer	
LCS- 6B	6/25/20	8.7	9.4	429.52	18.1	447.62	Y	Dedicated Transducer	
LCS- 6B	7/2/20	9.2	9.4	429.52	18.6	448.12	Y	Dedicated Transducer	
LCS- 6B	7/9/20	9.0	9.4	429.52	18.4	447.92	Y	Dedicated Transducer	
LCS- 6B	7/16/20	8.7	9.4	429.52	18.1	447.62	Y	Dedicated Transducer	
LCS- 6B	7/23/20	8.6	9.4	429.52	18.0	447.52	Y	Dedicated Transducer	
LCS- 6B	7/31/20	8.6	9.4	429.52	18.0	447.52	Y	Dedicated Transducer	
LCS- 6B	8/7/20	8.4	9.4	429.52	17.8	447.32	Y	Dedicated Transducer	
LCS- 6B	8/14/20	8.7	9.4	429.52	18.1	447.62	Ŷ	Dedicated Transducer	
LCS- 6B	8/21/20	7.2	9.4	429.52	16.6	446.12	Ý	Dedicated Transducer	
LCS- 6B	8/28/20	8.5	9.4	429.52	17.9	447.42	Y	Dedicated Transducer	
LCO- 0D	0/20/20	0.5	3.4	423.32	17.5	447.42	1	Dedicated Transducer	The LCS-6B pump was turned off on 8/31/20 for forcemain repairs. Forcemain repairs are
LCS- 6B	9/4/20	15.5	9.4	429.52	24.9	454.42	Ν	Dedicated Transducer	anticipated to be completed the week of 9/7/20.
LC3- 0D	9/4/20	15.5	9.4	429.52	24.9	404.42	IN	Dedicated Transducer	The LCS-6B pump was turned off on 8/31/20 for forcemain repairs. Forcemain repairs are
1.00.00	0/11/00	40.4	0.4	400 50	00.0	450.00	N	Dedicated Transdomen	
LCS- 6B	9/11/20	19.4	9.4	429.52	28.8	458.32	N	Dedicated Transducer	anticipated to be completed the week of 9/7/20.
									The LCS-6B pump was turned off on 8/31/20 for forcemain repairs. Forcemain repairs were
									completed on 9/9/20. The pump in LCS-6B was non-operational when attempts were made to turn it
LCS- 6B	9/18/20	20.1	9.4	429.52	29.5	459.02	N	Dedicated Transducer	back on after forcemain repairs. Pump repairs are tentatively scheduled for the week of 9/21/20.
									The LCS-6B pump was turned off on 8/31/20 for forcemain repairs. Forcemain repairs were
									completed on 9/9/20. The pump in LCS-6B was non-operational when attempts were made to turn it
									back on after forcemain repairs. The electric pump in LCS-6B will be converted to a pneumatic
LCS- 6B	9/25/20	N/A	N/A	429.52	24.1	453.62	N	Heron Dipper T	pump the week of 9/28/20. Liquid level was measured manually.
									The electric pump in LCS-6B was converted to a pneumatic pump on 9/30/20. Liquid level was
LCS- 6B	10/1/20	N/A	N/A	429.52	14.3	443.82	Y	Heron Dipper T	measured manually.
LCS- 6B	10/8/20	N/A	N/A	429.52	6.9	436.42	Y	Heron Dipper T	
LCS- 6B	10/15/20	N/A	N/A	429.52	7.1	436.62	Y	Heron Dipper T	
LCS- 6B	10/22/20	N/A	N/A	429.52	7.5	437.02	Y	Heron Dipper T	
LCS- 6B	10/29/20	N/A	N/A	429.52	8.0	437.52	Y	Heron Dipper T	
LCS- 6B	11/5/20	N/A	N/A	429.52	5.3	434.82	Y	Heron Dipper T	
LCS- 6B	11/12/20	N/A	N/A	429.52	5.8	435.32	Y	Heron Dipper T	
LCS- 6B	11/19/20	N/A	N/A	429.52	5.3	434.82	Y	Heron Dipper T	
LCS- 6B	11/25/20	N/A	N/A	429.52	5.3	434.82	Y	Heron Dipper T	
LCS- 6B	12/3/20	N/A	N/A	429.52	5.0	434.52	Y	Heron Dipper T	
LCS- 6B	12/10/20	N/A	N/A	429.52	5.8	435.32	Ŷ	Heron Dipper T	
LCS- 6B	12/18/20	N/A	N/A	429.52	5.2	434.72	Ý	Heron Dipper T	
LCS- 6B	12/24/20	N/A	N/A	429.52	5.1	434.62	Y	Heron Dipper T	
LCS- 6B	12/31/20	N/A	N/A	429.52	5.4	434.92	Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS- 6B	1/7/21	N/A N/A	N/A N/A	429.52	5.5	435.02	Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS- 6B	1/1/21	N/A N/A	N/A N/A	429.52	5.5	435.02	Y Y		Pump operational; liquid level measured manually Pump operational; liquid level measured manually
LCS- 6B	1/14/21	N/A N/A	N/A N/A	429.52		437.02	Y Y	Heron Dipper T	Pump operational; liquid level measured manually Pump operational: liquid level measured manually
				429.52	6.7		Y	Heron Dipper T	Pump operational; liquid level measured manually Pump operational: liquid level measured manually
LCS- 6B	1/28/21	N/A	N/A		6.7	436.22	Y	Heron Dipper T	
LCS- 6B	2/4/21	N/A	N/A	429.52	6.8	436.32	Y	Heron Dipper T	Pump operational; liquid level measured manually
									The LCS-6B pump was non-operational on 2/9/21 due to a frozen forcemain. The forcemain was
LCS- 6B	2/11/21	N/A	N/A	429.52	14.6	444.12	N	Heron Dipper T	frozen the remainder of the weekly reporting period.
									The LCS-6B pump was non-operational since 2/9/21 due to a frozen forcemain. The forcemain was
LCS- 6B	2/18/21	N/A	N/A	429.52	16.5	446.02	N	Heron Dipper T	frozen the entirety of the weekly reporting period.
									The LCS-6B pump was non-operational on 2/9/21 due to a frozen forcemain. The pump became
LCS- 6B	2/25/21	N/A	N/A	429.52	8.0	437.52	Y	Heron Dipper T	operational again on 2/22/21
LCS- 6B	3/4/21	N/A	N/A	429.52	7.7	437.22	Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS- 6B	3/11/21	N/A	N/A	429.52	7.1	436.62	Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS- 6B	3/18/21	N/A	N/A	429.52	6.9	436.42	Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS- 6B	3/25/21	N/A	N/A	429.52	8.3	437.82	Ý	Heron Dipper T	Pump operational; liquid level measured manually
LCS- 6B	4/1/21	N/A	N/A	429.52	10.5	440.02	Ý	Heron Dipper T	Pump operational; liquid level measured manually
LCS- 6B	4/8/21	N/A	N/A	429.52	7.0	436.52	Ý	Heron Dipper T	Pump operational; liquid level measured manually
LCS- 6B	4/15/21	N/A	N/A	429.52	6.9	436.42	Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS- 6B	4/15/21	N/A N/A	N/A N/A	429.52	6.8	436.32	r Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS- 6B	4/22/21	N/A N/A	N/A N/A	429.52	6.9	436.32	Y Y	Heron Dipper T Heron Dipper T	Pump operational; liquid level measured manually Pump operational; liquid level measured manually
LUO- 0B	4/29/21					436.42	ſ		
LCS- 6B	5/6/21	N/A	N/A	429.52	6.9			Heron Dipper T	Pump operational; liquid level measured manually

LCS-6B Liquid Level Above Quarry Floor

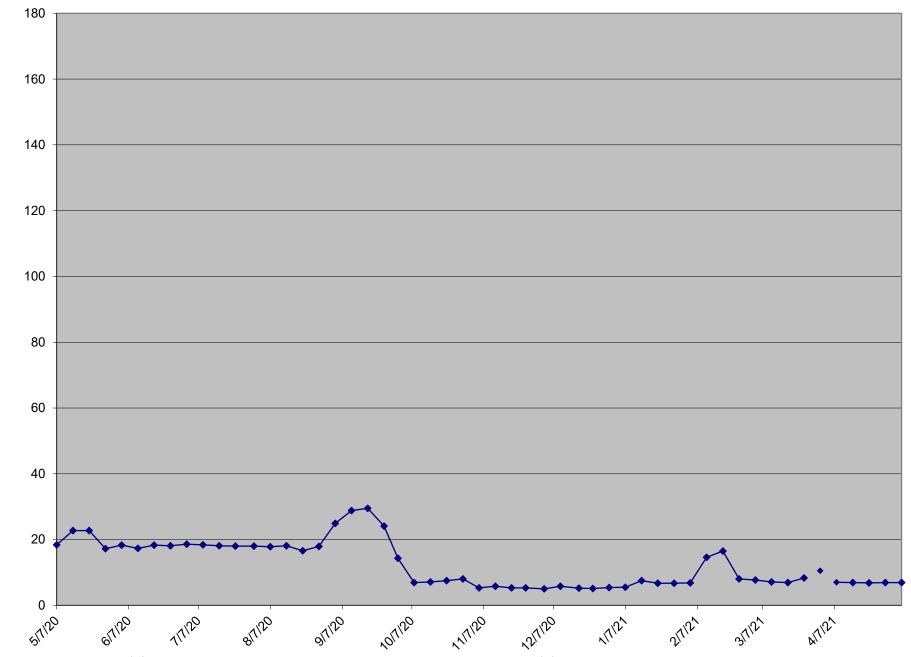

The LCS-6B pump was turned off on 8/31/20 for forcemain repairs leading to an increase in liquid level. The electric pump was converted to a pneumatic pump on 9/30/20.