

	11	Remark or at and being brings	Translator Balling Sen Translationing	Resultion Roads	12227		
	П			Ш	Ш		
	Ш			Н	Н		
	Ш		H	Ш	Ш		
-		I		Ш	Ш		
	Ш	H	Н	Ш	Ш	-	
	Ш	Н		Н	Н		
	Ш	H	H	Ш	Ш		
	Ш	H	H	Ш	t		
	П	Н		Ш	Ш		
	Ш	1		Ш	Н		
-	П	н	н	Ш	Н	****	
	Н		H	Н	Н		
MAN	š		š	ř	4	Named Tables	for the between to be about the second
-		I		Ш	Ш		
	П	I		Ш	Ш		
					Н		
			-	Ш	Н		
	П				4		2/2/
	Н		l	l	ľ		deputte nederate frequentendos artistas de apreción. Poro directación frequentendos aprecionados que se
	1				ł		Any also reasons for extended operationing also from the reasons for extended operationing also
100.0	THEFT		101	80		Temporary Temporary	Any Pin remains for an excellent operand about to Any Pin remains for an excellent operand about to
US.W	8 8		97	82	•	Separation of the Separation o	Top Pic session for an entire special popularies
105.90	100		97	2	1	NAME AND ADDRESS OF	Top Pic session for an entire special popularies
_	П				ŀ		Ang Ph. Selbour Top of South Space Space (polymerts) Ang Ph. Selbour Top of Stagler Space (polymerts)
	П						for the latitudes for any largest independent of the latitudes for any latitudes of the lat
	Н						They are also the professed FFTS from their artists of
			-		\blacksquare		
E	Ш	ΕĒ		Ħ	Ħ		
-			-	=	Ξ	-	
=	E			=	=		Committee of the Commit
=	E			=	=		The second Appellage State of the second
=	F						Any other and designed the annual of the Control of the
_	F			=	=		The property and the second state of the secon
100.0	-		W)	=	÷	terectore:	
100.0	-		W)	=	÷	terectore:	
	Н			Н	ŀ		Mark you work to be a series of the series o
	П			Н	ŀ		Married Wilder House, and the Control of the Contro
	Н		H	Н	Н		Married State of the Control of the
	Н		H	Н	Н		Married State of the Control of the
10.3	100		i	ı	ť	total total	Mark you with the second of the second
115.3	ı		97	=	4	Select States	Mark you work to be about 1975 for the party of the
_	Н			Н	Н		Mark you would never not the frequency of the
			-	-	-		Married works regarded to the second
	П				ł		Mark you within separately the contract of the
_	П				ŀ		Mark you works super private frequency or grown
US.W	100		97	82	4	Separation of the Separation o	Mark you would never named for the street ground
10.0	9.9		90	20	'n	NAME AND ADDRESS OF THE PARTY O	Mark you work to be a self-of-free base and and the self-of-free base and a se
	Н						AND DESCRIPTION OF THE PERSON NAMED IN COLUMN
	Н						NAME AND ADDRESS OF THE OWNER, WHEN PERSON ADDRESS OF THE OWNER, WHEN PERSON AND ADDRESS OF THE OWNER, WHEN
_	Н			Н	Н		Mark you within some order for party or and
	Ш				1		Was his many refer to any principle being
10.0			-	-	1	Name Tools	Mark you would never not the frequency of the
MAR.	100 EEE		90	AN AN		Telephone Telephone	Marie party maries conservatives frequency and an activative frequency and a second se
	П				ł		Mark you would be seen about the party of the seen about the seen
_	П				ŀ		Married week regarded to be accompanied
	П						Mark you would be seen and the forest party and the second
	Н						Mark you would be seen and the forest party and the second
175.W	8		977	200	٠,	NAME TO AN	And you with the same of the s
105.76	100		97	20	1	Separation of the Person of th	
	Н						Mark you with the same of the
	Н						Mark you widow supply and the first property of the supply
	н			Н	ŀ		Married water story over 5 to be a construction
	Н						Married work regarded by the control of
105.76	10		97	-	'n	Name Code	Mark you within below of the forest hand grown
10.0			97	-	-	teractions.	Mark you wish and a series for the series and a series of the series of
	_		-	=	÷	ATECTOR	
-	Е		E	=	Ė	_	Maryon water against the second
	Е		E	Е	Е		Married with the state of the s
	Ε			Ε	Ε		Mary page and the supple of the foreign page of the foreign page.
100 W			99	200	Ξ	NAME TANKS	Mark July States Super Street Property or product
105.00 105.00	Ξ		10	-	Ξ	tenerous tenerous	Mark you with the second of th
	Е		Ξ	Ξ	Ξ		Mark you waste annual street frequency and a street waste and the street frequency and the stree
	Ε			Ξ	Η		Mark you was a supplied to the supplied of the
	E						Mark you window service and the forest party and the service a
	E				=		Married water topic of the following of the
100.0	н		97 97	=	÷	teneroose teneroose	Maria per mante de para entre la companya de la companya del companya de la companya de la companya del companya de la company
10.0	-		100		÷	Total Total	
-	-		-	-	÷		Mark you will be seen and the second for the second second
E	F		=	Ξ	F	_	Married water region (CVII) for the contract of
	Е		E	Е	Е		Married with the state of the s
	Ε			Ε	Ε		Mary page and the supple of the frequency of the supple of the supple of the frequency of the supple
MAX.	-		101	200	÷	NAME AND ADDRESS OF THE PARTY O	Mark you with the same of the frequency of the
10.0			W.		Ξ	Terran Terran	Married Williams and Art Control of the Control of
	Ε			Ξ	Η		Mark you will a super a lot of the party of the super and the super and the super su
E	Ē	Ē	ΕĒ	Ē	Ε		200 E 100
E	Ë			Ē	Ë		Marya Maryana and Arabana and
=	E			=	=		Market State States of the August States
10.0	п		W/	-	÷	NAME AND ADDRESS OF	Maria yee water super street from the same
100.0	-		97 97	=	÷	teneroose teneroose	Maria per mante de para entre la companya de la companya del companya de la companya de la companya del companya de la company
			-	=	÷	Martine	
_	F		=	=	Ė		Marie and Marie Supplied to Commercial
_	F			=	=		Mark you within the part of the forest and the
E	F		=	Ξ	F	_	Market State
10.0	-		-	-	÷	Name Toronto	
100 M	1		W1	-	÷	SAMPLE SA	Mark page market market and Table September 2011
	Е	E	É	Ē	Ė		Marie para maries maries and PTE Property and annual Marie para maries and annual Annual Maries and an
	Е			Е	E	=	Mary In the Second Property and
	Ε			Ξ	Η		Mark you work to you never began a property or great
_	=		_	_	Ξ		Managed States States over 1 to 1 t



	Date	Measured Liquid	Transducer Height	Base of Sump	Elevation of	Pump on during		
	Reading	Level Above	above Floor of	Elevation	Leachate	measurement?		
LCS Number	Collected	Transducer (Ft.)	Quarry (Ft.)	(Ft. MSL)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 2D	5/21/20	N/A	14.4	235.92	,	N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/28/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/4/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/11/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/18/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/25/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/2/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/9/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/16/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/23/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/31/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/7/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/14/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/21/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/28/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/4/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/11/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/18/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/25/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	10/1/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	10/8/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	10/15/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	10/22/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	10/29/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	11/5/20 11/12/20	N/A N/A	14.4 14.4	235.92 235.92		N N	Dedicated Transducer Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	11/12/20	N/A N/A	14.4	235.92		N N	Dedicated Transducer Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/3/20	N/A	14.4	235.92		N N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/3/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/18/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/24/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/31/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/7/21	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/14/21	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/21/21	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/28/21	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/4/21	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/11/21	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/18/21	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/25/21	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/4/21	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/11/21	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/18/21	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/25/21	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/1/21	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/8/21	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/15/21	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/22/21	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/29/21	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/6/21	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/13/21	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/20/21	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement


				Well Total Depth				
	Date	Measured Liquid	Transducer Depth	from Top of	Elevation of	Pump on during		
	Reading	Level Below Ground	from Top of Casing	Casing (Ft.)	Leachate	measurement?		
LCS Number	Collected	Surface (ft)	(Ft.)	(Ft. MSL)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS-3D	5/21/20	40.8	N/A	140	(I t. IVIOL)	(1/N) Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/28/20	50.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/4/20	50.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/11/20	54.8	N/A	140		Ϋ́	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/19/20	52.5	N/A	140		Ý	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/26/20	52.8	N/A	140		Ϋ́	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/2/20	60.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/9/20	60.4	N/A	140		Ϋ́	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/17/20	61.1	N/A	140		Ϋ́	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/23/20	60.5	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/31/20	60.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/7/20	59.0	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/14/20	51.2	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/21/20	59.0	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/28/20	48.2	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/4/20	52.1	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/11/20	50.3	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/18/20	58.0	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/25/20	59.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/1/20	59.8	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/8/20	48.8	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/15/20	57.9	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/22/20	57.3	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/5/20	62.5	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/12/20	59.8	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/19/20	58.6	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/25/20	57.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	12/3/20	58.2	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
								The pump in LCS-3D was non-operational on 12/10/20 after the liquid level
LCS-3D	12/10/20	59.2	N/A	140		Υ	Heron Dipper T	measurement. Pump repairs are scheduled to be completed on 12/14/20.
								The pump in LCS-3D was non-operational on 12/10/20 after the liquid level
								measurement. Pump repairs were completed on 12/14/20. The pump was fully
LCS-3D	12/18/20	62.9	N/A	140		Υ	Heron Dipper T	operational for the rest of the reporting period.
LCS-3D	12/24/20	66.0	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	12/31/20	67.7	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
								The pump in LCS-3D was non-operational from 1/3/21 - 1/7/21. The pump was
LCS-3D	1/7/21	49.4	N/A	140		N	Heron Dipper T	repaired and became fully operational on 1/8/21.
								The pump in LCS-3D was non-operational from 1/11/21 - 1/13/21. The pump was
LCS-3D	1/14/21	54.8	N/A	140		Υ	Heron Dipper T	repaired and became fully operational on 1/14/21.
LCS-3D	1/21/21	58.4	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/28/21	55.7	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/4/21	60.1	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
								Liquid level measured manually. The LCS-3D pump was non-operational on 2/12/21
								due to a frozen forcemain. The forcemain was frozen the remainder of the weekly
LCS-3D	2/11/21	58.6	N/A	140		Y	Heron Dipper T	reporting period.
								Liquid level measured manually. The LCS-3D pump was non-operational since
								2/12/21 due to a frozen forcemain. The forcemain was frozen the entirety of the
LCS-3D	2/18/21	43.2	N/A	140		N	Heron Dipper T	weekly reporting period.
								Liquid level measured manually. The LCS-3D pump was non-operational on 2/12/21
LCS-3D	2/25/21	56.3	N/A	140		Y	Heron Dipper T	due to a frozen forcemain. The pump became operational again on 2/23/21.
LCS-3D	3/4/21	61.7	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/11/21	62.1	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/18/21	58.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/25/21	59.1	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/1/21	62.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/8/21	56.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/15/21	58.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/22/21	56.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/29/21	59.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/6/21	61.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/13/21	58.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/20/21	62.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually

LCS-3D Liquid Level Below Ground Surface

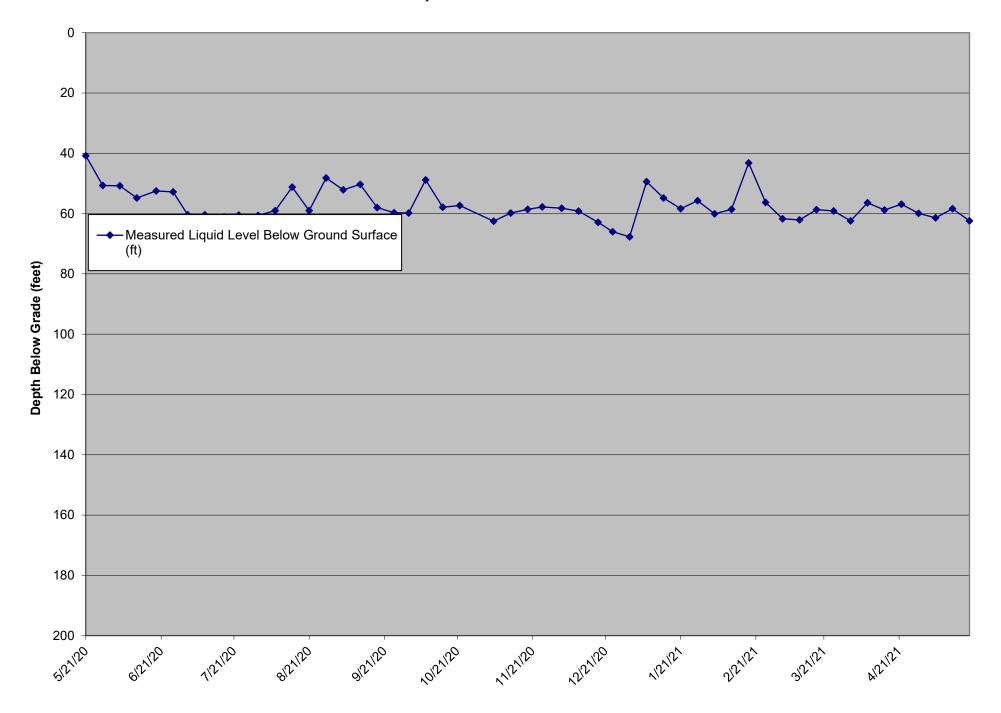


	Date	Measured Liquid	Transducer Depth	Base of Sump	Pump on during		
	Reading	Level Below Ground	from Top of Casing	Elevation	measurement?		
LCS Number	Collected	Surface (ft)	(Ft.)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 4B	5/21/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/28/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/4/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/11/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/18/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/26/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/2/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/9/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/16/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/23/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/31/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/7/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/14/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/21/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/28/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/4/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/11/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/18/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/25/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/1/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/8/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/15/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/22/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/29/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/5/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/12/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/19/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/25/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/3/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/10/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/18/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/24/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/31/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/7/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/14/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/21/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/28/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/4/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/11/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/18/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/25/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/4/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/11/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/18/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/25/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/1/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/8/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/15/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/22/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/29/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/6/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/13/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/20/21	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS

LCS-4B Liquid Level Below Ground Surface

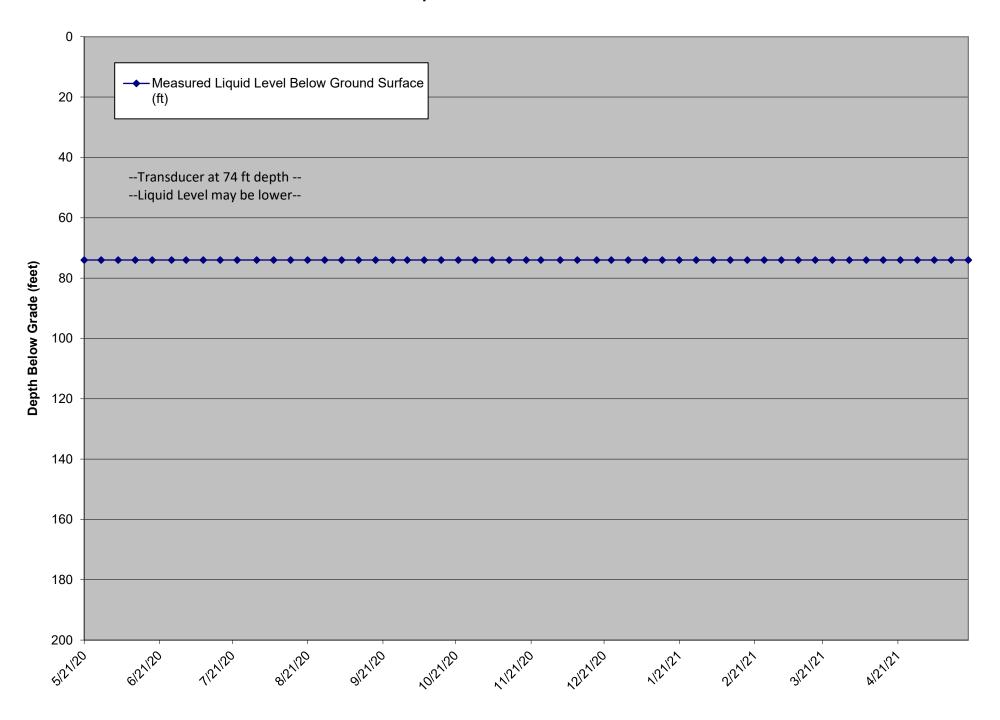

	Date	Magazinad Limitid	Transduces Height	Door of Cump		Claustian of	Duman on during		
	Reading	Measured Liquid Level Above	Transducer Height above Floor of	Base of Sump Elevation	Height of	Elevation of Leachate	Pump on during measurement?		
LCS Number	Collected	Transducer (Ft.)	Quarry (Ft.)	(Ft. MSL)	Liquid (ft)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 5B	5/21/20	11.7	21.9	235.3	33.6	268.90	Y	Dedicated Transducer	<u> </u>
LCS- 5B	5/28/20	11.2	21.9	235.3	33.1	268.40	Υ	Dedicated Transducer	
LCS- 5B	6/4/20	11.1	21.9	235.3	33.0	268.30	Υ	Dedicated Transducer	
LCS- 5B	6/11/20	11.6	21.9	235.3	33.5	268.80	Y	Dedicated Transducer	
LCS- 5B	6/18/20	9.3	21.9	235.3	31.2	266.50	Υ	Dedicated Transducer	
LCS- 5B	6/25/20	11.4	21.9	235.3	33.3	268.60	Υ	Dedicated Transducer	
LCS- 5B	7/2/20	8.9	21.9	235.3	30.8	266.10	Υ	Dedicated Transducer	
LCS- 5B	7/9/20	10.0	21.9	235.3	31.9	267.20	Y	Dedicated Transducer	
LCS- 5B	7/16/20	8.3	21.9	235.3	30.2	265.50	Y	Dedicated Transducer	
LCS- 5B	7/23/20	12.4	21.9	235.3	34.3	269.60	Y	Dedicated Transducer	
LCS- 5B	7/31/20	13.0	21.9	235.3	34.9	270.20	Y	Dedicated Transducer	
LCS- 5B	8/7/20 8/14/20	11.1 14.0	21.9 21.9	235.3 235.3	33.0	268.30 271.20	Y	Dedicated Transducer	
LCS- 5B LCS- 5B	8/14/20	14.0	21.9	235.3	35.9 36.0	271.20	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B LCS- 5B	8/21/20	13.1	21.9	235.3	35.0	271.30	Y		
LC3- 3B	0/20/20	13.1	21.9	235.3	35.0	270.30	T	Dedicated Transducer	The LCS-5B pump was turned off on 8/31/20 for forcemain
LCS- 5B	9/4/20	82.1	21.9	235.3	104.0	339.30	N	Dedicated Transducer	repairs. Forcemain repairs are anticipated to be completed the week of 9/7/20.
LCS- 5B	9/11/20	84.7	21.9	235.3	106.6	341.90	N	Dedicated Transducer	The LCS-5B pump was turned off on 8/31/20 for forcemain repairs. Forcemain repairs are anticipated to be completed the week of 9/7/20.
									The LCS-5B pump was replaced on 9/17/20 and was fully
LCS- 5B	9/18/20	15.0	21.9	235.3	36.9	272.20	Υ	Dedicated Transducer	operational.
									The LCS-5B transducer was found to be non-operational on 9/21/20. The transducer was replaced on 9/24/20 and was fully
LCS- 5B	9/25/20	14.1	21.9	235.3	36.0	271.30	Y	Dedicated Transducer	operational.
LCS- 5B	10/1/20	13.9	21.9	235.3	35.8	271.10	Υ	Dedicated Transducer	
LCS- 5B	10/8/20	14.0	21.9	235.3	35.9	271.20	Υ	Dedicated Transducer	
LCS- 5B	10/15/20	14.1	21.9	235.3	36.0	271.30	Y	Dedicated Transducer	
LCS- 5B	10/22/20	14.8	21.9	235.3	36.7	272.00	Y	Dedicated Transducer	
LCS- 5B	10/29/20	14.2	21.9	235.3	36.1	271.40	Y	Dedicated Transducer	
LCS- 5B	11/5/20 11/12/20	14.1	21.9 21.9	235.3 235.3	36.0 36.0	271.30	Y	Dedicated Transducer	
LCS- 5B LCS- 5B	11/12/20	14.1 14.2	21.9	235.3	36.1	271.30 271.40	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	11/19/20	14.1	21.9	235.3	36.0	271.30	Y	Dedicated Transducer	
LCS- 5B	12/3/20	14.2	21.9	235.3	36.1	271.40	Ϋ́	Dedicated Transducer	
LCS- 5B	12/10/20	14.0	21.9	235.3	35.9	271.20	Y	Dedicated Transducer	
LCS- 5B	12/18/20	13.9	21.9	235.3	35.8	271.10	Ϋ́	Dedicated Transducer	
LCS- 5B	12/24/20	14.0	21.9	235.3	35.9	271.20	Y	Dedicated Transducer	
LCS- 5B	12/31/20	13.9	21.9	235.3	35.8	271.10	Y	Dedicated Transducer	
LCS- 5B	1/7/21	13.9	21.9	235.3	35.8	271.10	Y	Dedicated Transducer	
LCS- 5B	1/14/21	13.8	21.9	235.3	35.7	271.00	Y	Dedicated Transducer	
LCS- 5B	1/21/21	13.8	21.9	235.3	35.7	271.00	Υ	Dedicated Transducer	
LCS- 5B	1/28/21	13.8	21.9	235.3	35.7	271.00	Υ	Dedicated Transducer	
LCS- 5B	2/4/21	13.9	21.9	235.3	35.8	271.10	Υ	Dedicated Transducer	
LCS- 5B	2/11/21	13.6	21.9	235.3	35.5	270.80	Y	Dedicated Transducer	
LCS- 5B	2/18/21	48.2	21.9	235.3	70.1	305.40	N	Dedicated Transducer	The pump in LCS-5B was non-operational on 2/15/21 due to a frozen forcemain. The forcemain was frozen the entirety of the weekly reporting period.
LCS- 5B	2/25/21	13.6	21.9	235.3	35.5	270.80	Y	Dedicated Transducer	The pump in LCS-5B was non-operational on 2/15/21 due to a frozen forcemain. The pump became operational again on 2/25/21.
LCS- 5B	3/4/21	13.8	21.9	235.3	35.7	271.00	Y	Dedicated Transducer Dedicated Transducer	ZIZUIZI.
LCS- 5B	3/11/21	13.9	21.9	235.3	35.8	271.10	Y	Dedicated Transducer	
LCS- 5B	3/18/21	13.5	21.9	235.3	35.4	270.70	Y	Dedicated Transducer	
LCS- 5B	3/25/21	13.5	21.9	235.3	35.4	270.70	Y	Dedicated Transducer	
LCS- 5B	4/1/21	13.5	21.9	235.3	35.4	270.70	Ϋ́	Dedicated Transducer	
LCS- 5B	4/9/21	13.8	21.9	235.3	35.7	271.00	Ϋ́	Dedicated Transducer	
LCS- 5B	4/15/21	13.8	21.9	235.3	35.7	271.00	Y	Dedicated Transducer	
LCS- 5B	4/22/21	13.8	21.9	235.3	35.7	271.00	Υ	Dedicated Transducer	
LCS- 5B	4/29/21	13.3	21.9	235.3	35.2	270.50	Y	Dedicated Transducer	
LCS- 5B	5/6/21	13.5	21.9	235.3	35.4	270.70	Υ	Dedicated Transducer	
LCS- 5B	5/13/21	13.9	21.9	235.3	35.8	271.10	Υ	Dedicated Transducer	
LCS- 5B	5/20/21	14.2	21.9	235.3	36.1	271.40	Υ	Dedicated Transducer	

LCS-5B Liquid Level Above Quarry Floor

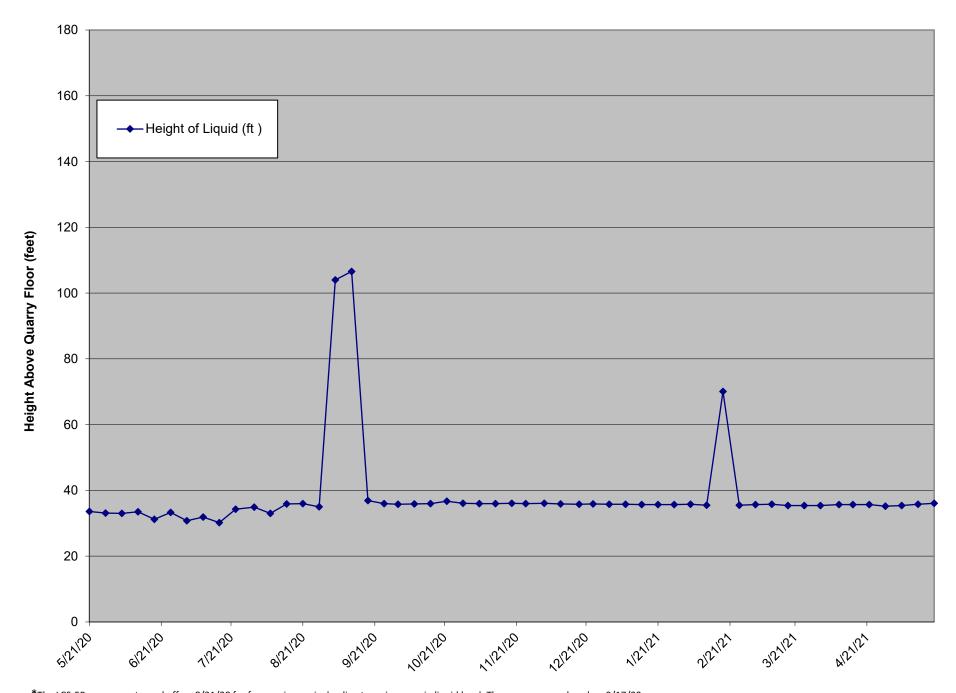

^{*}The LCS-5B pump was turned off on 8/31/20 for forecmain repairs leading to an increase in liquid level. The pump was replaced on 9/17/20.

									T
	Date		Transducer Height	Base of Sump		Elevation of	Pump on during		
	Reading		above Floor of	Elevation	Height of	Leachate	measurement?		
LCS Number	Collected	V	Quarry (Ft.)	(Ft. MSL)	Liquid (ft)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 6B	5/21/20	13.3	9.4	429.52	22.7	452.22	Y	Dedicated Transducer	
LCS- 6B	5/28/20	7.8	9.4	429.52	17.2	446.72	Υ	Dedicated Transducer	
LCS- 6B	6/4/20	8.9	9.4	429.52	18.3	447.82	Υ	Dedicated Transducer	
LCS- 6B	6/11/20	7.9	9.4	429.52	17.3	446.82	Υ	Dedicated Transducer	
LCS- 6B	6/18/20	8.9	9.4	429.52	18.3	447.82	Y	Dedicated Transducer	
LCS- 6B	6/25/20	8.7	9.4	429.52	18.1	447.62	Y	Dedicated Transducer	
LCS- 6B	7/2/20	9.2	9.4	429.52	18.6	448.12	Υ	Dedicated Transducer	
LCS- 6B	7/9/20	9.0	9.4	429.52	18.4	447.92	Υ	Dedicated Transducer	
LCS- 6B	7/16/20	8.7	9.4	429.52	18.1	447.62	Υ	Dedicated Transducer	
LCS- 6B	7/23/20	8.6	9.4	429.52	18.0	447.52	Y	Dedicated Transducer	
LCS- 6B	7/31/20	8.6	9.4	429.52	18.0	447.52	Υ	Dedicated Transducer	
LCS- 6B	8/7/20	8.4	9.4	429.52	17.8	447.32	Υ	Dedicated Transducer	
LCS- 6B	8/14/20	8.7	9.4	429.52	18.1	447.62	Y	Dedicated Transducer	
LCS- 6B	8/21/20	7.2	9.4	429.52	16.6	446.12	Ϋ́	Dedicated Transducer	
LCS- 6B	8/28/20	8.5	9.4	429.52	17.9	447.42	Ý	Dedicated Transducer	
E00-0B	0/20/20	0.0	0.4	420.02	17.5	777.72	'	Dedicated Transducer	The LCS-6B pump was turned off on 8/31/20 for forcemain repairs. Forcemain repairs are
LCS- 6B	9/4/20	15.5	9.4	429.52	24.9	454.42	N	Dedicated Transducer	anticipated to be completed the week of 9/7/20.
	1				1	1			The LCS-6B pump was turned off on 8/31/20 for forcemain repairs. Forcemain repairs are
LCS- 6B	9/11/20	19.4	9.4	429.52	28.8	458.32	N	Dedicated Transducer	anticipated to be completed the week of 9/7/20.
LCS- 6B	9/18/20	20.1	9.4	429.52	29.5	459.02	N	Dedicated Transducer	The LCS-6B pump was turned off on 8/31/20 for forcemain repairs. Forcemain repairs were completed on 9/9/20. The pump in LCS-6B was non-operational when attempts were made to turn it back on after forcemain repairs. Pump repairs are tentatively scheduled for the week of 9/21/20. The LCS-6B pump was turned off on 8/31/20 for forcemain repairs. Forcemain repairs were
LCS- 6B	9/25/20	N/A	N/A	429.52	24.1	453.62	N	Heron Dipper T	completed on 9/9/20. The pump in LCS-6B was non-operational when attempts were made to turn it back on after forcemain repairs. The electric pump in LCS-6B will be converted to a pneumatic pump the week of 9/28/20. Liquid level was measured manually.
	40/4/00			100.50	440	440.00	.,	5: -	The electric pump in LCS-6B was converted to a pneumatic pump on 9/30/20. Liquid level was
LCS- 6B	10/1/20	N/A	N/A	429.52	14.3	443.82	Y	Heron Dipper T	measured manually.
LCS- 6B	10/8/20	N/A	N/A	429.52	6.9	436.42	Y	Heron Dipper T	
LCS- 6B	10/15/20	N/A	N/A	429.52	7.1	436.62	Y	Heron Dipper T	
LCS- 6B	10/22/20	N/A	N/A	429.52	7.5	437.02	Υ	Heron Dipper T	
LCS- 6B	10/29/20	N/A	N/A	429.52	8.0	437.52	Υ	Heron Dipper T	
LCS- 6B	11/5/20	N/A	N/A	429.52	5.3	434.82	Υ	Heron Dipper T	
LCS- 6B	11/12/20	N/A	N/A	429.52	5.8	435.32	Υ	Heron Dipper T	
LCS- 6B	11/19/20	N/A	N/A	429.52	5.3	434.82	Υ	Heron Dipper T	
LCS- 6B	11/25/20	N/A	N/A	429.52	5.3	434.82	Υ	Heron Dipper T	
LCS- 6B	12/3/20	N/A	N/A	429.52	5.0	434.52	Υ	Heron Dipper T	
LCS- 6B	12/10/20	N/A	N/A	429.52	5.8	435.32	Υ	Heron Dipper T	
LCS- 6B	12/18/20	N/A	N/A	429.52	5.2	434.72	Υ	Heron Dipper T	
LCS- 6B	12/24/20	N/A	N/A	429.52	5.1	434.62	Y	Heron Dipper T	
LCS- 6B	12/31/20	N/A	N/A	429.52	5.4	434.92	Ϋ́	Heron Dipper T	Pump operational; liquid level measured manually
LCS- 6B	1/7/21	N/A	N/A	429.52	5.5	435.02	Ϋ́	Heron Dipper T	Pump operational; liquid level measured manually
LCS- 6B	1/14/21	N/A	N/A	429.52	7.5	437.02	Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS- 6B	1/21/21	N/A	N/A	429.52	6.7	436.22	Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS- 6B	1/28/21	N/A	N/A	429.52	6.7	436.22	Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS- 6B	2/4/21	N/A N/A	N/A N/A	429.52	6.8	436.32	Y	Heron Dipper T	Pump operational; liquid level measured manually
									The LCS-6B pump was non-operational on 2/9/21 due to a frozen forcemain. The forcemain was
LCS- 6B	2/11/21	N/A N/A	N/A N/A	429.52 429.52	14.6	444.12 446.02	N N	Heron Dipper T Heron Dipper T	frozen the remainder of the weekly reporting period. The LCS-6B pump was non-operational since 2/9/21 due to a frozen forcemain. The forcemain was frozen the entirety of the weekly reporting period.
		·							The LCS-6B pump was non-operational on 2/9/21 due to a frozen forcemain. The pump became
LCS- 6B	2/25/21	N/A	N/A	429.52	8.0	437.52	Y	Heron Dipper T	operational again on 2/22/21
LCS- 6B	3/4/21	N/A	N/A	429.52	7.7	437.22	Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS- 6B	3/11/21	N/A	N/A	429.52	7.1	436.62	Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS- 6B	3/18/21	N/A	N/A	429.52	6.9	436.42	Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS- 6B	3/25/21	N/A	N/A	429.52	8.3	437.82	Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS- 6B	4/1/21	N/A	N/A	429.52	10.5	440.02	Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS- 6B	4/8/21	N/A	N/A	429.52	7.0	436.52	Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS- 6B	4/15/21	N/A	N/A	429.52	6.9	436.42	Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS- 6B	4/22/21	N/A	N/A	429.52	6.8	436.32	Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS- 6B	4/29/21	N/A	N/A	429.52	6.9	436.42	Y	Heron Dipper T	Pump operational: liquid level measured manually
LCS- 6B	5/6/21	N/A	N/A	429.52	6.9	436.42	Ý	Heron Dipper T	Pump operational; liquid level measured manually
LCS- 6B	5/13/21	N/A	N/A	429.52	6.8	436.32	Ý	Heron Dipper T	Pump operational; liquid level measured manually
				429.52	6.8	436.32	Ÿ	Heron Dipper T	Pump operational; liquid level measured manually
LCS- 6B	5/20/21	N/A	N/A	429.52					

LCS-6B Liquid Level Above Quarry Floor

