
LCS-6B Liquid Level Above Quarry Floor

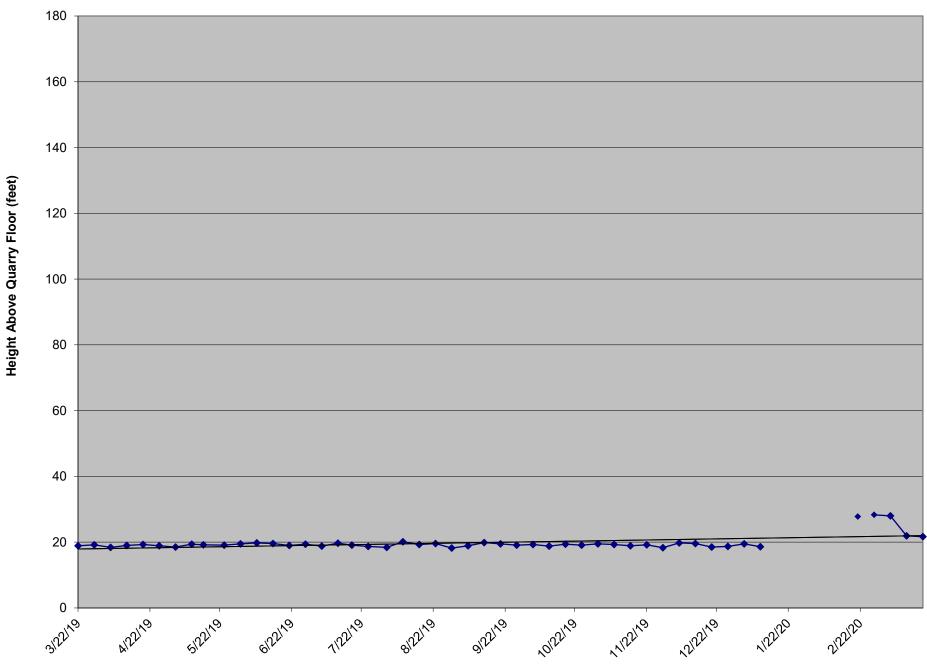


The transducer became non-operational on 1/13/20. Liquid level was measured manually on 2/21/20, 2/28/20 and 3/6/20. The transducer became operational on 3/13/20.

	Party Named	Manager square same flame former flames	Transmiss Rept Soon Report	Reserve Auto	Purpose many		
					-		
WA 9	-		-	e e		Introd System	
			=	200	=		
32.5	-		-	200	-	Deliver Senter	
45.0			-	800		Indicated Transaction	
WA 9	-	30.4	-	e e	÷	Introd System	
200.0	-	37.4	27	64.0		Introd trader	
===	=	==	=	=			
200.0	-	37.4	27	64.0		Introd trader	
===	=	==	=	=			
20.0	127	-	- 2	640		Deliver Senter	
===	Ξ	==	=	=			
45.7	3227	21	- 23	600	-	belood broken	
===	=	==	=	=			
	=	-	=	-			
22.0 22.0	Annual Annual		- 27	800		Deliver Treatment	Party of Australian Section 2015
	=		=	==	-		
200.0	1007		27	64.0	-	Introd trader	
===	=		=	=	-		
200.0	107		27	64.0	-	Introd trader	
==	=				÷		
45.2	-		- 21	60	-	bened bashing	
					-		Party of the management of the party and the state of the section of the section of
105.00	-			60.00	,	the set house.	Purp of to numerous Purp and tendent schedulers to agreed
							Any of his numbers on Any are random specimen pushing an
115.90			-	840		Deliver Treatment	Any of the management Purp and transfers represent puring and there are the management Purp and transfers represent a factor for
	_			-			Any of the management Purp did hashing represent a resource
100.00		-			-	Delicate Delicates	nery and translation. Pully and translate represent proposed in Party 41 for management Pully and translate represent proposed in
							Party of the transaction from and tendence represented properties.
				-	_	Delicate Transport	hery at the management has particulate squarest proposed in
105.00	1000	_	-	600	-	Deliver Treatment	harp of terraments. Puls and tenders squarted project of their of terraments. Puls and tenders squarted contents
	=				=		Party of the management, the by and transfer represent the property of
105.00			-	600		Deliver Transcor	Purp of the hardware. Purp and transfers represent a find-ball. Purp represent this part for said of \$1.10 Purp shade attribute.
	Е		⊑.		드		
25.7	-		-	200		1000	
25.2	E		-	6/0		named banks	
32.5			-	200	-	Deliver Senter	
	-		-		-		Purp represent energy of the or A TOTAL SEE ASSESSMENT AND ASSESSMENT AND ASSESSMENT ASS
100.00	1307			60.0		being body	
			-				
	-		_	-			Personal and the second of the
105.00	100			20.00		between Treatment	Marrie party configurations place at \$15/14 Purpoprosperal articles
	-		_		-		Same party resident has place at \$1416. Purp strong and
105.00	****			60.00	,	the set house.	Status purp modern has been a \$1215. Purp samp and
	_			-			Name party residence has pass at \$1976. Purp party and
105.00	411		-	800		between Transactive	Barrier puris moderne min para di STATA. Puro samp are Barrier puro moderne min para di STATA. Puro samp are
105.70			-	es a		NAME AND ADDRESS.	Status para condesse has pass at 61416. Para parka ass Status para condesse has pass at 61416. Para parka ass
			_		-		Share your modern has pass at \$1216. Purp sompass
105.00	177		- 10	60.00		benefiteasy.	Same party conductors in gard at \$150. Purp some are
	_						Barrer purposedant has para at \$1000. Purposers
105.00	100			No.	-	Deliver Treatment	Same party conductor to the an ANATA Party sampless Same party conductor that place as ANATA Party sampless
							Same your conductions have at \$1000. Any same are
105.10	-		-	AL II		Deliver Transport	Share you're contained that the same and the
	-		-	-			Same party conductivities place at \$1574. Purp party and Same party conductivities place at \$1574. Purp party and
	_		-	-			Share your condense that you as the first during an open
105.00	200		-	60.0		thereof bearing	Same party conductor has place at \$1416. Purp sampless
	_				-		Barry pary residence has place at \$1000. Purp party and
100.00				AL II		thereof beauting	Barry part makes and part of their Responses
	_		_		-		Same party modern man pass of \$1000. New party and
100.00			-	ALI		NAME OF TAXABLE	Elementer and producer to the product of the produc
			_		-		States purp condens has pass at \$1576. Purp states and
			_				Barra para matematika para a 1994. Anji awap asi
105.00	200		-	ALI		before beauty	Share your condens the part of \$1000. Purp strap and
	-		-	-			Share you contact on the a NATA first property
105.00				400		Second Second	Same party residence has party at 1 and 1 Anny party and
	-	H	H=-		H-Ē		Rent party makes has pass at \$1010. Purp many and them to party makes has pass at \$1010. Purp many and
	_				Ė		Sample control parameter Annual control
105.79	1257		-	848	<u> </u>	Date of Tables	Share built company and from a party back to the back to a
	F	_	-		F		Name you conduct his pass of \$1016. Any owner or Name you conduct his pass of \$1016. Any owner or
W5.9	111		-	640	-	being bases	Name you produce his day in \$1018. Purp story are
105.7	277		-		-	terror trac	Rent para meleor has place at \$1016. Purp sturip and
							Manus puny medican has place at 610°M. Puny many and Manus puny medican has place at 610°M. Puny many and
10.0				600		Delicate Transport	Name party condesion has place at \$1.575. Purp sturing and
	-	H	H=-		H-Ē		Name party resident has place at \$1010. Purp many and Name party resident has place at \$1010. Purp many and
105.00			-	644		below beauty	Name you condens the last of \$1000. But you properly
							Security respective to a state but worker
			- 177	600		Deliver Treatment	Barrery and conduction place in \$1016. Purp strop are
	7363						
10.0	1000		-	60.00		Indicated Transact	Status purp condition has been a \$1916. Purp samp and
			Ξ	-	÷	Todayor Todayor	Barrier punty annotation from gave at \$1.514 Punty punty and security annotation of the security annotation and security annotation and security annotation from the \$1.514 Punty annotation from plant at \$1.514 Punty annotation and security annotation and plant at \$1.514 Punty annotation and security annotation and plant at \$1.514 Punty annotation and security annotation and plant at \$1.514 Punty annotation and security
	-		=		÷	Interest Section	Share and produce has pure a NATA Purp share and Share and produce has pure a NATA Purp share and Share and produce has pure a NATA Purp share and Share and produce has pure a NATA Purp share and Share and produce has pure a NATA Purp share and Share and produces has pure a NATA Purp share and
					į	here have	Service party medicine rate grape or 6 1/14 ft. Party many and Service party medicine rate part or 6 1/15 ft. Party many and Service party medicine rate gave or 6 1/15 ft. Party many and Service party medicine rate gave in 6 1/15 ft. Party many and Service party medicine rate gave in 6 1/15 ft. Party many and Service party medicine rate gave in 6 1/15 ft. Party many and Service party medicine rate gave in 6 1/15 ft. Party many and Service party medicine rate gave in 6 1/15 ft. Party many and
20 V				**************************************	1	being body	Section processes and part at NAME And product of Management and part at NAME And product of Management and part at NAME And product of Management and part at NAME And part of Management and part of NAME AND part of N
				### ### ### ###		Total Control	
						Defined Function Defined Function Defined Function Defined Function Defined Function Defined Function	Manifestina de la companio del la companio de la companio de la companio del la companio
20. W				### ##################################		Description of the control of the co	Section Section 2012 - 10 Per 1 Per
				### ### ### ### ### ### ### ### ###		Patrick Tracker	Management of the Control of the Con
100 M			20 20 20 20 20 20 20 20 20 20 20 20 20 2	200 200 200 200 200 200 200 200 200 200		Description of the second control of the sec	Montangement of a Control of the Con
105 W			20 20 20 20 20 20 20 20 20 20 20 20 20 2	200 200 200 200 200 200 200 200 200 200		Description of the same of the	
100 to 10			20 20 20 20 20 20 20 20 20 20 20 20 20 2	### ### ### ### ### ### ### ### ### ##		Description of Teacher	
100 to 10			27 27 27 27 27 27 27 27 27 27 27 27 27 2	#10 #10 #10 #10 #10 #10 #10 #10 #10 #10		Particular Transfer Particular Transfer Particular Transfer Particular Transfer Particular Transfer Particular Transfer	
100 m			22 22 22 22 22 22 22 22 22 22 22 22 22	### ### ### ### ### ### ### ### ### ##		Manual Yanaba Manual Yanaba Manual Yanaba Manual Yanaba Manual Yanaba Manual Yanaba	
105 0 105 0			20 20 20 20 20 20 20 20 20 20 20 20 20 2	#19 #19 #19 #19 #19 #19 #19 #19 #19 #19		Ballon Tables Ballon Tables Ballon Tables Ballon Tables Ballon Tables Ballon Tables	
105 0 105 0			20 20 20 20 20 20 20 20 20 20 20 20 20 2	200 200 200 200 200 200 200 200 200 200		Indicate Values Indica	
100 m			10 10 10 10 10 10 10 10 10 10 10 10 10 1	# 10 mm m m m m m m m m m m m m m m m m m		Manager Talabase	
100 mm (100 mm			100 mm m	#100 #100 #100 #100 #100 #100 #100 #100		Manager Talabase	
100 m			100 mm m	200 200 200 200 200 200 200 200 200 200			
333 333 333 333 333 333 333 333 333 33			100 mm m	### ### ### ### ### ### ### ### ### ##		AND TABLE	
333			20			ADDRESS TO A SECOND STATE OF THE SECOND STATE	

	Date	Measured Liquid	Transducer Height	Base of Sump	Elevation of	Pump on during		
	Reading	Level Above	above Floor of	Elevation	Leachate	measurement?		
LCS Number	Collected	Transducer (Ft.)	Quarry (Ft.)	(Ft. MSL)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 2D	3/22/19	N/A	14.4	235.92	,	N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/29/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/5/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/12/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/19/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/26/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/3/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/10/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/15/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/24/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/31/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/7/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/14/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/21/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/28/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/5/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/12/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/18/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/25/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/2/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/9/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/16/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/23/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/30/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/6/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/13/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/20/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/27/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	10/4/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	10/11/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	10/18/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	10/25/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	11/1/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	11/8/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	11/15/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	11/29/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/6/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/13/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/20/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/27/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/3/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/10/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/17/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/24/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/31/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/7/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/14/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/21/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/28/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/6/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D LCS- 2D	3/13/20 3/20/20	N/A N/A	14.4 14.4	235.92 235.92		N N	Dedicated Transducer Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LU3- ZD	3/20/20	IN/A	14.4	230.92		IN	Dedicated Haristucer	PCP Installed to depth of 62' BGS, failed stator, needs replacement


				Well Total Depth				
	Date	Measured Liquid	Transducer Depth	from Top of	Elevation of	Pump on during		
	Reading	Level Below Ground	from Top of Casing	Casing (Ft.)	Leachate	measurement?		
LCS Number	Collected	Surface (ft)	(Ft.)	(Ft. MSL)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS-3D	3/22/19	36.8	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/29/19	36.0	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/5/19	36.1	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/12/19	36.5	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/19/19	35.9	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/26/19	36.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/3/19	35.2	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/10/19	35.1	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/15/19	34.6	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/24/19	35.3	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/31/19	37.5	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/7/19	39.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/14/19	39.7	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/21/19	39.1	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/28/19	39.6	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/5/19	39.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/12/19	36.4	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/18/19	36.5	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/25/19	37.1	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/2/19	37.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/9/19	34.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/16/19	34.2	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/23/19	34.4	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/30/19	32.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/6/19	32.1	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/13/19	32.5	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/20/19	35.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/27/19	37.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/4/19	42.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/11/19	43.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/18/19	44.5	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/25/19	48.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/1/19	49.5	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/8/19	51.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/15/19	52.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/22/19	52.1	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/27/19	51.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	12/6/19	52.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	12/13/19	51.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	12/20/19	52.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	12/27/19	51.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/3/20	49.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/10/20	49.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/17/20	46.4	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/24/20	41.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/31/20	41.2	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/7/20	43.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/14/20	47.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/21/20	48.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/28/20	48.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/6/20	49.9	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/13/20	47.3	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/20/20	62.1	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually

LCS-3D Liquid Level Below Ground Surface

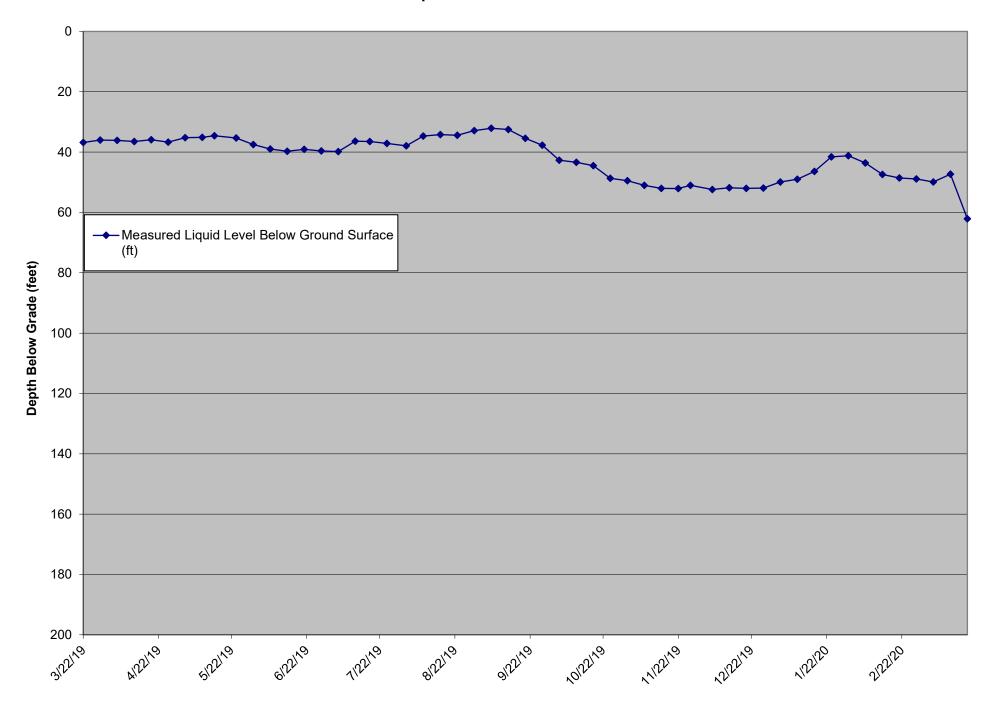


	Date	Measured Liquid	Transducer Depth	Base of Sump	Pump on during		
	Reading	Level Below Ground	from Top of Casing	Elevation	measurement?		
LCS Number	Collected	Surface (ft)	(Ft.)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 4B	3/22/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/29/19	74.0	81.0	244.00	Y	Dedicated Transducer Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0 BGS
LCS- 4B	4/5/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/12/19	74.0	81.0	244.00	Y	Dedicated Transducer Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0 BGS
LCS- 4B	4/12/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0 BGS
LCS- 4B	4/26/19	74.0	81.0	244.00	Y	Dedicated Transducer Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0 BGS
LCS- 4B	5/3/19	74.0	81.0	244.00	Y	Dedicated Transducer Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0 BGS
LCS- 4B	5/10/19	74.0	81.0	244.00	Y	Dedicated Transducer Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0 BGS
LCS- 4B	5/15/19	74.0	81.0	244.00	Y	Dedicated Transducer Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0 BGS
LCS- 4B	5/24/19	74.0	81.0	244.00	Y	Dedicated Transducer Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0 BGS Pump operational, no flow detected, liquid level >74.0 BGS
LCS- 4B	5/31/19	74.0	81.0	244.00	Y	Dedicated Transducer Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0 BGS Pump operational, no flow detected, liquid level >74.0 BGS
LCS- 4B	6/7/19	74.0	81.0	244.00	Y	Dedicated Transducer Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0 BGS Pump operational, no flow detected, liquid level >74.0 BGS
LCS- 4B	6/14/19	74.0	81.0	244.00	Y	Dedicated Transducer Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0 BGS Pump operational, no flow detected, liquid level >74.0 BGS
LCS- 4B	6/21/19	74.0	81.0	244.00	Y	Dedicated Transducer Dedicated Transducer	, , ,
LCS- 4B	6/21/19	74.0	81.0	244.00	Y	Dedicated Transducer Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS Pump operational, no flow detected, liquid level >74.0' BGS
					Y		
LCS- 4B	7/5/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/12/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/18/19	74.0 74.0	81.0	244.00		Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/25/19		81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/2/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/9/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/16/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/23/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/30/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/6/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/13/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/20/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/27/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/4/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/11/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/18/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/25/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/1/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/8/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/15/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/22/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/29/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/6/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/13/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/20/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/27/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/3/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/10/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/17/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/24/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/31/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/7/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/14/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/21/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/28/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/6/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/13/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/20/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS

LCS-4B Liquid Level Below Ground Surface

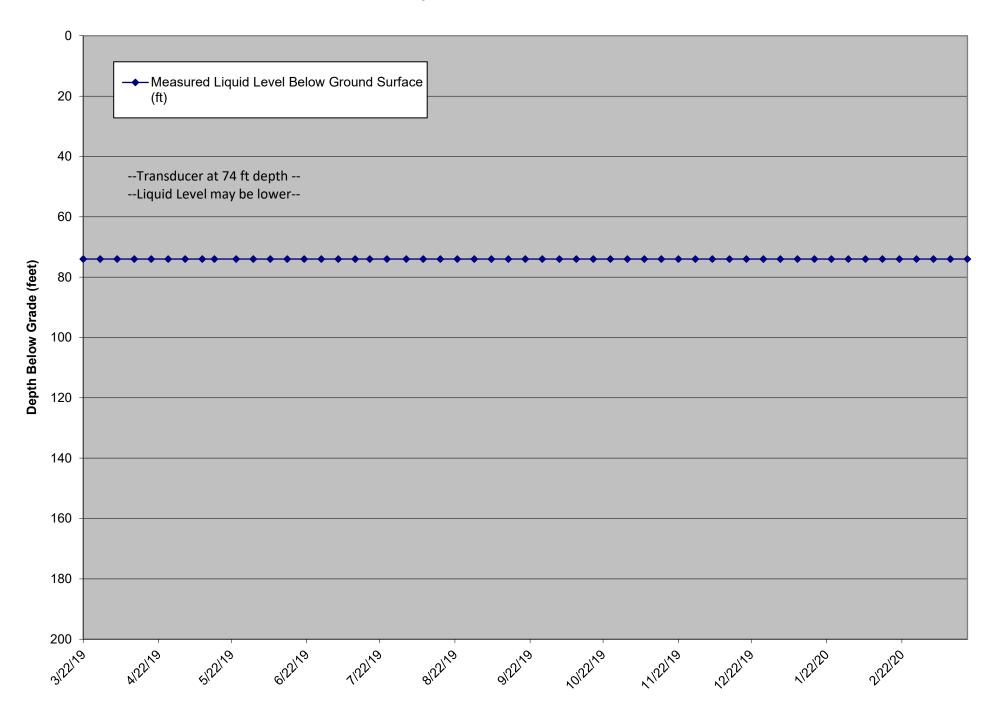

	Date	Measured Liquid	Transducer Height	Base of Sump		Elevation of	Pump on during		
	Reading	Level Above	above Floor of	Elevation	Height of	Leachate	measurement?		
LCS Number	Collected	Transducer (Ft.)	Quarry (Ft.)	(Ft. MSL)	Liquid (ft)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 5B	3/22/19	12.6	21.9	235.3	34.5	269.80	Y	Dedicated Transducer	
LCS- 5B	3/29/19	13.6	21.9	235.3	35.5	270.80	Y	Dedicated Transducer	
LCS- 5B LCS- 5B	4/4/19 4/12/19	12.1 13.0	21.9 21.9	235.3 235.3	34.0 34.9	269.30 270.20	Y	Dedicated Transducer Dedicated Transducer	
LCS-5B	4/12/19	12.2	21.9	235.3	34.9	269.40	Y	Dedicated Transducer Dedicated Transducer	
LCS-5B	4/26/19	12.5	21.9	235.3	34.4	269.70	Ÿ	Dedicated Transducer	
									Pump was observed to be non-operational on 5/1/19. Pump was
LCS- 5B	5/3/19	13.3	21.9	235.3	35.2	270.50	Y	Dedicated Transducer	replaced on 5/3/19
LCS- 5B	5/10/19	11.6	21.9	235.3	33.5	268.80	Ϋ́	Dedicated Transducer	10 5 10 00 10
LCS- 5B	5/15/19	11.9	21.9	235.3	33.8	269.10	Υ	Dedicated Transducer	
LCS- 5B	5/24/19	13.1	21.9	235.3	35.0	270.30	Y	Dedicated Transducer	
LCS- 5B	5/31/19	11.6	21.9	235.3	33.5	268.80	Y	Dedicated Transducer	
LCS- 5B LCS- 5B	6/7/19 6/14/19	12.7 12.7	21.9 21.9	235.3 235.3	34.6 34.6	269.90 269.90	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	6/21/19	11.7	21.9	235.3	33.6	268.90	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	6/28/19	13.2	21.9	235.3	35.1	270.40	Ϋ́	Dedicated Transducer	
LCS- 5B	7/5/19	12.2	21.9	235.3	34.1	269.40	Y	Dedicated Transducer	
LCS- 5B	7/12/19	13.4	21.9	235.3	35.3	270.60	Y	Dedicated Transducer	
LCS- 5B	7/18/19	11.6	21.9	235.3	33.5	268.80	Y	Dedicated Transducer	
LCS- 5B	7/25/19	12.8	21.9 21.9	235.3	34.7	270.00 270.70	Y	Dedicated Transducer	
LCS- 5B LCS- 5B	8/2/19 8/9/19	13.5 11.3	21.9	235.3 235.3	35.4 33.2	268.50	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	8/16/19	12.6	21.9	235.3	34.5	269.80	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	8/23/19	12.5	21.9	235.3	34.4	269.70	Y	Dedicated Transducer	
LCS-5B	8/30/19	12.3	21.9	235.3	34.2	269.50	Y	Dedicated Transducer	
LCS- 5B	9/6/19	11.1	21.9	235.3	33.0	268.30	Y	Dedicated Transducer	
LCS- 5B	9/13/19	12.6	21.9	235.3	34.5	269.80	Y	Dedicated Transducer	
LCS- 5B	9/20/19	12.8	21.9	235.3	34.7	270.00	Y	Dedicated Transducer	
LCS- 5B LCS- 5B	9/27/19 10/4/19	13.0 12.2	21.9 21.9	235.3 235.3	34.9 34.1	270.20 269.40	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	10/11/19	13.3	21.9	235.3	35.2	270.50	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	10/18/19	11.5	21.9	235.3	33.4	268.70	Y	Dedicated Transducer	
LCS- 5B	10/25/19	12.7	21.9	235.3	34.6	269.90	Υ	Dedicated Transducer	
LCS-5B	11/1/19	12.3	21.9	235.3	34.2	269.50	Υ	Dedicated Transducer	
LCS- 5B	11/8/19		21.9	235.3		235.30	N	Dedicated Transducer	The transducer was observed to be non-operational on 11/6/19. Transducer replacement is scheduled on 11/13/19.
LCS- 5B	11/15/19		21.9	235.3		235.30	N	Dedicated Transducer	The transducer was observed to be non-operational on 11/6/19 and was replaced on 11/13/19. After transducer replacement, pump was non-operational due to suspected frozen forcemain section. Troubleshooting will continue the week of 11/18/19.
									,
100 50	44/00/40	44.7	04.0	005.0	00.0	000.00		Butto de d'Esseratura	The transducer was observed to be non-operational on 11/6/19 and was replaced on 11/13/19. After transducer replacement, pump was non-operational due to suspected frozen forcemain section. The pump and motor were replaced on 11/19/19 and
LCS- 5B LCS- 5B	11/22/19 11/29/19	11.7 11.0	21.9 21.9	235.3 235.3	33.6 32.9	268.90 268.20	Y	Dedicated Transducer Dedicated Transducer	LCS-5B became fully operational.
LCS- 5B	12/6/19	12.4	21.9	235.3	34.3	269.60	Y	Dedicated Transducer	
LCS- 5B	12/13/19	12.0	21.9	235.3	33.9	269.20	Ϋ́	Dedicated Transducer	
LCS- 5B	12/20/19	13.1	21.9	235.3	35.0	270.30	Υ	Dedicated Transducer	
LCS- 5B	12/27/19	10.0	21.9	235.3	31.9	267.20	Y	Dedicated Transducer	
LCS- 5B	1/3/20	11.3	21.9	235.3	33.2	268.50	Y	Dedicated Transducer	
LCS- 5B LCS- 5B	1/10/20 1/17/20	12.4 11.3	21.9 21.9	235.3 235.3	34.3 33.2	269.60 268.50	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	1/1//20	13.0	21.9	235.3	34.9	270.20	Y	Dedicated Transducer	
LCS- 5B	1/31/20	11.7	21.9	235.3	33.6	268.90	Ϋ́	Dedicated Transducer	
LCS- 5B	2/7/20	12.6	21.9	235.3	34.5	269.80	Υ	Dedicated Transducer	
LCS- 5B	2/14/20	12.3	21.9	235.3	34.2	269.50	Y	Dedicated Transducer	
LCS- 5B	2/21/20	11.3	21.9	235.3	33.2	268.50	Y	Dedicated Transducer	
LCS-5B	2/28/20 3/6/20	11.6 10.3	21.9 21.9	235.3	33.5	268.80 267.50	Y	Dedicated Transducer	
LCS- 5B LCS- 5B	3/6/20	11.2	21.9	235.3 235.3	32.2 33.1	268.40	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	3/20/20	12.3	21.9	235.3	34.2	269.50	Ÿ	Dedicated Transducer Dedicated Transducer	
L00- 3D	3/20/20	12.0	21.0	200.0	J-4.2	203.50	<u>'</u>	Dedicated Hansautel	ļ

LCS-5B Liquid Level Above Quarry Floor

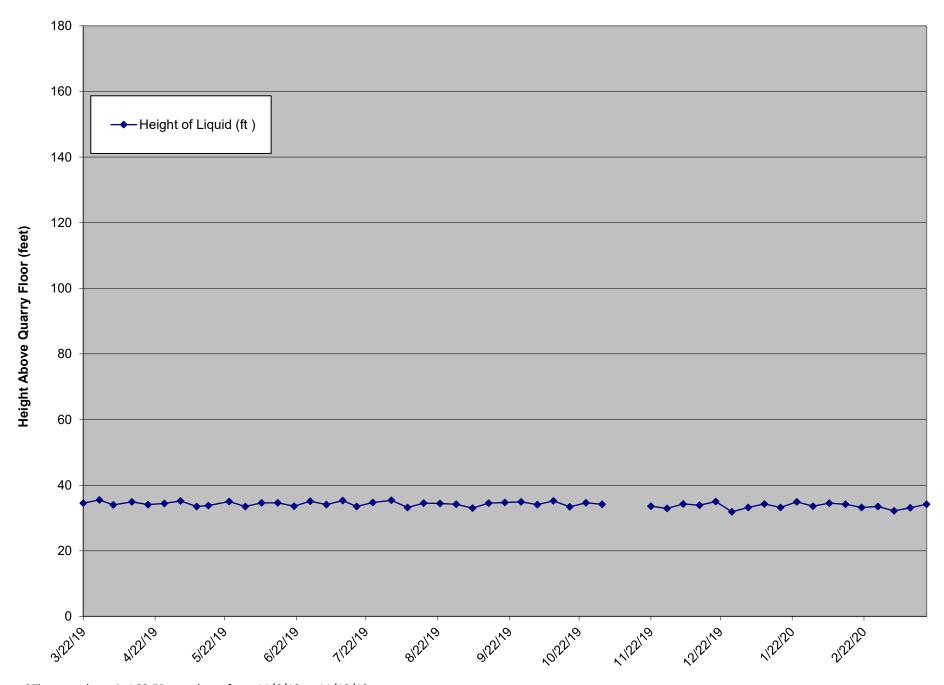

^{*}The transducer in LCS-5B was down from 11/6/19 to 11/19/19.

	Date		Transducer Height	Base of Sump		Elevation of	Pump on during		
	Reading		above Floor of	Elevation	Height of	Leachate	measurement?		
LCS Number	Collected	V	Quarry (Ft.)	(Ft. MSL)	Liquid (ft)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 6B	3/22/19	9.5	9.4	429.52	18.9	448.42	Υ	Dedicated Transducer	
LCS- 6B	3/29/19	9.8	9.4	429.52	19.2	448.72	Υ	Dedicated Transducer	
LCS- 6B	4/5/19	9.0	9.4	429.52	18.4	447.92	Y	Dedicated Transducer	
LCS- 6B	4/12/19 4/19/19	9.6 9.9	9.4 9.4	429.52 429.52	19.0	448.52	Y	Dedicated Transducer	
LCS- 6B LCS- 6B	4/19/19	9.9	9.4	429.52 429.52	19.3 18.9	448.82 448.42	Y Y	Dedicated Transducer Dedicated Transducer	
LCS- 6B	5/3/19	9.5	9.4	429.52	18.5	448.02	Y	Dedicated Transducer Dedicated Transducer	
LCS- 6B	5/10/19	10.0	9.4	429.52	19.4	448.92	Y	Dedicated Transducer	
LCS- 6B	5/15/19	9.8	9.4	429.52	19.2	448.72	Ϋ́	Dedicated Transducer	
LCS- 6B	5/24/19	9.7	9.4	429.52	19.1	448.62	Y	Dedicated Transducer	
LCS- 6B	5/31/19	10.1	9.4	429.52	19.5	449.02	Y	Dedicated Transducer	
LCS- 6B	6/7/19	10.4	9.4	429.52	19.8	449.32	Y	Dedicated Transducer	
LCS- 6B	6/14/19	10.2	9.4	429.52	19.6	449.12	Y	Dedicated Transducer	
LCS- 6B	6/21/19	9.6	9.4	429.52	19.0	448.52	Y	Dedicated Transducer	
LCS- 6B LCS- 6B	6/28/19 7/5/19	10.0 9.4	9.4 9.4	429.52 429.52	19.4 18.8	448.92 448.32	Y	Dedicated Transducer Dedicated Transducer	
LCS- 6B	7/12/19	10.3	9.4	429.52	19.7	440.32	Y	Dedicated Transducer Dedicated Transducer	
LCS- 6B	7/12/19	9.7	9.4	429.52	19.7	449.22	Y	Dedicated Transducer Dedicated Transducer	
LCS- 6B	7/25/19	9.3	9.4	429.52	18.7	448.22	Ϋ́	Dedicated Transducer	
LCS- 6B	8/2/19	9.0	9.4	429.52	18.4	447.92	Ϋ́	Dedicated Transducer	
LCS- 6B	8/9/19	10.7	9.4	429.52	20.1	449.62	Y	Dedicated Transducer	
LCS- 6B	8/16/19	9.9	9.4	429.52	19.3	448.82	Υ	Dedicated Transducer	
LCS- 6B	8/23/19	10.2	9.4	429.52	19.6	449.12	Υ	Dedicated Transducer	
LCS- 6B	8/30/19	8.8	9.4	429.52	18.2	447.72	Y	Dedicated Transducer	
LCS- 6B	9/6/19	9.5	9.4	429.52	18.9	448.42	Y	Dedicated Transducer	
LCS- 6B LCS- 6B	9/13/19 9/20/19	10.5 10.1	9.4 9.4	429.52 429.52	19.9 19.5	449.42 449.02	Y	Dedicated Transducer	
LCS- 6B	9/27/19	9.7	9.4	429.52	19.5	448.62	Y	Dedicated Transducer Dedicated Transducer	
LCS- 6B	10/4/19	9.9	9.4	429.52	19.3	448.82	Y	Dedicated Transducer	
LCS- 6B	10/11/19	9.4	9.4	429.52	18.8	448.32	Ý	Dedicated Transducer	
LCS- 6B	10/18/19	10.0	9.4	429.52	19.4	448.92	Y	Dedicated Transducer	
LCS- 6B	10/25/19	9.7	9.4	429.52	19.1	448.62	Y	Dedicated Transducer	
LCS- 6B	11/1/19	10.1	9.4	429.52	19.5	449.02	Υ	Dedicated Transducer	
LCS- 6B	11/8/19	9.9	9.4	429.52	19.3	448.82	Υ	Dedicated Transducer	
LCS- 6B	11/15/19	9.5	9.4	429.52	18.9	448.42	Y	Dedicated Transducer	
LCS- 6B LCS- 6B	11/22/19 11/29/19	9.8 8.9	9.4 9.4	429.52 429.52	19.2 18.3	448.72 447.82	Y	Dedicated Transducer Dedicated Transducer	
LCS- 6B	12/6/19	10.4	9.4	429.52	19.8	447.62	Y	Dedicated Transducer Dedicated Transducer	
LCS- 6B	12/13/19	10.2	9.4	429.52	19.6	449.12	Y	Dedicated Transducer	
LCS- 6B	12/20/19	9.1	9.4	429.52	18.5	448.02	Y	Dedicated Transducer	
LCS- 6B	12/27/19	9.3	9.4	429.52	18.7	448.22	Y	Dedicated Transducer	
LCS- 6B	1/3/20	10.1	9.4	429.52	19.5	449.02	Y	Dedicated Transducer	
LCS- 6B	1/10/20	9.2	9.4	429.52	18.6	448.12	Υ	Dedicated Transducer	
LCS- 6B	1/17/20		9.4	429.52			N	Dedicated Transducer	The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is pending replacement parts arrival.
LCS- 6B	1/24/20		9.4	429.52			N	Dedicated Transducer	The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is pending replacement parts arrival.
	4/0			100 ==				5 "	The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is
LCS- 6B	1/31/20		9.4	429.52		ļ	N	Dedicated Transducer	pending replacement parts arrival.
LCS- 6B	2/7/20		9.4	429.52			N	Dedicated Transducer	The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is pending replacement parts arrival.
LCS- 6B	2/14/20		9.4	429.52			N	Dedicated Transducer	The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is pending replacement parts arrival.
LCS- 6B	2/21/20	N/A	N/A	429.52	27.8	457.32	N	Heron Dipper T	The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is pending replacement parts arrival. Liquid level was measured manually.
LCS- 6B	2/28/20	N/A	N/A	429.52	28.3	457.82	N	Heron Dipper T	The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is tentatively scheduled the week of 3/9/20. Liquid level was measured manually.
LCS- 6B	3/6/20	N/A	N/A	429.52	28.0	457.52	N	Heron Dipper T	The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is scheduled for 3/11/20. Liquid level was measured manually.
						451.42	~		The LCS-6B transducer was replaced on 3/11/20 and the pump became fully operational. The LCS-6B pump was observed to be non-operational on 3/12/20. The LCS-6B pump was replaced on 3/13/20. LCS-6B became fully operational on 3/13/20.
LCS- 6B LCS- 6B	3/13/20 3/20/20	12.5 12.3	9.4 9.4	429.52 429.52	21.9 21.7	451.42 451.22	Y V	Dedicated Transducer Dedicated Transducer	3/13/20. LG3-0B Decame runy operational on 3/13/20.
LOO- 0D	3120120	12.0	J. 4	423.32	21.1	401.22	· ·	Douldated Transoutcel	<u> </u>