
## LCS-6B Liquid Level Above Quarry Floor

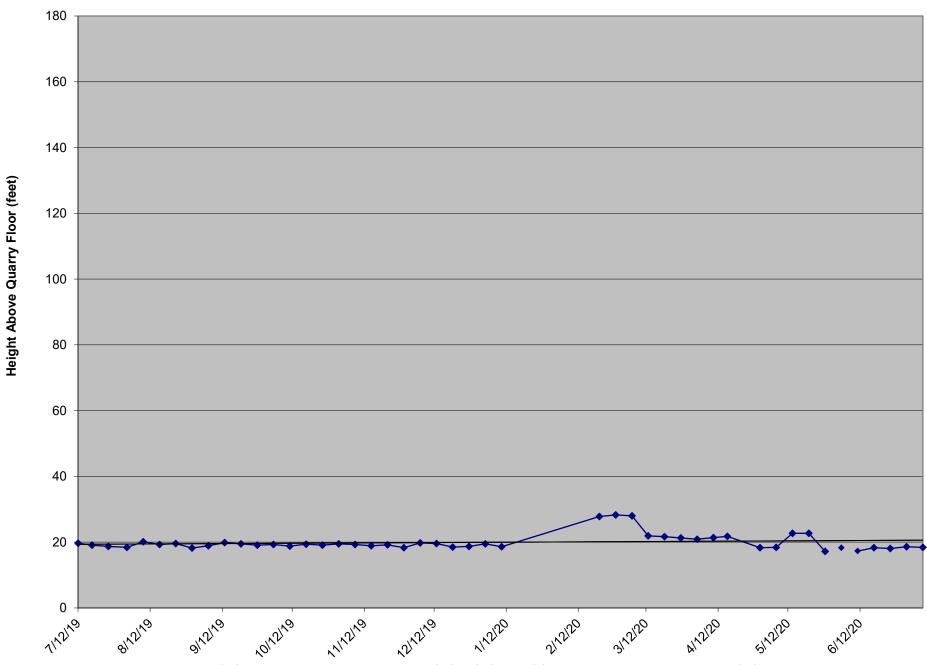


The transducer became non-operational on 1/13/20. Liquid level was measured manually on 2/21/20, 2/28/20 and 3/6/20. The transducer became operational on 3/13/20. The VFD was observed to be non-operational on 4/23/20, it was replaced on 4/23/20, however the level sensor reading was not taken due to VFD communication loss with SCADA.

_	_		_	_			
	and territ	Resonativo di Last Retradorisco di	Tenner tren he restricted	Base of Series Streeters	Total Charge		
10.7	-		-	91	÷	Selections:	
45.5	-		-	24	-	No. of Contrasts	
10.7	1		-	20	+	NAME AND ADDRESS OF	
10.0	н		-	ä	1	No. of Concession,	
-	Ξ		-	Ш	-		
	=		=				
10.7	=	ı		2		No. of Contrast	
MA W	ı	ı	- 61	ä	т	DESCRIPTION OF	
100.0	100			2 2	H	Selections.	
100.00	E	- 11	71	21		NAME THAN	
45.5	=		-	21		No. of Contrasts	
10.0	ı	-	-	1	+	NAME AND ADDRESS OF THE PERSON	
	=			Н			
100.0	100			2 2	÷	Selections.	
MA.W	w		F1	ma		newstanks.	
	Ш			H			
100.00	200		**	i		Delay Tapay	
10.5	Ξ		-	20	-	Non-Tenha	
10.7	=		-	2		DOM: TODAY	
10.7	I		-	20	+	NAME AND ADDRESS OF	
	_		-	-	-		Sepurite seasons from the second of the seco
	1		-	1	1		
	-		-	-	-		Any Parlament for extractor operations produced to
MATE IN	1907		-	ma		DESCRIPTION	Ang Pile rational from controlling representation for any
	-		-	-	-		And the relation for principle spherodynaholis from Angulin serious happermarker spherodynapout for the
			_				Any Pin terioris Separticular special popularies an
	=		-	-		NAME OF TAXABLE PARTY.	Any Particular Separate de administrações de car
100.00	-			ma		Desertion	Any Pin Selection Top attended spherost population and Any Pin Selection Top attended spherost population of
10.0	-		-	-	_	DOM: THE	
	F						
10.0	60		-	90	-	DESCRIPTION OF	
10.0	=	F	-	94	H	NAME OF TAXABLE PARTY.	
	E		E		E		
	Е	_	L-		Ŀ	10000000	
	1		_	1			
10.0	-		-	200	-	NAME AND ADDRESS OF	and the same and t
							The special depot is an extended to a control to the second to the secon
US.W	-		-	-	,	NAME AND ADDRESS OF	Mark you work super a first frequency state and
	_			Н			Marke party stateller bespiese and "PR Party on Separate party and a final
10.0	-		-	90		NAME AND ADDRESS OF	Note you work to provide the following of the
	-		-	_	-		Mark yang melakir kerjasa anti-178 Pang-pang-pang-terlaki anta- Mark yang melakir kerjasa anti-178 Pang-pang-pang-pang-
10.0			-	20	-	MARTINA	Activity when the control for the control of
	_			Н			Marke party stateller bespiese and "PR Party on Separate party and a final
10.0	-		-	90		NAME AND ADDRESS OF	Note you work to provide the following of the
	_		-	-	-		Mark you with the super of the forest particular and Mark you within super of the forest particular and
US.W	***		-	-	,	NAME AND ADDRESS OF	Mark you works separa served frequency or greater and
	_		-	ı	-		
100.00	-		-	-		DESCRIPTION OF	Marke yang market serpesa and the Paragraphy and provide and
	_		-	-	-		Mark you with the super of the forest particular and Mark you within super of the forest particular and
10.0	-		-	20	-	MARTINA	Activity when the control for the control of
115.0	-		-	-	-		Markey Street, Super Street, Super-Land Street, Street
MATE IN	100		-	ma		DOWNSON	and the same artist of the principle of the same and
	-		-	-	-		Mark you within topics and the forest parameter and
	_			Н			Activity was a superior of the forest property of
115.0	-		-	-	-		Markey Street, Super Street, Super-Land Street, Street
100.00	-		-	90		DOMESTICAL	Mark you works super and all for produce of the sale
	-		-	-	-		Mark you within topics and the forest parameter and
	_			Н			Activity was a superior of the forest property of
115.0	-		-	-	-		Markage with the second of the following state of
MATE IN	-		-	ma		DOWNSON	Street have account to the street of the str
US.W	***		-	-	,	NAME AND ADDRESS OF	Mark you works separa served frequency or greater and
	_			Н			Activity was superior to the forest property and the
115.0	-		-	-	-		Markage with the second of the following state of
	=		-	-		NAME OF TAXABLE PARTY.	
	ь	E	-		ĿĒ	new reason	
-	F		-	Ξ	F		
	_		-	-	Ė	DESCRIPTION OF	Markey with the service of the forest property of
	-	E	-		ĿĒ	new reason	
-	E		-	Ξ	F		
	=		-	-	Ė		
					=		Mark you within super colors frequency or ground and
100.00	-		-	-	-	DESCRIPTION OF	Markey with the service of the frequency of the state of
-	=	H	-	-	H	new	
10.0	-		-	- 000	Ė	DESCRIPTION OF	
	E						
			-	-		NAME OF TAXABLE PARTY.	Notice and represent the second con-
	E	<u> </u>	-	-	L:	Delication of the last of the	Mark you within super-order frequency or product and mark you within super-order frequency or product and
100.00	-		-	-	-	new ready	
_	F			=	F		
	=		-	-		NAME OF TAXABLE PARTY.	Notice and represent the second con-
	E	<u> </u>		ш	Ŀ		Mark you within super-self-II frequency or product and mark you within super-self-II frequency or product and
	E	_	-	-	ΗĒ	new Tenar	
	F						
	=				Ė	DESCRIPTION OF	Mark your section response of the Annual Confession of the
	Е	E	-		ĿĒ	new reason	
	F						Mark you within super orders for each parameter and
10.0	=		-	90	-	DESCRIPTION OF	Mark you with super colors from the property of the
	E				ᆮ		Mark you water super server from the property of
	E	_	-	-	Ε	new Tenar	
	F						Mark you within super orders for each parameter and
10.0	Ξ		-	90	=	DESCRIPTION OF	Mark you with super colors from the property of the
	Е	E	-		ĿĒ	new reason	
F	F				F	-	Markey and Markey September 2015 The September 2015
10.0	=		-	-	-	DESCRIPTION OF	Mark you with super of the August party and all
100.00	200		-	-	-	NAME AND ADDRESS OF	Married Married Street, or St. Co., St.

	Date	Measured Liquid	Transducer Height	Base of Sump	Elevation of	Pump on during		
	Reading	Level Above	above Floor of	Elevation	Leachate	measurement?		
LCS Number	Collected	Transducer (Ft.)	Quarry (Ft.)	(Ft. MSL)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 2D	7/12/19	N/A	14.4	235.92	,	N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/18/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/25/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/2/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/9/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/16/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/23/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	8/30/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/6/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/13/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/20/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	9/27/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	10/4/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	10/11/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	10/18/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	10/25/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	11/1/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	11/8/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	11/15/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	11/29/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/6/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/13/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/20/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	12/27/19	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/3/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/10/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/17/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/24/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	1/31/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/7/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/14/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/21/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	2/28/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/6/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/13/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/20/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	3/27/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/3/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/10/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/16/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/23/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	4/30/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/7/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/14/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/21/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	5/28/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/4/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/11/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/18/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	6/25/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/2/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement
LCS- 2D	7/9/20	N/A	14.4	235.92		N	Dedicated Transducer	PCP Installed to depth of 62' BGS, failed stator, needs replacement


				Well Total Depth				
ı	Date	Measured Liquid	Transducer Depth	from Top of	Elevation of	Pump on during		
1	Reading	Level Below Ground	from Top of Casing	Casing (Ft.)	Leachate	measurement?		
LCS Number	Collected	Surface (ft)	(Ft.)	(Ft. MSL)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS-3D	7/12/19	36.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/18/19	36.5	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/25/19	37.1	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/2/19	37.9	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/9/19	34.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/16/19	34.2	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/23/19	34.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	8/30/19	32.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/6/19	32.1	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/13/19	32.5	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/20/19	35.4	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	9/27/19	37.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/4/19	42.7	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/11/19	43.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/18/19	44.5	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	10/25/19	48.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/1/19	49.5	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/8/19	51.0	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/15/19	52.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/22/19	52.1	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	11/27/19	51.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	12/6/19	52.4	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	12/13/19	51.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	12/20/19	52.0	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	12/27/19	51.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/3/20	49.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/10/20	49.0	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/17/20	46.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/24/20	41.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	1/31/20	41.2	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/7/20	43.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/14/20	47.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/21/20	48.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	2/28/20	48.9	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/6/20	49.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/13/20	47.3	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/20/20	62.1	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	3/27/20	50.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/3/20	45.9	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/10/20	49.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/16/20	52.2	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	4/23/20	51.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/1/20	55.6	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/7/20	50.0	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/14/20	54.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/21/20	40.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	5/28/20	50.7	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/4/20	50.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/11/20	54.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/19/20	52.5	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	6/26/20	52.8	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/2/20	60.4	N/A	140		Y	Heron Dipper T	Pump operational; liquid level measured manually
LCS-3D	7/9/20	60.4	N/A	140		Υ	Heron Dipper T	Pump operational; liquid level measured manually

## LCS-3D Liquid Level Below Ground Surface

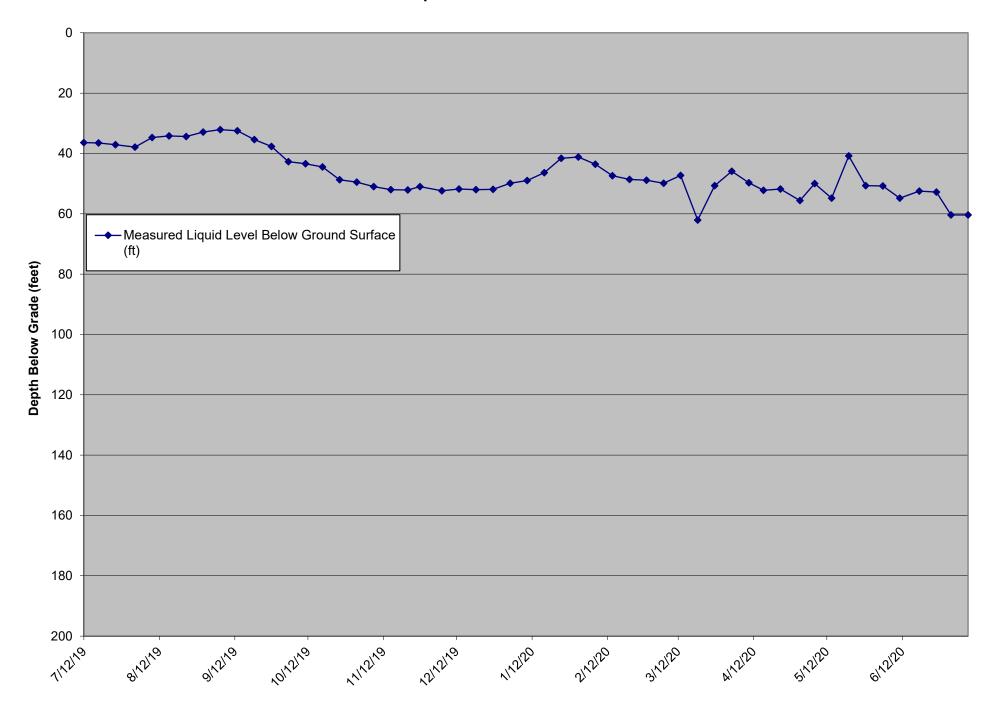


	Date	Measured Liquid	Transducer Depth	Base of Sump	Pump on during		
	Reading	Level Below Ground	from Top of Casing	Elevation	measurement?		
LCS Number	Collected	Surface (ft)	(Ft.)	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 4B	7/12/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/18/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/25/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/2/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/9/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/16/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/23/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	8/30/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/6/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/13/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/20/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	9/27/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/4/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/11/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/18/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	10/25/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/1/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/8/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/15/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/22/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	11/29/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/6/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/13/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/20/19	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	12/27/19	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/3/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/10/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/17/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/24/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	1/31/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/7/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/14/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/21/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	2/28/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/6/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/13/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/20/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	3/27/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/3/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/10/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/16/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/23/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	4/30/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/7/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/14/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/21/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	5/28/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/4/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/11/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/18/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	6/26/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/2/20	74.0	81.0	244.00	Y	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS
LCS- 4B	7/9/20	74.0	81.0	244.00	Υ	Dedicated Transducer	Pump operational, no flow detected, liquid level >74.0' BGS

## LCS-4B Liquid Level Below Ground Surface

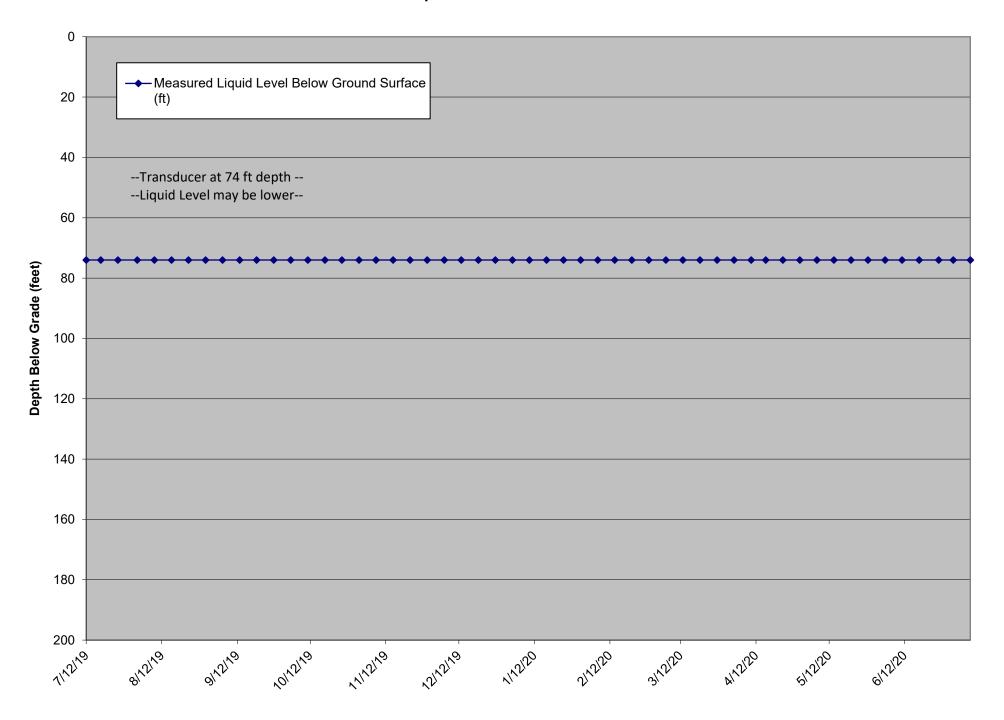

	D-4-	Manager at Lincoln	Towns down a 11-1-b4	D		Florestion of	D		
	Date Reading	Measured Liquid Level Above	Transducer Height above Floor of	Base of Sump Elevation	Height of	Elevation of Leachate	Pump on during measurement?		
LCS Number	Collected	Transducer (Ft.)	Quarry (Ft.)	(Ft. MSL)	Liquid (ft )	(Ft. MSL)	(Y/N)	Liquid level meter used	Comments
LCS- 5B	7/12/19	13.4	21.9	235.3	35.3	270.60	(1/N) V	Dedicated Transducer	Comments
LCS- 5B	7/12/19	11.6	21.9	235.3	33.5	268.80	Ý	Dedicated Transducer	
LCS- 5B	7/25/19	12.8	21.9	235.3	34.7	270.00	Ý	Dedicated Transducer	
LCS- 5B	8/2/19	13.5	21.9	235.3	35.4	270.70	Ϋ́	Dedicated Transducer	
LCS- 5B	8/9/19	11.3	21.9	235.3	33.2	268.50	Y	Dedicated Transducer	
LCS- 5B	8/16/19	12.6	21.9	235.3	34.5	269.80	Y	Dedicated Transducer	
LCS- 5B	8/23/19	12.5	21.9	235.3	34.4	269.70	Y	Dedicated Transducer	
LCS- 5B	8/30/19	12.3	21.9	235.3	34.2	269.50	Y	Dedicated Transducer	
LCS- 5B	9/6/19	11.1	21.9	235.3	33.0	268.30	Υ	Dedicated Transducer	
LCS- 5B	9/13/19	12.6	21.9	235.3	34.5	269.80	Y	Dedicated Transducer	
LCS- 5B	9/20/19	12.8	21.9	235.3	34.7	270.00	Y	Dedicated Transducer	
LCS- 5B	9/27/19	13.0	21.9	235.3	34.9	270.20	Y	Dedicated Transducer	
LCS- 5B	10/4/19	12.2	21.9	235.3	34.1	269.40	Y	Dedicated Transducer	
LCS- 5B	10/11/19	13.3	21.9	235.3	35.2	270.50	Y	Dedicated Transducer	
LCS- 5B LCS- 5B	10/18/19 10/25/19	11.5 12.7	21.9 21.9	235.3 235.3	33.4 34.6	268.70 269.90	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	11/1/19	12.7	21.9	235.3	34.0	269.50	Y	Dedicated Transducer	
LC3- 3B	11/1/19	12.3	21.9	235.3	34.2	209.50	T	Dedicated Transducer	
									The transducer was observed to be non-operational on 11/6/19.
LCS- 5B	11/8/19		21.9	235.3		235.30	N	Dedicated Transducer	Transducer replacement is scheduled on 11/13/19.
E00-0B	11/0/15		21.0	200.0		200.00		Dedicated Transducer	Transacci replacement is constant a sit in 10, 10.
LCS- 5B	11/15/19		21.9	235.3		235.30	N	Dedicated Transducer	The transducer was observed to be non-operational on 11/6/19 and was replaced on 11/13/19. After transducer replacement, pump was non-operational due to suspected frozen forcemain section. Troubleshooting will continue the week of 11/18/19.
100 50	44/99/49		04.0	205.0	00.0	000.00		S	The transducer was observed to be non-operational on 11/6/19 and was replaced on 11/13/19. After transducer replacement, pump was non-operational due to suspected frozen forcemain section. The pump and motor were replaced on 11/19/19 and LCS
LCS- 5B	11/22/19	11.7	21.9	235.3	33.6	268.90	Y	Dedicated Transducer	5B became fully operational.
LCS- 5B	11/29/19	11.0 12.4	21.9 21.9	235.3 235.3	32.9 34.3	268.20 269.60	Y	Dedicated Transducer	
LCS- 5B LCS- 5B	12/6/19 12/13/19	12.4	21.9	235.3	33.9	269.00	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B	12/13/19	13.1	21.9	235.3	35.0	270.30	Y	Dedicated Transducer	
LCS- 5B	12/27/19	10.0	21.9	235.3	31.9	267.20	Ý	Dedicated Transducer  Dedicated Transducer	
LCS- 5B	1/3/20	11.3	21.9	235.3	33.2	268.50	Ý	Dedicated Transducer	
LCS- 5B	1/10/20	12.4	21.9	235.3	34.3	269.60	Ý	Dedicated Transducer	
LCS- 5B	1/17/20	11.3	21.9	235.3	33.2	268.50	Y	Dedicated Transducer	
LCS- 5B	1/24/20	13.0	21.9	235.3	34.9	270.20	Y	Dedicated Transducer	
LCS- 5B	1/31/20	11.7	21.9	235.3	33.6	268.90	Y	Dedicated Transducer	
LCS- 5B	2/7/20	12.6	21.9	235.3	34.5	269.80	Y	Dedicated Transducer	
LCS- 5B	2/14/20	12.3	21.9	235.3	34.2	269.50	Y	Dedicated Transducer	
LCS- 5B	2/21/20	11.3	21.9	235.3	33.2	268.50	Y	Dedicated Transducer	
LCS- 5B	2/28/20	11.6	21.9	235.3	33.5	268.80	Y	Dedicated Transducer	
LCS- 5B	3/6/20	10.3	21.9	235.3	32.2	267.50	Y	Dedicated Transducer	
LCS- 5B	3/13/20	11.2	21.9	235.3	33.1	268.40	Y	Dedicated Transducer	
LCS- 5B	3/20/20 3/27/20	12.3 12.2	21.9 21.9	235.3 235.3	34.2 34.1	269.50 269.40	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B LCS- 5B	4/3/20	11.9	21.9	235.3	33.8	269.40	Y	Dedicated Transducer  Dedicated Transducer	
LCS- 5B	4/9/20	10.9	21.9	235.3	32.8	268.10	Y	Dedicated Transducer	
LCS- 5B	4/16/20	11.3	21.9	235.3	33.2	268.50	Y	Dedicated Transducer  Dedicated Transducer	<u> </u>
LCS- 5B	4/23/20	10.4	21.9	235.3	32.3	267.60	Ý	Dedicated Transducer	
LCS- 5B	4/30/20	11.7	21.9	235.3	33.6	268.90	Ϋ́	Dedicated Transducer	
LCS- 5B	5/7/20	10.1	21.9	235.3	32.0	267.30	Y	Dedicated Transducer	
LCS- 5B	5/14/20	12.0	21.9	235.3	33.9	269.20	Υ	Dedicated Transducer	_
LCS- 5B	5/21/20	11.7	21.9	235.3	33.6	268.90	Y	Dedicated Transducer	
LCS- 5B	5/28/20	11.2	21.9	235.3	33.1	268.40	Y	Dedicated Transducer	
LCS- 5B	6/4/20	11.1	21.9	235.3	33.0	268.30	Y	Dedicated Transducer	
LCS- 5B	6/11/20	11.6	21.9	235.3	33.5	268.80	Y	Dedicated Transducer	
LCS- 5B	6/18/20	9.3	21.9	235.3	31.2	266.50	Y	Dedicated Transducer	
LCS- 5B LCS- 5B	6/25/20 7/2/20	11.4 8.9	21.9 21.9	235.3 235.3	33.3 30.8	268.60 266.10	Y	Dedicated Transducer Dedicated Transducer	
LCS- 5B LCS- 5B	7/2/20	10.0	21.9	235.3	30.8	267.20	Y	Dedicated Transducer  Dedicated Transducer	
LU3- 3D	119120	10.0	21.9	233.3	31.8	201.20	T	Dedicated Transducer	1

## LCS-5B Liquid Level Above Quarry Floor

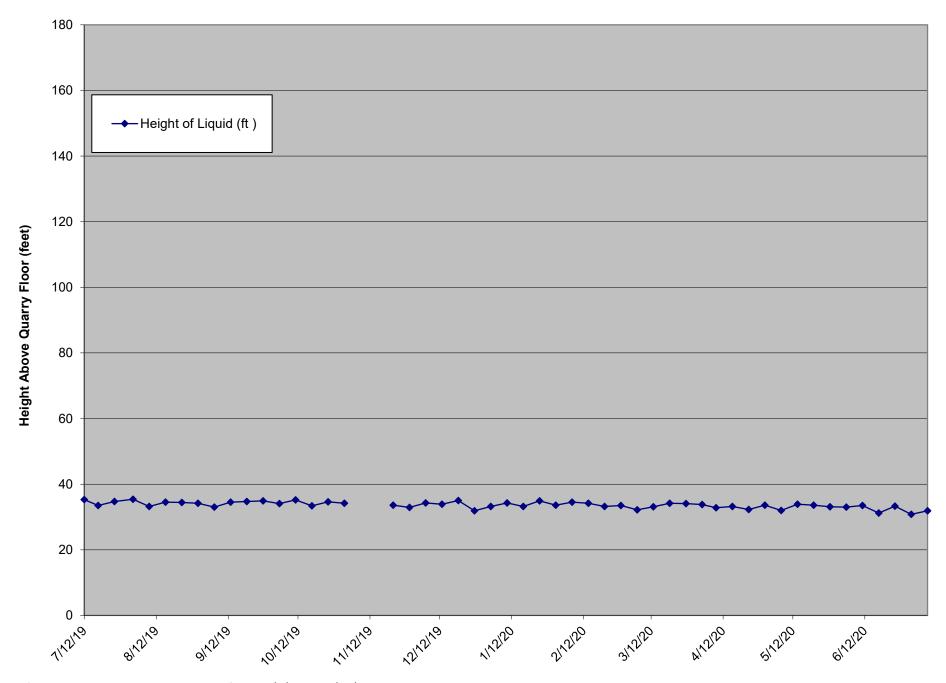

<sup>\*</sup>The transducer in LCS-5B was down from 11/6/19 to 11/19/19.

Columber		Date		Transducer Height	Base of Sump		Elevation of	Pump on during		
						Height of				
C.C. 68	LCS Number		V						Liquid level meter used	Comments
Co.S. 68	LCS- 6B	7/12/19	10.3	9.4	429.52	19.7	449.22	Y	Dedicated Transducer	
Cost	LCS- 6B	7/18/19	9.7	9.4		19.1		Y	Dedicated Transducer	
C.C. 68   B979   137   9.4   4592   75   44667   7   Concent impactors										
Col. 68   87678   9.9   9.4   42.52   19.3   444.82   Y   Decided Transduct   Col. 68   6.00   19.5   19.										
CS-68   System   CS-69   System   System   CS-69   System   System   CS-69   System										
CGS-68   80019   8-8   9-4   40030   19-2   44777   Y   Decision Transducer   CGS-68   68771   9-7   9-4   40030   19-5   44772   Y   Decision Transducer   CGS-68   68771   9-7   9-4   40030   Y   Decision Transducer   CGS-68   68771   9-7   9-4   40030   Y   Decision Transducer   CGS-68   68771   9-7   9-4   40030   Y   Decision Transducer   CGS-68   CGS-68   10071   100   9-4   40030   Y   Decision Transducer   CGS-68   CGS-68   10071   100   9-4   40030   Y   Decision Transducer   CGS-68   CGS-68   10071   100   9-4   40030   Y   Decision Transducer   CGS-68										
C.C.   B   98/19   9.5   9.4   4.0932   19.3   448.42   Y   Descripted Transducer   C.C.   Descripted Transducer   Descripted Tran										
105-88					429.52					
Color										
1.05-88   92719   97										
LOS-88   19419   9.0										
CS-88   3011/19								Y Y		
CG-86   1078/19   10.0   9.4   429.52   19.1   4.48.90   Y   Dedicated Transdoor   CG-86   1079/19   9.7   9.4   429.52   19.1   4.48.90   Y   Dedicated Transdoor   CG-86   1787/9   9.5   9.4   429.52   18.9   4.48.90   Y   Dedicated Transdoor   CG-86   1787/9   9.5   9.4   429.52   18.9   4.48.90   Y   Dedicated Transdoor   CG-86   1797/9   9.5   9.4   429.52   18.9   4.48.90   Y   Dedicated Transdoor   CG-86   1797/9   9.5   9.4   429.52   18.9   4.48.90   Y   Dedicated Transdoor   CG-86   1797/9   9.3   9.4   429.52   18.9   4.48.90   Y   Dedicated Transdoor   CG-86   1797/9   9.3   9.4   429.52   18.9   4.48.90   Y   Dedicated Transdoor   CG-86   1797/9   9.3   9.4   429.52   18.8   4.48.90   Y   Dedicated Transdoor   CG-86   1797/9   9.3   9.4   429.52   18.8   4.48.90   Y   Dedicated Transdoor   CG-86   1797/9   9.3   9.4   429.52   18.8   4.48.90   Y   Dedicated Transdoor   CG-86   1797/9   9.3   9.4   429.52   18.8   4.48.90   Y   Dedicated Transdoor   CG-86   1797/9   9.3   9.4   429.52   18.8   448.90   Y   Dedicated Transdoor   CG-86   1797/9   9.3   9.4   429.52   18.8   448.90   Y   Dedicated Transdoor   CG-86   1797/9   9.3   9.4   429.52   18.8   448.90   Y   Dedicated Transdoor   CG-86   1797/9   9.3   9.4   429.52   18.8   448.90   Y   Dedicated Transdoor   CG-86   1797/9   1797/9   9.4   429.52   18.8   448.90   Y   Dedicated Transdoor   CG-86   1797/9   1797/9   9.4   429.52   18.8   449.90   Y   Dedicated Transdoor   CG-86   1797/9   1797/9   9.4   429.52   Y   Dedicated Transdoor   CG-86   1797/9   1797/9   9.4   429.52   Y   Dedicated Transdoor   Trans								Y		
CS-68   11979   10.1   9.4   429.52   19.5   448.92   Y   Decident Transducer Producer		10/18/19	10.0		429.52	19.4	448.92	Υ	Dedicated Transducer	
CG-68	LCS- 6B	10/25/19	9.7	9.4	429.52	19.1	448.62	Υ	Dedicated Transducer	
ICS-68   1192919   9.8   9.4   429.92   19.9   448.72   Y   Decidical Transducer										
LGS-88   11/22/19   9.8   9.4   429.52   19.3   448.72   Y   Decided Transducer										
LGS-68   11/2019   8.9										
LCS- 68   126/19   10.4   9.4   429.52   11.8   449.32   Y   Deficiated Transducer										
LGS-68 12/3/19 10 2 9.4 429.52 19.6 448.12 Y Descented Transducer   LGS-68 12/20719 9.1 9.1 9.4 429.52 18.6 448.02 Y Descented Transducer   LGS-68 12/20719 9.3 9.4 429.52 18.6 448.02 Y Descented Transducer   LGS-68 17/2073 9.2 9.4 429.52 18.6 448.12 Y Descented Transducer   LGS-68 17/2073 9.2 9.4 429.52 18.6 448.12 Y Descented Transducer   LGS-68 17/2073 9.2 9.4 429.52 18.6 448.12 Y Descented Transducer   LGS-68 17/2073 9.2 9.4 429.52 18.6 448.12 Y Descented Transducer   LGS-68 17/2074 9.4 429.52 18.6 448.12 Y Descented Transducer   LGS-68 17/2074 9.4 429.52 18.6 449.12 Y Descented Transducer   LGS-68 17/2074 9.4 429.52 18.6 18.6 18.6 18.6 18.6 18.6 18.6 18.6										
LCS-68 1/2/2/10 9 91 94 429 52 16.5 448 022 Y Declared Transducer LCS-68 1/2/2/10 10 1 94 429 52 16.5 448 022 Y Declared Transducer LCS-68 1/2/2/10 10 1 94 429 52 16.5 448 022 Y Declared Transducer LCS-68 1/2/2/10 94 429 52 16.5 448 022 Y Declared Transducer LCS-68 1/2/2/10 94 429 52 16.5 448 022 Y Declared Transducer LCS-68 1/2/2/10 94 429 52 N Declared Transducer LCS-68 2/2/2/2 N Declared Transducer LCS-68 3/3/2/2 N Declared Transducer replacement is pending replacement parts artival. LCS-68 3/3/2/2 N Declared Transducer replacement is pending replacement parts artival. LCS-68 3/3/2/2 N Declared Transducer LCS-68 4/3/2/2 N Declared Tr										
LCS-6B 10/200 9.3 9.4 429.52 18.7 449.22 Y Declared Transducer LCS-6B 11/10/20 9.2 9.4 429.52 18.6 449.12 Y Declared Transducer LCS-6B 11/10/20 9.2 9.4 429.52 18.6 449.12 Y Declared Transducer LCS-6B 11/10/20 9.4 429.52 18.6 449.12 Y Declared Transducer LCS-6B 11/10/20 9.4 429.52 18.6 449.12 Y Declared Transducer LCS-6B 11/10/20 9.4 429.52 18.6 449.12 Y Declared Transducer LCS-6B 11/10/20 9.4 429.52 18.6 449.12 Y Declared Transducer LCS-6B 11/10/20 9.4 429.52 18.6 449.12 Y Declared Transducer LCS-6B 11/10/20 9.4 429.52 18.6 449.12 Y Declared Transducer LCS-6B 11/10/20 9.4 429.52 18.6 449.12 Y Declared Transducer LCS-6B 11/10/20 9.4 429.52 18.6 459.12 Y Declared Transducer LCS-6B 11/10/20 9.4 429.52 18.6 459.12 Y Declared Transducer LCS-6B 11/10/20 9.4 429.52 18.6 459.12 Y Declared Transducer LCS-6B 21/10/20 N/A N/A N/A 429.52 77.8 457.32 N Heron Dipper T LCS-6B 11/10/20 N/A N/A N/A 429.52 17.8 457.32 N Heron Dipper T LCS-6B 360.0 N/A N/A N/A 429.52 28.3 457.62 N Heron Dipper T LCS-6B 31/10/20 N/A N/A N/A 429.52 28.0 457.52 N Heron Dipper T LCS-6B 31/10/20 12.3 9.4 429.52 28.0 457.52 N Heron Dipper T LCS-6B 31/10/20 12.3 9.4 429.52 27.8 459.12 Y Declared Transducer LCS-6B 31/10/20 12.3 9.4 429.52 27.8 459.12 Y Declared Transducer LCS-6B 31/10/20 12.3 9.4 429.52 27.8 459.12 Y Declared Transducer LCS-6B 31/10/20 12.3 9.4 429.52 27.8 459.12 Y Declared Transducer LCS-6B 31/10/20 12.3 9.4 429.52 27.8 459.12 Y Declared Transducer LCS-6B 31/10/20 12.3 9.4 429.52 27.8 459.12 Y Declared Transducer LCS-6B 31/10/20 12.3 9.4 429.52 27.8 459.12 Y Declared Transducer LCS-6B 41/10/20 12.3 9.4 429.52 27.7 459.22 Y Declared Transducer LCS-6B 41/10/20 12.3 9.4 429.52 27.7 459.22 Y Declared Transducer LCS-6B 41/10/20 12.3 9.4 429.52 27.7 459.22 Y Declared Transducer LCS-6B 41/10/20 13.3 9.4 429.52 18.3 447.82 Y Declared Transducer LCS-6B 51/10/20 13.3 9.4 429.52 18.3 447.82 Y Declared Transducer LCS-6B 61/10/20 13.3 9.4 429.52 18.3 447.82 Y Declared Transducer LCS-6B 61/10/20 13.3 9.4 429.52 18.3 447.82 Y Declared Transducer LCS-6										
LCS-68 1/10/20 9.2 9.4 429.52 16.6 446.12 Y Decidated Transductor Format (CS-68 1/10/20) 9.2 9.4 429.52 16.6 446.12 Y Decidated Transductor Format (CS-68 1/10/20) 9.4 429.52 16.6 446.12 Y Decidated Transductor Format (CS-68 1/10/20) 9.4 429.52 17.0 N Decidated Transductor Format (CS-68 1/10/20) 9.4 429.52 1 N Decidated Transductor Format (CS-68 1/10/20) 9.4 429.52										
LCS-68   1/17/20   9.2   9.4   429.52   18.6   448.12   Y   Dedicated Transducer   The LCS-68 transducer was observed to be non-operational on 1/13/20. Transducer replacement   LCS-68 transducer was observed to be non-operational on 1/13/20. Transducer replacement   LCS-68 transducer was observed to be non-operational on 1/13/20. Transducer replacement   LCS-68 transducer was observed to be non-operational on 1/13/20. Transducer replacement   LCS-68 transducer was observed to be non-operational on 1/13/20. Transducer replacement   LCS-68 transducer was observed to be non-operational on 1/13/20. Transducer replacement   LCS-68 transducer was observed to be non-operational on 1/13/20. Transducer replacement   LCS-68 transducer was observed to be non-operational on 1/13/20. Transducer replacement   LCS-68 transducer was observed to be non-operational on 1/13/20. Transducer replacement   LCS-68 transducer was observed to be non-operational on 1/13/20. Transducer replacement   LCS-68 transducer was observed to be non-operational on 1/13/20. Transducer replacement   LCS-68 transducer was observed to be non-operational on 1/13/20. Transducer replacement   LCS-68 transducer was observed to be non-operational on 1/13/20. Transducer replacement   LCS-68 transducer was observed to be non-operational on 1/13/20. Transducer replacement   LCS-68 transducer was observed to be non-operational on 1/13/20. Transducer replacement   LCS-68 transducer was observed to be non-operational on 1/13/20. Transducer replacement   LCS-68 transducer was observed to be non-operational on 1/13/20. Transducer replacement   LCS-68 transducer was observed to be non-operational on 1/13/20. Transducer replacement   LCS-68 transducer was observed to be non-operational on 1/13/20. Transducer replacement   LCS-68 transducer was observed to be non-operational on 1/13/20. Transducer replacement   LCS-68 transducer was observed to be non-operational on 1/13/20. Transducer replacement   LCS-68 transducer was observed to be non-operational on 1/13/20. Tr										
LCS-6B										
LCS-68 17/17/20 9.4 429.52 N Decicated Transducer Fine LCS-68 transducer was observed to be non-operational on 17/320. Transducer replacement (as pending replacement parts arrival.)  The LCS-68 transducer was observed to be non-operational on 17/320. Transducer replacement (as pending replacement parts arrival.)  The LCS-68 transducer was observed to be non-operational on 17/320. Transducer replacement (as pending replacement parts arrival.)  The LCS-68 transducer was observed to be non-operational on 17/320. Transducer replacement (as pending replacement parts arrival.)  The LCS-68 transducer was observed to be non-operational on 17/320. Transducer replacement (as pending replacement parts arrival.)  The LCS-68 transducer was observed to be non-operational on 17/320. Transducer replacement (as pending replacement parts arrival.)  The LCS-68 transducer was observed to be non-operational on 17/320. Transducer replacement (as pending replacement parts arrival.)  The LCS-68 transducer was observed to be non-operational on 17/320. Transducer replacement (as pending replacement parts arrival.)  The LCS-68 transducer was observed to be non-operational on 17/320. Transducer replacement (as pending replacement parts arrival.)  The LCS-68 transducer was observed to be non-operational on 17/320. Transducer replacement (as transducer) (as pending replacement parts arrival.)  The LCS-68 transducer was observed to be non-operational on 17/320. Transducer replacement (as transducer) (as pending replacement parts arrival.)  The LCS-68 transducer was observed to be non-operational on 17/320. Transducer replacement (as pending replacement parts arrival.)  The LCS-68 transducer was observed to be non-operational on 17/320. Transducer replacement (as pending replacement parts arrival.)  The LCS-68 transducer was observed to be non-operational on 17/320. Transducer replacement (as pending replacement parts arrival.)  The LCS-68 transducer was observed to be non-operational on 17/320. Transducer replacement parts arrival.  The LCS-	E00-0B	1710/20	J.2	5.4	420.02	10.0	440.12		Dedicated Transducer	The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement
CS-68   1/24/20	LCS- 6B	1/17/20		9.4	429.52			N	Dedicated Transducer	
LCS-6B 1/24/20 9.4 429.52 N Dedicated Transducer LCS-6B 1/31/20 9.4 429.52 N Dedicated Transducer LCS-6B 1/31/20 9.4 429.52 N Dedicated Transducer LCS-6B 2/14/20 9.4 429.52 N Dedicated Transducer LCS-6B 2/14/20 NA NA VA 429.52 T N Dedicated Transducer LCS-6B 2/14/20 NA NA NA 429.52 T N Dedicated Transducer LCS-6B 3/13/20 NA NA NA 429.52 T N Dedicated Transducer LCS-6B 3/13/20 NA NA NA 429.52 T N Dedicated Transducer LCS-6B 3/13/20 NA NA NA 429.52 T N Dedicated Transducer LCS-6B 3/13/20 NA NA NA 429.52 T N Dedicated Transducer LCS-6B 3/13/20 NA NA NA 429.52 T N Dedicated Transducer LCS-6B 3/13/20 NA NA NA 429.52 T N Dedicated Transducer LCS-6B 3/13/20 NA NA NA 429.52 T N Dedicated Transducer LCS-6B 3/13/20 NA NA NA 429.52 T N Dedicated Transducer LCS-6B 3/13/20 NA NA NA 429.52 N Dedicated Trans										
LCS-6B 1/31/20 9.4 429.52 N Dedicated Transducer is pending replacement parts arrival.  LCS-6B 2/7/20 9.4 429.52 N Dedicated Transducer The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is pending replacement parts arrival.  The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is pending replacement parts arrival.  The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is pending replacement parts arrival.  The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is pending replacement parts arrival. Liquid level was measured manually.  LCS-6B 2/28/20 N/A N/A N/A 429.52 28.3 457.82 N Heron Dipper T  LCS-6B 2/28/20 N/A N/A N/A 429.52 28.0 457.52 N Heron Dipper T  LCS-6B 3/8/20 N/A N/A 429.52 28.0 457.52 N Heron Dipper T  LCS-6B 3/8/20 N/A N/A 429.52 28.0 457.52 N Heron Dipper T  LCS-6B 3/8/20 N/A N/A 429.52 28.0 457.52 N Heron Dipper T  LCS-6B 3/8/20 N/A N/A 429.52 28.0 457.52 N Heron Dipper T  LCS-6B 3/8/20 N/A N/A 429.52 28.0 457.52 N Heron Dipper T  LCS-6B 3/8/20 N/A N/A 429.52 28.0 457.52 N Heron Dipper T  LCS-6B 3/8/20 N/A N/A 429.52 28.0 457.52 N Heron Dipper T  LCS-6B 3/8/20 N/A N/A 429.52 28.0 457.52 N Heron Dipper T  LCS-6B 3/8/20 N/A N/A 429.52 28.0 457.52 N Heron Dipper T  LCS-6B 3/8/20 N/A N/A 429.52 28.0 457.52 N Heron Dipper T  LCS-6B 3/8/20 N/A N/A 429.52 28.0 457.52 N Heron Dipper T  LCS-6B 3/8/20 N/A N/A 429.52 28.0 457.52 N Heron Dipper T  LCS-6B 3/8/20 N/A N/A 429.52 21.9 451.42 Y Dedicated Transducer  LCS-6B 3/8/20 N/A N/A 429.52 21.9 451.42 Y Dedicated Transducer  LCS-6B 3/8/20 N/A 429.52 21.4 451.32 Y Dedicated Transducer  LCS-6B 4/8/20 N/A 429.52 21.4 451.32 Y Dedicated Transducer  LCS-6B 4/8/20 N/A 429.52 21.4 451.32 Y Dedicated Transducer  LCS-6B 4/8/20 N/A 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/8/20 N/A 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/8/20 N/A 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/8/20 N/A	LCS- 6B	1/24/20		9.4	429.52			N	Dedicated Transducer	
CS-6B   27720										The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement
LCS-6B 27/20 9.4 429.52 N Dedicated Transducer  LCS-6B 27/120 N/A N/A 429.52 27.8 457.32 N Heron Dipper T  LCS-6B 27/20 N/A N/A N/A 429.52 28.3 457.82 N Heron Dipper T  LCS-6B 27/20 N/A N/A N/A 429.52 28.3 457.82 N Heron Dipper T  LCS-6B 3/8/20 N/A N/A 429.52 28.0 457.52 N Heron Dipper T  LCS-6B 3/8/20 N/A N/A 429.52 28.0 457.52 N Heron Dipper T  LCS-6B 3/8/20 N/A N/A 429.52 28.0 457.52 N Heron Dipper T  LCS-6B 3/8/20 N/A N/A 429.52 28.0 457.52 N Heron Dipper T  LCS-6B 3/8/20 N/A N/A 429.52 28.0 457.52 N Heron Dipper T  LCS-6B 3/8/20 N/A N/A 429.52 28.0 457.52 N Heron Dipper T  LCS-6B 3/8/20 N/A N/A 429.52 28.0 457.52 N Heron Dipper T  LCS-6B 3/8/20 N/A N/A 429.52 28.0 457.52 N Heron Dipper T  LCS-6B 3/8/20 N/A N/A 429.52 28.0 457.52 N Heron Dipper T  LCS-6B 3/8/20 N/A N/A 429.52 28.0 457.52 N Heron Dipper T  LCS-6B 3/8/20 N/A N/A 429.52 28.0 457.52 N Heron Dipper T  LCS-6B 3/8/20 N/A N/A 429.52 21.9 451.42 Y Dedicated Transducer  LCS-6B 3/8/20 12.5 9.4 429.52 21.9 451.42 Y Dedicated Transducer  LCS-6B 3/8/20 11.5 9.4 429.52 21.7 451.22 Y Dedicated Transducer  LCS-6B 4/8/20 11.5 9.4 429.52 21.8 459.32 Y Dedicated Transducer  LCS-6B 4/10/20 12.4 9.4 429.52 21.8 459.32 Y Dedicated Transducer  LCS-6B 4/10/20 12.4 9.4 429.52 21.8 451.32 Y Dedicated Transducer  LCS-6B 4/10/20 12.4 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 4/8/20 19.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 5/7/20 19.0 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/8/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/8/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/8/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/8/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/8/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/8/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/8/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/8/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/8/20 8.9 9.4 429.52 18.3 447.82 Y Dedicat	LCS- 6B	1/31/20		9.4	429.52			N	Dedicated Transducer	is pending replacement parts arrival.
CGS-6B   2/14/20										
LCS-6B   271/20	LCS- 6B	2/7/20		9.4	429.52			N	Dedicated Transducer	
CS-6B   2/21/20   N/A   N/A   429.52   27.8   457.32   N   Heron Dipper T   The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is pending replacement parts arrival. Liquid level was measured manually.    CS-6B   2/28/20   N/A   N/A   429.52   28.3   457.82   N   Heron Dipper T   The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is tentalively scheduled the week of 3/3/20. Liquid level was measured manually.    The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is tentalively scheduled the week of 3/3/20. Liquid level was measured manually.    The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is scheduled for 3/11/20. Liquid level was measured manually.    The LCS-6B transducer was replaced on 3/11/20 and the pump became fully operational. The LCS-6B pump was observed to be non-operational on 3/12/20. The LCS-6B pump was replaced on 3/13/20. 12.5   9.4   429.52   21.7   451.22   Y   Dedicated Transducer										
LCS-6B   2/21/20   N/A   N/A   429.52   27.8   457.32   N   Heron Dipper T   is pending replacement parts arrival. Liquid level was measured manually.	LCS- 6B	2/14/20		9.4	429.52			N	Dedicated Transducer	
LCS-6B   2/28/20   N/A   N/A   429.52   28.3   457.82   N   Heron Dipper T   The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is tentatively scheduled the week of 3/9/20. Liquid level was measured manually. The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is tentatively scheduled the week of 3/9/20. Liquid level was measured manually. The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is scheduled for 3/11/20. Liquid level was measured manually. The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is scheduled for 3/11/20. Liquid level was measured manually. The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is scheduled for 3/11/20. Liquid level was measured manually. The LCS-6B transducer was observed to be non-operational on 1/13/20. Transducer replacement is scheduled for 3/11/20. Liquid level was measured manually. The LCS-6B transducer is scheduled for 3/11/20. Included the was measured manually. The LCS-6B pump was observed to be non-operational on 3/12/20. The LCS-6B pump was observed to be non-operational on 3/12/20. The LCS-6B pump was observed to be non-operational on 3/13/20. LCS-6B became fully operational on 3/13/20. LCS-6B will be considered transducer and the scheduled transducer was observed to be non-operational on 3/13/20. The VFD was replaced on 3/13/20. The	LCC CD	2/24/20	NI/A	NI/A	400 F0	27.0	457.22	NI NI	Heren Dinner T	
LCS- 6B	LC3- 0B	2/2 1/20	IN/A	IN/A	429.52	21.0	457.32	IN	neron Dipper i	is pending replacement parts arrival. Liquid level was measured manually.
LCS- 6B										The LCS 6B transducer was observed to be non operational on 1/13/20. Transducer replacement
LCS-6B   3/6/20	LCS- 6B	2/28/20	N/A	N/A	429 52	28.3	457.82	N	Heron Dinner T	
LCS-6B 3/6/20 N/A N/A 429.52 28.0 457.52 N Heron Dipper T is scheduled for 3/11/20. Liquid level was measured manually.  The LCS-6B transducer was replaced on 3/11/20 and the pump became fully operational. The LCS-6B pump was observed to be non-operational on 3/12/20. The LCS-6B pump was replaced on 3/13/20. LCS-6B pump was observed to be non-operational on 3/13/20. LCS-6B pump was observed to be non-operational on 3/13/20. LCS-6B pump was observed to be non-operational on 3/13/20. LCS-6B pump was observed to be non-operational on 3/13/20. LCS-6B pump was replaced on 3/13/20. LCS-6B became fully operational on 3/13/20. LCS-6B pump was observed to be non-operational on 3/13/20. LCS-6B pump was observed to be non-operational on 3/13/20. LCS-6B pump was observed to be non-operational on 3/13/20. LCS-6B pump was observed to be non-operational on 3/13/20. LCS-6B pump was observed to be non-operational on 3/13/20. LCS-6B pump was observed to be non-operational on 3/13/20. LCS-6B pump was observed to be non-operational on 3/13/20. LCS-6B pump was observed to be non-operational on 3/13/20. LCS-6B pump was observed to be non-operational on 3/13/20. LCS-6B pump was observed to be non-operational on 3/13/20. The VFD was replaced on 3/13/20 and LCS-6B pump was observed to be non-operational on 4/23/20. The VFD was replaced on 4/23/20 and LCS-6B became fully operational on 4/23/20. The VFD was replaced on 4/23/20 and LCS-6B became fully operational on 4/23/20. The VFD was replaced on 4/23/20 and LCS-6B became fully operational on 4/23/20. The VFD was replaced on 4/23/20 and LCS-6B became fully operational on 4/23/20. The VFD was replaced on 4/23/20 and LCS-6B became fully operational on 4/23/20. The VFD was replaced on 4/23/20 and LCS-6B became fully operational on 4/23/20. The VFD was replaced on 4/23/20 and LCS-6B became fully operational on 4/23/20. The VFD was replaced on 4/23/20 and LCS-6B became fully operational on 4/23/20. The VFD was replaced on 4/23/20 and LCS-6B became fully operational on 4/23/20. The VFD was re	E00-0B	2/20/20	14// (	14// 1	420.02	20.0	401.02		ricion Dipper i	
LCS-6B   3/13/20   12.5   9.4   429.52   21.9   451.42   Y   Dedicated Transducer   CS-6B page   Dedicated Transducer   Dedicated Trans	LCS- 6B	3/6/20	N/A	N/A	429 52	28.0	457 52	N	Heron Dinner T	
LCS-6B 3/13/20 12.5 9.4 429.52 21.9 451.42 Y Dedicated Transducer CS-6B pump was observed to be non-operational on 3/12/20. The LCS-6B pump was replaced on 3/13/20. LCS-6B pump was replaced replaced in 3/13/20. LCS-6B pump was replaced on 3/13/20. LCS-6B pump was replaced replaced in 3/13/20. LCS-6B pump was replaced on 3/13/20. LCS-6B pump was replaced replaced in 3/13/20. LCS-6B pump was replaced replaced	200 02	0/0/20	1471	14/7 (	120.02	20.0	107.02	.,	rioron Dippor i	
LCS-6B 3/13/20 12.5 9.4 429.52 21.9 451.42 Y Dedicated Transducer on 3/13/20. LCS-6B became fully operational	1									
LCS-6B 3/20/20 12.3 9.4 429.52 21.7 451.22 Y Dedicated Transducer  LCS-6B 3/27/20 11.9 9.4 429.52 21.3 450.82 Y Dedicated Transducer  LCS-6B 4/3/20 11.5 9.4 429.52 20.9 450.42 Y Dedicated Transducer  LCS-6B 4/10/20 12.0 9.4 429.52 21.8 450.92 Y Dedicated Transducer  LCS-6B 4/16/20 12.4 9.4 429.52 21.8 451.32 Y Dedicated Transducer  LCS-6B 4/16/20 12.4 9.4 429.52 21.8 451.32 Y Dedicated Transducer  LCS-6B 4/23/20 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 5/12/20 13.3 9.4 429.52 18.4 447.92 Y Dedicated Transducer  LCS-6B 5/12/20 13.3 9.4 429.52 18.4 447.92 Y Dedicated Transducer  LCS-6B 5/28/20 7.8 9.4 429.52 18.4 447.92 Y Dedicated Transducer  LCS-6B 6/4/20 13.3 9.4 429.52 18.4 447.92 Y Dedicated Transducer  LCS-6B 6/4/20 13.3 9.4 429.52 18.4 447.92 Y Dedicated Transducer  LCS-6B 6/4/20 13.3 9.4 429.52 18.4 447.92 Y Dedicated Transducer  LCS-6B 6/4/20 13.3 9.4 429.52 18.4 447.92 Y Dedicated Transducer  LCS-6B 6/4/20 13.3 9.4 429.52 18.4 447.92 Y Dedicated Transducer  LCS-6B 6/4/20 13.3 9.4 429.52 17.2 446.72 Y Dedicated Transducer  LCS-6B 6/4/20 8.9 9.4 429.52 17.2 446.72 Y Dedicated Transducer  LCS-6B 6/4/20 8.9 9.4 429.52 17.3 446.82 Y Dedicated Transducer  LCS-6B 6/4/20 8.9 9.4 429.52 17.3 446.82 Y Dedicated Transducer  LCS-6B 6/4/20 8.9 9.4 429.52 17.3 446.82 Y Dedicated Transducer  LCS-6B 6/4/20 8.9 9.4 429.52 17.3 446.82 Y Dedicated Transducer  LCS-6B 6/4/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/4/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/4/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/4/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/4/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/4/20 8.9 9.4 429.52 18.6 448.82 Y Dedicated Transducer  LCS-6B 6/4/20 8.9 9.4 429.52 18.6 448.82 Y Dedicated Transducer  LCS-6B 6/4/20 8.9 9.4 429.52 18.6 448.82 Y Dedicated Transducer	LCS- 6B	3/13/20	12.5	9.4	429.52	21.9	451.42	Y	Dedicated Transducer	
LCS-6B 4/3/20 11.5 9.4 429.52 20.9 450.42 Y Dedicated Transducer  LCS-6B 4/10/20 12.0 9.4 429.52 21.8 450.92 Y Dedicated Transducer  LCS-6B 4/16/20 12.4 9.4 429.52 21.8 451.32 Y Dedicated Transducer  LCS-6B 4/30/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 5/7/20 9.0 9.4 429.52 18.4 447.92 Y Dedicated Transducer  LCS-6B 5/14/20 13.3 9.4 429.52 18.4 447.92 Y Dedicated Transducer  LCS-6B 5/14/20 13.3 9.4 429.52 18.4 447.92 Y Dedicated Transducer  LCS-6B 5/14/20 13.3 9.4 429.52 18.4 447.92 Y Dedicated Transducer  LCS-6B 5/14/20 13.3 9.4 429.52 18.4 447.92 Y Dedicated Transducer  LCS-6B 5/14/20 13.3 9.4 429.52 18.4 447.92 Y Dedicated Transducer  LCS-6B 5/14/20 13.3 9.4 429.52 18.4 447.92 Y Dedicated Transducer  LCS-6B 5/14/20 13.3 9.4 429.52 17.2 446.72 Y Dedicated Transducer  LCS-6B 5/28/20 7.8 9.4 429.52 17.2 446.72 Y Dedicated Transducer  LCS-6B 6/14/20 8.9 9.4 429.52 17.3 446.82 Y Dedicated Transducer  LCS-6B 6/14/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/14/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/18/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/18/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/18/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/18/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/18/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/18/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 7/220 9.2 9.4 429.52 18.1 447.62 Y Dedicated Transducer	LCS- 6B	3/20/20	12.3	9.4	429.52	21.7		Y	Dedicated Transducer	
LCS-6B 4/10/20 12.0 9.4 429.52 21.4 450.92 Y Dedicated Transducer  LCS-6B 4/16/20 12.4 9.4 429.52 21.8 451.32 Y Dedicated Transducer  The LCS-6B VFD was observed to be non-operational on 4/23/20. The VFD was replaced on 4/23/20 and LCS-6B became fully operational. A level sensor reading was not collected during the weekly reporting period due to VFD communication loss with the site's SCADA system.  LCS-6B 4/30/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 5/7/20 9.0 9.4 429.52 18.4 447.92 Y Dedicated Transducer  LCS-6B 5/14/20 13.3 9.4 429.52 22.7 452.22 Y Dedicated Transducer  LCS-6B 5/21/20 13.3 9.4 429.52 22.7 452.22 Y Dedicated Transducer  LCS-6B 5/28/20 7.8 9.4 429.52 17.2 446.72 Y Dedicated Transducer  LCS-6B 6/14/20 8.9 9.4 429.52 17.3 446.82 Y Dedicated Transducer  LCS-6B 6/14/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/14/20 8.9 9.4 429.52 17.3 446.82 Y Dedicated Transducer  LCS-6B 6/18/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/18/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/18/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/18/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/25/20 8.7 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/25/20 8.7 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 7/2/20 9.2 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 7/2/20 9.2 9.4 429.52 18.1 447.62 Y Dedicated Transducer										
LCS-6B 4/16/20 12.4 9.4 429.52 21.8 451.32 Y Dedicated Transducer  LCS-6B 4/23/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 5/71/20 13.3 9.4 429.52 18.4 447.92 Y Dedicated Transducer  LCS-6B 5/14/20 13.3 9.4 429.52 22.7 452.22 Y Dedicated Transducer  LCS-6B 5/28/20 7.8 9.4 429.52 18.4 447.92 Y Dedicated Transducer  LCS-6B 6/25/20 7.8 9.4 429.52 18.4 447.92 Y Dedicated Transducer  LCS-6B 6/11/20 7.9 9.4 429.52 18.4 447.92 Y Dedicated Transducer  LCS-6B 6/11/20 7.9 9.4 429.52 18.4 447.92 Y Dedicated Transducer  LCS-6B 6/11/20 7.9 9.4 429.52 18.4 447.92 Y Dedicated Transducer  LCS-6B 6/11/20 7.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/11/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/11/20 7.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/11/20 7.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/18/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/18/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/18/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/18/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/18/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/18/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/18/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 6/18/20 8.9 9.4 429.52 18.3 447.82 Y Dedicated Transducer  LCS-6B 7/2/20 9.2 9.4 429.52 18.1 447.62 Y Dedicated Transducer										
CS-6B										
LCS-6B	LCS- 6B	4/16/20	12.4	9.4	429.52	21.8	451.32	Y	Dedicated Transducer	
LCS-6B	1									T 100 00 1/50
LCS-6B         4/23/20         9.4         429.52         Y         Dedicated Transducer Transducer         weekly reporting period due to VFD communication loss with the site's SCADA system.           LCS-6B         4/30/20         8.9         9.4         429.52         18.3         447.82         Y         Dedicated Transducer           LCS-6B         5/7/20         9.0         9.4         429.52         18.4         447.92         Y         Dedicated Transducer           LCS-6B         5/74/20         13.3         9.4         429.52         22.7         452.22         Y         Dedicated Transducer           LCS-6B         5/21/20         13.3         9.4         429.52         22.7         452.22         Y         Dedicated Transducer           LCS-6B         5/21/20         7.8         9.4         429.52         17.2         446.72         Y         Dedicated Transducer           LCS-6B         6/4/20         8.9         9.4         429.52         17.3         446.82         Y         Dedicated Transducer           LCS-6B         6/18/20         7.9         9.4         429.52         17.3         446.82         Y         Dedicated Transducer           LCS-6B         6/18/20         8.7         9.4	İ						Ì			
LCS-6B         4/30/20         8.9         9.4         429.52         18.3         447.82         Y         Dedicated Transducer           LCS-6B         5/7/20         9.0         9.4         429.52         18.4         447.92         Y         Dedicated Transducer           LCS-6B         5/14/20         13.3         9.4         429.52         22.7         452.22         Y         Dedicated Transducer           LCS-6B         5/21/20         13.3         9.4         429.52         22.7         452.22         Y         Dedicated Transducer           LCS-6B         5/28/20         7.8         9.4         429.52         17.2         446.72         Y         Dedicated Transducer           LCS-6B         6/4/20         8.9         9.4         429.52         18.3         447.82         Y         Dedicated Transducer           LCS-6B         6/18/20         8.9         9.4         429.52         17.3         446.82         Y         Dedicated Transducer           LCS-6B         6/18/20         8.9         9.4         429.52         18.3         447.82         Y         Dedicated Transducer           LCS-6B         6/25/20         8.7         9.4         429.52         18.1	1.00 60	4/22/20		0.4	420.52		Ì		Dadicated Transd:	
LCS-6B         5/7/20         9.0         9.4         429.52         18.4         447.92         Y         Dedicated Transducer           LCS-6B         5/14/20         13.3         9.4         429.52         22.7         452.22         Y         Dedicated Transducer           LCS-6B         5/21/20         13.3         9.4         429.52         22.7         452.22         Y         Dedicated Transducer           LCS-6B         5/28/20         7.8         9.4         429.52         17.2         446.72         Y         Dedicated Transducer           LCS-6B         6/4/20         8.9         9.4         429.52         18.3         447.82         Y         Dedicated Transducer           LCS-6B         6/18/20         8.9         9.4         429.52         17.3         446.82         Y         Dedicated Transducer           LCS-6B         6/18/20         8.9         9.4         429.52         18.3         447.82         Y         Dedicated Transducer           LCS-6B         6/18/20         8.9         9.4         429.52         18.3         447.82         Y         Dedicated Transducer           LCS-6B         6/25/20         8.7         9.4         429.52         18.1			g n			19.2	447.00			weekly reporting period due to VPD communication loss with the site's SCADA system.
LCS-6B         5/14/20         13.3         9.4         429.52         22.7         452.22         Y         Dedicated Transducer           LCS-6B         5/21/20         13.3         9.4         429.52         22.7         452.22         Y         Dedicated Transducer           LCS-6B         5/28/20         7.8         9.4         429.52         17.2         446.72         Y         Dedicated Transducer           LCS-6B         6/4/20         8.9         9.4         429.52         18.3         447.82         Y         Dedicated Transducer           LCS-6B         6/11/20         7.9         9.4         429.52         17.3         446.82         Y         Dedicated Transducer           LCS-6B         6/18/20         8.9         9.4         429.52         18.3         447.82         Y         Dedicated Transducer           LCS-6B         6/25/20         8.7         9.4         429.52         18.1         447.82         Y         Dedicated Transducer           LCS-6B         7/2/20         9.2         9.4         429.52         18.6         448.12         Y         Dedicated Transducer           LCS-6B         7/2/20         9.2         9.4         429.52         18.6										
LCS-6B         5/21/20         13.3         9.4         429.52         22.7         452.22         Y         Dedicated Transducer           LCS-6B         5/28/20         7.8         9.4         429.52         17.2         446.72         Y         Dedicated Transducer           LCS-6B         6/4/20         8.9         9.4         429.52         18.3         447.82         Y         Dedicated Transducer           LCS-6B         6/11/20         7.9         9.4         429.52         17.3         446.82         Y         Dedicated Transducer           LCS-6B         6/18/20         8.9         9.4         429.52         18.3         447.82         Y         Dedicated Transducer           LCS-6B         6/25/20         8.7         9.4         429.52         18.1         447.62         Y         Dedicated Transducer           LCS-6B         7/2/20         9.2         9.4         429.52         18.6         448.12         Y         Dedicated Transducer										
LCS-6B         5/28/20         7.8         9.4         429.52         17.2         446.72         Y         Dedicated Transducer           LCS-6B         6/4/20         8.9         9.4         429.52         18.3         447.82         Y         Dedicated Transducer           LCS-6B         6/11/20         7.9         9.4         429.52         17.3         446.82         Y         Dedicated Transducer           LCS-6B         6/18/20         8.9         9.4         429.52         18.3         447.82         Y         Dedicated Transducer           LCS-6B         6/25/20         8.7         9.4         429.52         18.1         447.62         Y         Dedicated Transducer           LCS-6B         7/2/20         9.2         9.4         429.52         18.6         448.12         Y         Dedicated Transducer										
LCS-6B         6/4/20         8.9         9.4         429.52         18.3         447.82         Y         Dedicated Transducer           LCS-6B         6/11/20         7.9         9.4         429.52         17.3         446.82         Y         Dedicated Transducer           LCS-6B         6/18/20         8.9         9.4         429.52         18.3         447.82         Y         Dedicated Transducer           LCS-6B         6/25/20         8.7         9.4         429.52         18.1         447.62         Y         Dedicated Transducer           LCS-6B         7/2/20         9.2         9.4         429.52         18.6         448.12         Y         Dedicated Transducer										
LCS-6B         6/11/20         7.9         9.4         429.52         17.3         446.82         Y         Dedicated Transducer           LCS-6B         6/18/20         8.9         9.4         429.52         18.3         447.82         Y         Dedicated Transducer           LCS-6B         6/25/20         8.7         9.4         429.52         18.1         447.62         Y         Dedicated Transducer           LCS-6B         7/2/20         9.2         9.4         429.52         18.6         448.12         Y         Dedicated Transducer								Y		
LCS-6B         6/25/20         8.7         9.4         429.52         18.1         447.62         Y         Dedicated Transducer           LCS-6B         7/2/20         9.2         9.4         429.52         18.6         448.12         Y         Dedicated Transducer           Description of the properties of the propert										
LCS-6B 7/2/20 9.2 9.4 429.52 18.6 448.12 Y Dedicated Transducer									Dedicated Transducer	
							447.62			
LCS-6B 7/9/20 9.0 9.4 429.52 18.4 447.92 Y Dedicated Transducer										
	LCS- 6B	7/9/20	9.0	9.4	429.52	18.4	447.92	Υ	Dedicated Transducer	