



GIW ID#	Reading Date	CH4 (% Vol.)	CO2 (% Vol.)	Oxygen (% Vol.)	Balance (% Vol.)	Wellhead Temp. (°F)	Initial Static Pressure (In W.C.)	Pump Operational (Y/N)	Comments
GIW-01	05/01/17	6.8	27.0	9.7	56.5	63.8	-18.6	Y	
GIW-01	05/01/17	6.5	27.8	9.9	55.8	61.5	-19.2	Y	
GIW-01	05/11/17	7.5	41.1	6.9	44.5	82.1	-19.0	Y	
GIW-01	05/11/17	9.7	34.6	7.3	48.4	82.3	-19.0	Y	
GIW-01	05/15/17	7.4	36.6	3.2	52.8	98.4	-17.6	Y	
GIW-01	05/23/17	9.3	43.6	1.9	45.2	88.3	-18.1	Y	
GIW-01	05/30/17	6.6	42.4	4.3	46.7	102.1	-18.7	Y	
GIW-01	06/05/17	14.5	52.3	2.1	31.1	109.9	-18.2	Y	
GIW-01	06/05/17	14.6	50.6	2.2	32.6	111.0	-17.5	Y	
GIW-01	06/12/17	20.2	46.8	1.0	32.0	104.8	-17.5	Y	
GIW-01	06/19/17	11.3	37.6	2.8	48.3	99.2	-17.3	Y	
GIW-01	06/26/17	23.1	42.2	1.2	33.5	100.9	-17.4	Y	
GIW-01	07/06/17	21.4	54.8	0.9	22.9	111.4	-17.7	Y	
GIW-01	07/12/17	13.6	38.7	2.4	45.3	98.4	-18.1	Y	
GIW-01	07/12/17	14.0	33.9	2.5	49.6	98.9	-18.1	Y	
GIW-01	07/17/17	16.6	50.2	1.3	31.9	104.8	-17.5	Y	
GIW-01	07/24/17	16.6	54.1	1.4	27.9	105.0	-18.1	Y	
GIW-01	07/31/17	13.5	57.4	0.9	28.2	110.7	-19.1	Y	
GIW-01	08/07/17	12.3	57.9	1.6	28.2	89.6	-18.9	Y	
GIW-01	08/08/17	12.9	59.9	0.8	26.4	101.8	-18.6	Y	
GIW-01	08/08/17	12.2	60.1	0.8	26.9	102.8	-15.2	Y	
GIW-01	08/15/17	12.4	64.6	0.7	22.3	119.4	-14.1	Y	
GIW-01	08/22/17	17.0	60.5	0.1	22.4	97.2	-15.7	Y	
GIW-01	08/29/17	18.4	50.8	2.0	28.8	107.2	-15.6	Y	

# GIW-1 Wellhead Temperatures

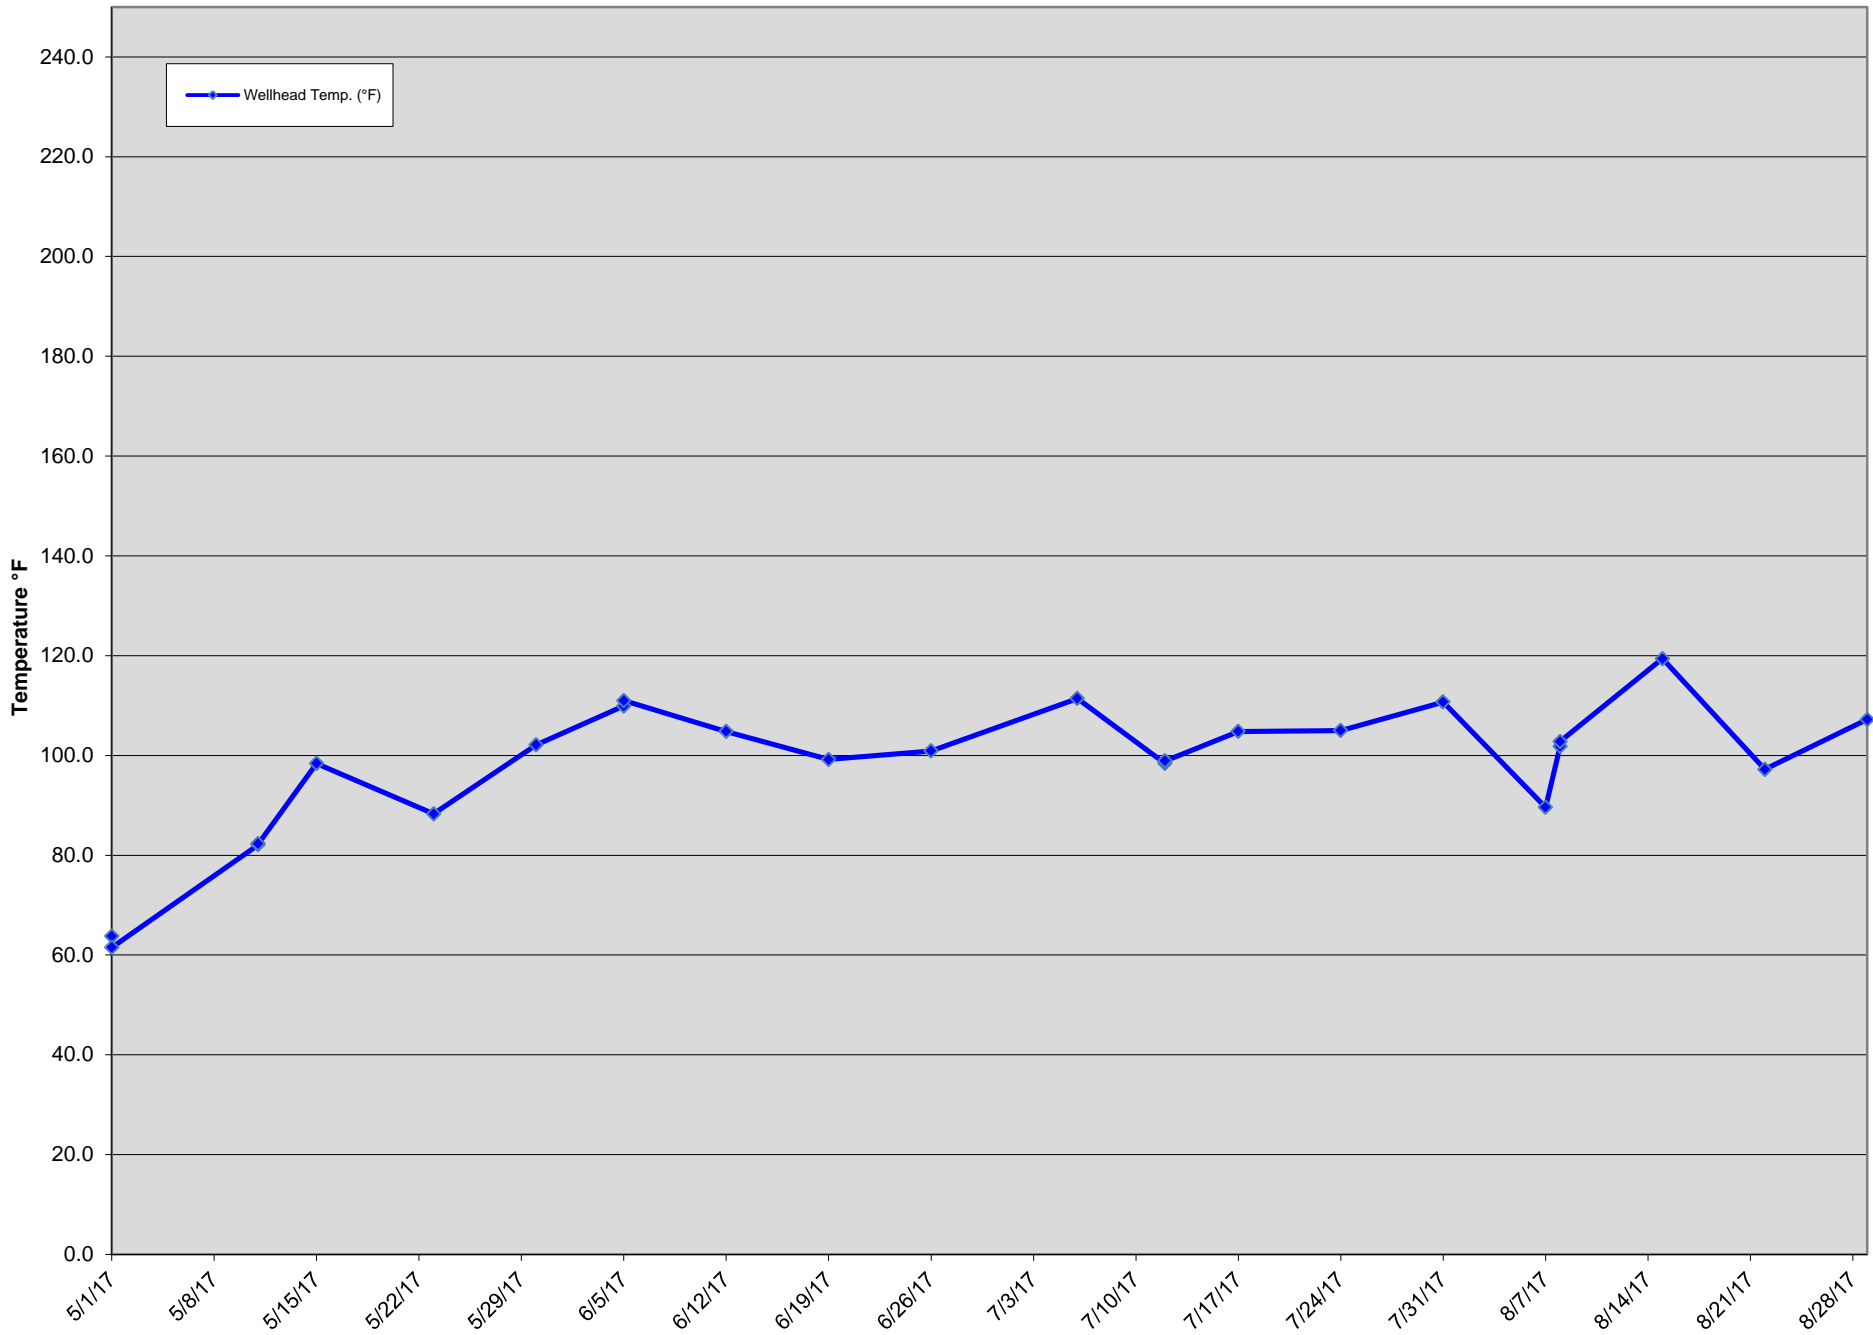


GIW ID#	Reading Date	CH4 (% Vol.)	CO2 (% Vol.)	Oxygen (% Vol.)	Balance (% Vol.)	Wellhead Temp. (F)	Initial Static Pressure (In W.C.)	Pump Operational (Y/N)	Comments
GIW-02	05/01/17	6.9	32.2	10.3	50.6	59.8	-0.3	N/A	(HES Installed)
GIW-02	05/01/17	6.6	32.7	10.3	50.4	60.1	-0.2	N/A	(HES Installed)
GIW-02	05/11/17	8.1	31.3	9.5	51.1	71.6	-0.3	N/A	(HES Installed)
GIW-02	05/11/17	7.2	35.3	9.5	48.0	71.8	-0.3	N/A	(HES Installed)
GIW-02	05/15/17	8.7	35.8	7.9	47.6	96.0	-0.3	N/A	(HES Installed)
GIW-02	05/15/17	8.7	36.8	7.9	46.6	96.3	-0.3	N/A	(HES Installed)
GIW-02	05/23/17	7.2	37.3	8.1	47.4	74.8	-0.3	N/A	(HES Installed)
GIW-02	05/23/17	7.1	37.2	8.2	47.5	75.2	-0.3	N/A	(HES Installed)
GIW-02	05/30/17	7.1	36.9	8.2	47.8	89.6	-0.3	N/A	(HES Installed)
GIW-02	05/30/17	7.3	36.5	8.1	48.1	90.5	-0.3	N/A	(HES Installed)
GIW-02	06/05/17	7.0	38.2	7.2	47.6	101.8	-0.3	N/A	(HES Installed)
GIW-02	06/05/17	7.0	37.1	7.4	48.5	101.8	-0.3	N/A	(HES Installed)
GIW-02	06/12/17	6.4	37.0	8.6	48.0	101.8	-0.36	N/A	(HES Installed)
GIW-02	06/12/17	6.0	35.9	8.7	49.4	101.8	-0.34	N/A	(HES Installed)
GIW-02	06/19/17	6.5	35.0	9.3	49.2	92.0	-0.4	N/A	(HES Installed)
GIW-02	06/19/17	6.5	34.8	9.4	49.3	93.4	-0.1	N/A	(HES Installed)
GIW-02	06/26/17	9.0	48.9	3.7	38.4	93.4	-0.1	N/A	(HES Installed)
GIW-02	07/06/17	9.3	57.8	1.1	31.8	101.6	-0.1	N/A	(HES Installed)
GIW-02	07/12/17	16.0	59.1	0.0	24.9	93.6	-0.1	N/A	(HES Installed)
GIW-02	07/12/17	15.7	62.5	0.0	21.8	92.9	0.0	N/A	(HES Installed)
GIW-02	07/17/17	17.6	63.2	0.0	19.2	97.2	0.0	N/A	(HES Installed)
GIW-02	07/24/17	16.6	61.5	0.0	21.9	99.4	0.0	N/A	(HES Installed)
GIW-02	07/31/17	16.2	61.4	0.0	22.4	98.9	0.0	N/A	(HES Installed)
GIW-02	08/07/17	16.9	64.6	0.0	18.5	77.1	0.0	N/A	(HES Installed)
GIW-02	08/08/17	16.9	60.0	0.0	23.1	92.8	0.0	N/A	(HES Installed)
GIW-02	08/08/17	16.4	59.2	0.0	24.4	92.9	-0.1	N/A	(HES Installed)
GIW-02	08/15/17	13.8	53.0	3.3	29.9	108.5	-0.1	N/A	(HES Installed)
GIW-02	08/22/17	3.6	36.1	11.1	49.2	88.1	-0.2	N/A	(HES Installed)
GIW-02	08/22/17	3.5	33.9	11.3	51.3	88.6	-0.2	N/A	(HES Installed)
GIW-02	08/29/17	3.6	30.6	12.2	53.6	104.8	-0.3	N/A	(HES Installed)
GIW-02	08/29/17	3.6	29.9	12.2	54.3	105.0	-0.3	N/A	(HES Installed)

# GIW-2 Wellhead Temperatures

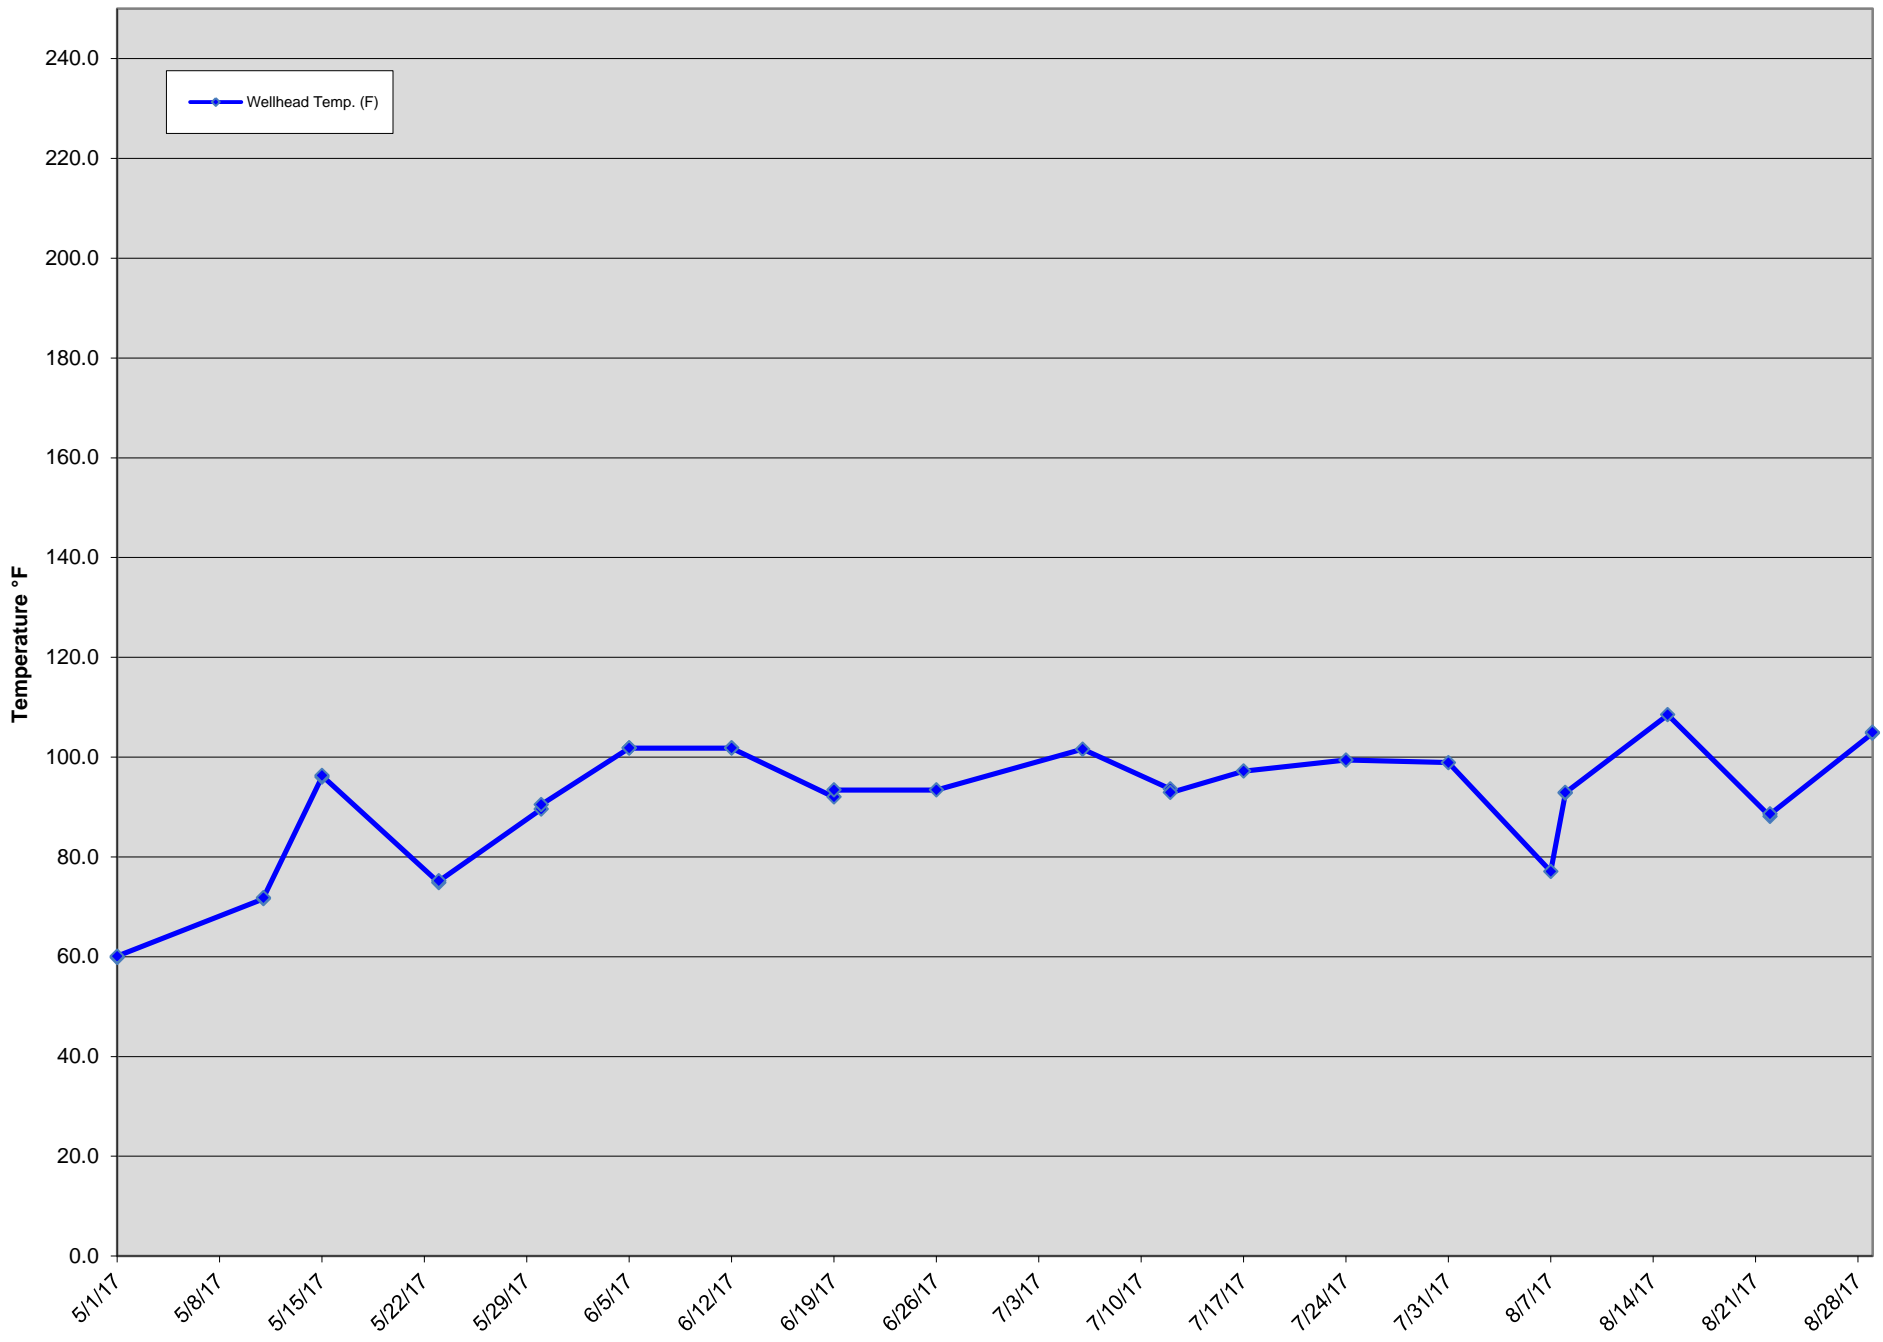


GIW ID#	Reading Date	CH4 (% Vol.)	CO2 (% Vol.)	Oxygen (% Vol.)	Balance (% Vol.)	Wellhead Temp. (F)	Initial Static Pressure (In W.C.)	Pump Operational (Y/N)	Comments
GIW-03	05/01/17	1.0	56.0	2.1	40.9	59.3	-1.6	N/A	(HES Installed)
GIW-03	05/01/17	0.8	52.6	2.5	44.1	57.0	-1.6	N/A	(HES Installed)
GIW-03	05/11/17	1.0	49.1	3.1	46.8	71.8	-3.0	N/A	(HES Installed)
GIW-03	05/15/17	1.2	50.4	2.5	45.9	92.4	-2.3	N/A	(HES Installed)
GIW-03	05/23/17	0.9	47.8	5.1	46.2	75.9	-3.1	N/A	(HES Installed)
GIW-03	05/23/17	0.8	48.9	5.2	45.1	76.2	-3.5	N/A	(HES Installed)
GIW-03	05/30/17	0.8	49.2	4.7	45.3	92.6	-4.4	N/A	(HES Installed)
GIW-03	06/05/17	1.1	48.4	4.4	46.1	112.4	-4.1	N/A	(HES Installed)
GIW-03	06/05/17	1.3	48.9	4.2	45.6	111.8	-4.3	N/A	(HES Installed)
GIW-03	06/12/17	0.8	53.7	2.1	43.4	97.4	-4.5	N/A	(HES Installed)
GIW-03	06/19/17	1.2	50.7	3.9	44.2	91.9	-5.1	N/A	(HES Installed)
GIW-03	06/26/17	1.7	49.3	2.7	46.3	88.4	-5.2	N/A	(HES Installed)
GIW-03	07/06/17	1.2	50.4	3.8	44.6	111.7	-7.9	N/A	(HES Installed)
GIW-03	07/12/17	1.1	51.3	3.9	43.7	87.2	-5.8	N/A	(HES Installed)
GIW-03	07/12/17	0.7	52.9	3.7	42.7	87.5	-5.8	N/A	(HES Installed)
GIW-03	07/17/17	2.3	56.5	3.2	38.0	98.4	-3.6	N/A	(HES Installed)
GIW-03	07/24/17	1.3	52.2	4.6	41.9	98.2	-2.7	N/A	(HES Installed)
GIW-03	07/31/17	1.8	50.0	3.6	44.6	97.4	-2.9	N/A	(HES Installed)
GIW-03	08/07/17	1.0	54.9	3.8	40.3	77.4	-2.4	N/A	(HES Installed)
GIW-03	08/08/17	1.4	52.3	3.9	42.4	102.3	-2.9	N/A	(HES Installed)
GIW-03	08/08/17	0.8	50.8	4.2	44.2	104.8	-3.3	N/A	(HES Installed)
GIW-03	08/15/17	1.5	56.3	1.9	40.3	112.3	-0.8	N/A	(HES Installed)
GIW-03	08/22/17	7.1	48.7	2.9	41.3	91.3	-18.1	N/A	(HES Installed)
GIW-03	08/29/17	6.8	55.5	1.1	36.6	94.6	-2.80	N/A	(HES Installed)

# GIW-3 Wellhead Temperatures

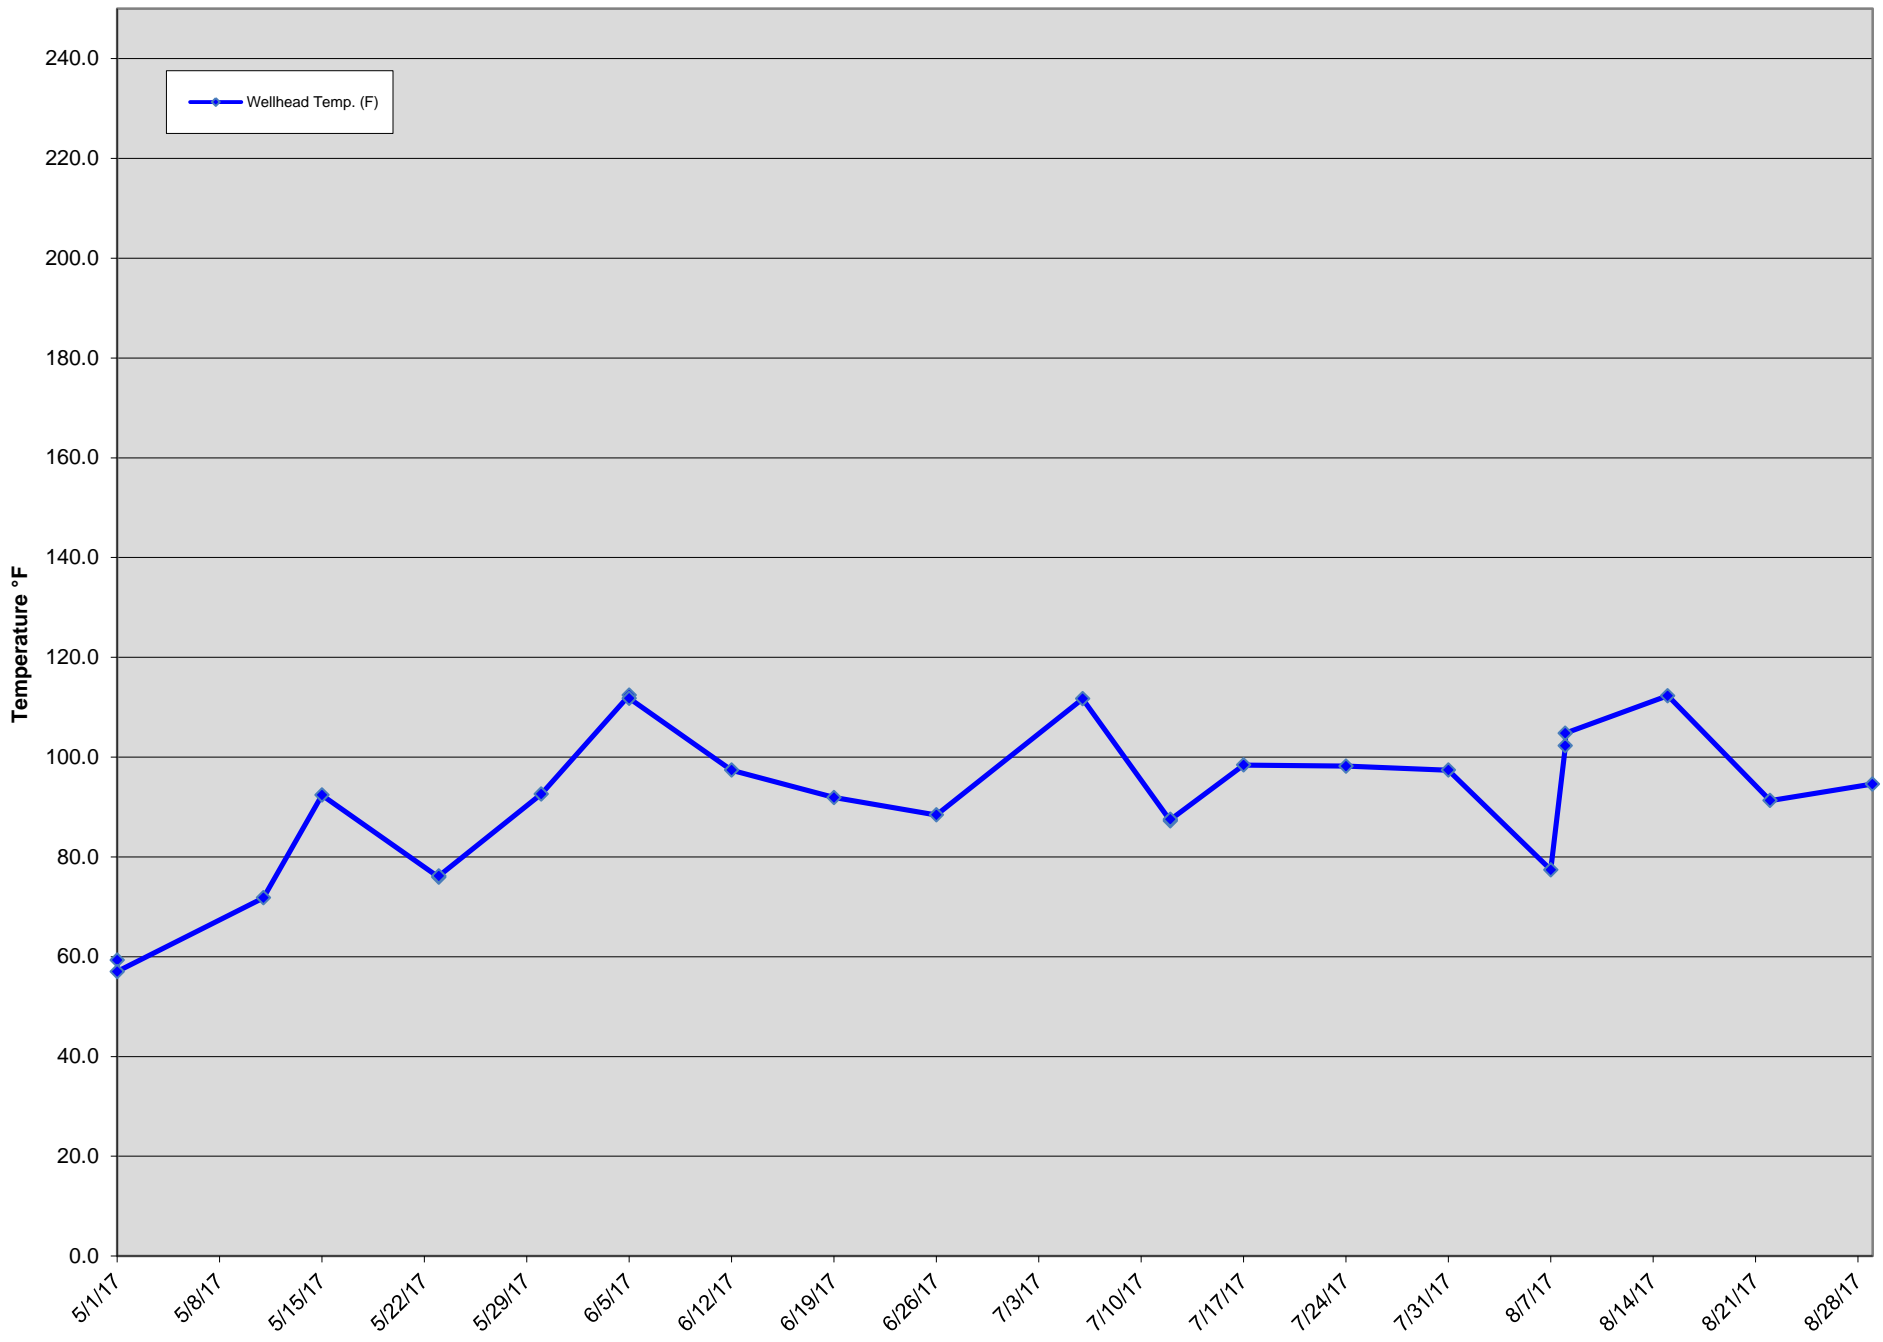

GIW ID#	Reading Date	CH4 (% Vol.)	CO2 (% Vol.)	Oxygen (% Vol.)	Balance (% Vol.)	Wellhead Temp. (F)	Initial Static Pressure (In W.C.)	Pump Operational (Y/N)	Comments
GIW-04	05/02/17	0.5	25.5	10.8	63.2	73.9	-2.2	N/A	(HES Installed)
GIW-04	05/02/17	0.6	27.3	10.5	61.6	77.4	-2.1	N/A	(HES Installed)
GIW-04	05/11/17	0.9	45.5	4.6	49.0	71.0	-3.5	N/A	(HES Installed)
GIW-04	05/15/17	0.6	25.6	11.2	62.6	96.5	-2.7	N/A	(HES Installed)
GIW-04	05/16/17	0.5	24.3	11.1	64.1	89.8	-2.8	N/A	(HES Installed)
GIW-04	05/23/17	0.4	25.7	12.8	61.1	75.0	-3.7	N/A	(HES Installed)
GIW-04	05/23/17	0.4	24.1	12.7	62.8	76.0	-3.6	N/A	(HES Installed)
GIW-04	05/30/17	0.4	21.7	13.4	64.5	85.2	-4.3	N/A	(HES Installed)
GIW-04	05/30/17	0.4	20.3	13.4	65.9	86.8	-4.3	N/A	(HES Installed)
GIW-04	06/05/17	0.8	32.5	9.5	57.2	103.3	-4.4	N/A	(HES Installed)
GIW-04	06/05/17	0.9	32.5	9.3	57.3	103.0	-4.2	N/A	(HES Installed)
GIW-04	06/12/17	0.3	27.4	12.5	59.8	99.1	-4.7	N/A	(HES Installed)
GIW-04	06/12/17	0.3	28.2	12.3	59.2	99.9	-4.7	N/A	(HES Installed)
GIW-04	06/19/17	0.4	20.9	14.7	64.0	93.4	-5.8	N/A	(HES Installed)
GIW-04	06/19/17	0.4	22.1	14.3	63.2	93.6	-5.4	N/A	(HES Installed)
GIW-04	06/26/17	0.3	18.4	15.1	66.2	91.7	-5.7	N/A	(HES Installed)
GIW-04	06/26/17	0.3	15.9	15.0	68.8	94.0	-5.7	N/A	(HES Installed)
GIW-04	07/06/17	0.4	22.2	12.7	64.7	105.2	-8.4	N/A	(HES Installed)
GIW-04	07/06/17	0.4	23.2	12.6	63.8	106.7	-8.3	N/A	(HES Installed)
GIW-04	07/12/17	0.3	19.8	14.5	65.4	94.4	-5.8	N/A	(HES Installed)
GIW-04	07/12/17	0.4	16.3	14.6	68.7	95.8	-5.6	N/A	(HES Installed)
GIW-04	07/17/17	0.6	26.9	12.4	60.1	101.8	-3.3	N/A	(HES Installed)
GIW-04	07/17/17	0.6	25.1	12.4	61.9	103.5	-3.3	N/A	(HES Installed)
GIW-04	07/24/17	0.4	31.2	11.4	57.0	96.6	-2.4	N/A	(HES Installed)
GIW-04	07/24/17	0.4	27.9	11.4	60.3	99.1	-2.4	N/A	(HES Installed)
GIW-04	07/31/17	0.3	24.7	12.4	62.6	92.9	-2.9	N/A	(HES Installed)
GIW-04	07/31/17	0.3	22.7	12.3	64.7	95.0	-3.0	N/A	(HES Installed)
GIW-04	08/07/17	0.4	27.7	11.2	60.7	76.7	-2.2	N/A	(HES Installed)
GIW-04	08/07/17	0.4	27.9	10.9	60.8	78.4	-2.1	N/A	(HES Installed)
GIW-04	08/08/17	0.4	25.4	12.1	62.1	98.4	-3.0	N/A	(HES Installed)
GIW-04	08/08/17	0.4	20.2	12.6	66.8	101.6	-2.9	N/A	(HES Installed)
GIW-04	08/15/17	0.7	45.3	4.7	49.3	103.7	-0.2	N/A	(HES Installed)
GIW-04	08/22/17	0.3	35.2	7.8	56.7	91.8	-19.2	N/A	(HES Installed)
GIW-04	08/22/17	0.6	39.0	7.0	53.4	92.9	-19.0	N/A	(HES Installed)
GIW-04	08/29/17	9.4	53.0	2.0	35.6	95.5	-7.4	N/A	(HES Installed)


# GIW-4 Wellhead Temperatures

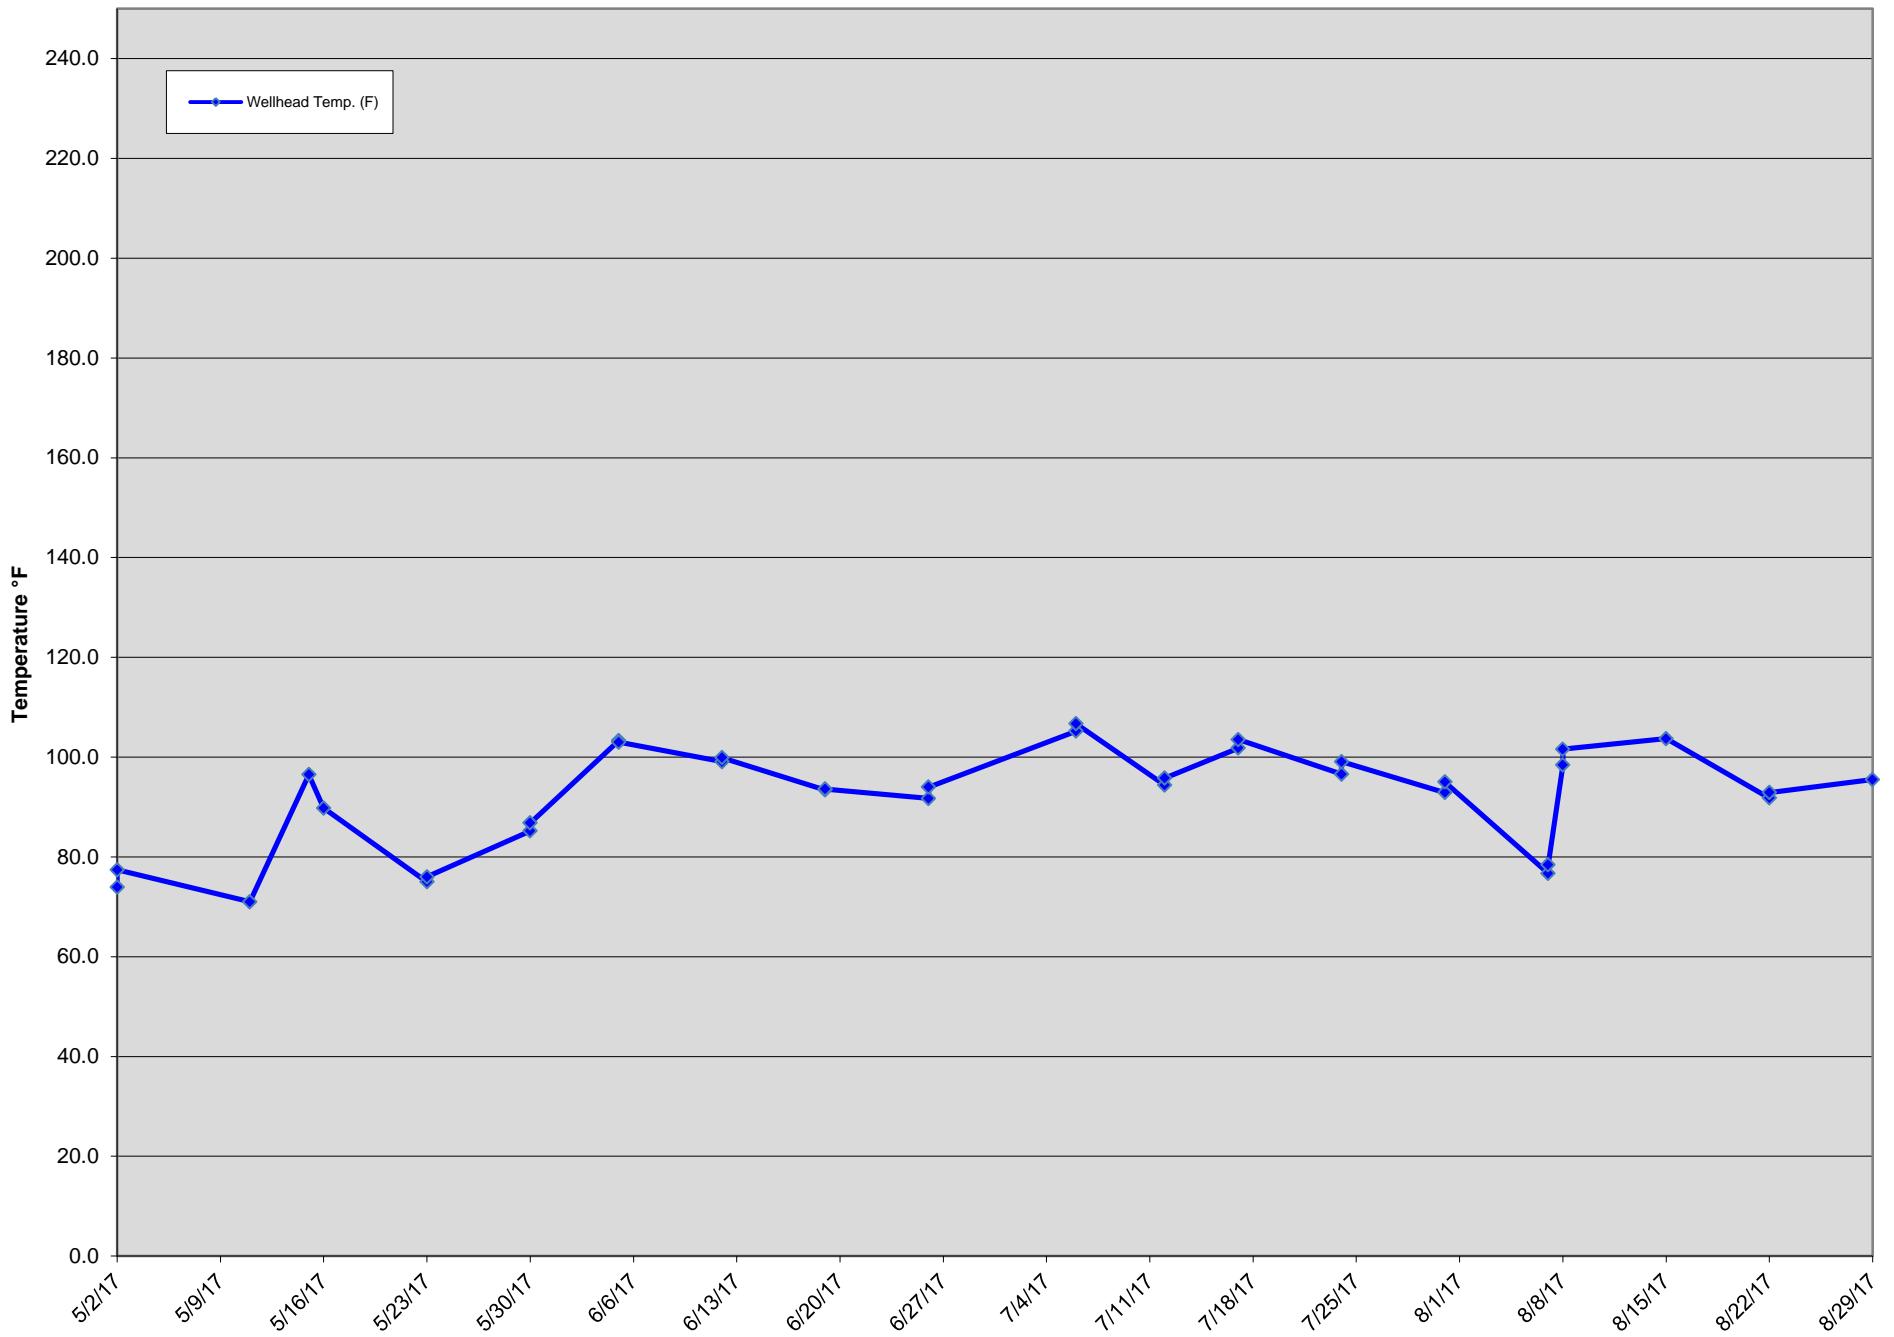




GIW ID#	Reading Date	CH4 (% Vol.)	CO2 (% Vol.)	Oxygen (% Vol.)	Balance (% Vol.)	Wellhead Temp. (F)	Initial Static Pressure (In W.C.)	Pump Operational (Y/N)	Comments
GIW-05	05/02/17	0.0	7.8	19.6	72.6	62.6	-5.8	N/A	(HES Installed)
GIW-05	05/02/17	0.0	2.2	21.0	76.8	64.3	-4.3	N/A	(HES Installed)
GIW-05	05/11/17	0.0	5.7	20.8	73.5	70.9	-4.8	N/A	(HES Installed)
GIW-05	05/11/17	0.0	2.9	21.4	75.7	70.9	-5.4	N/A	(HES Installed)
GIW-05	05/15/17	0.1	2.6	20.5	76.8	89.6	-7.9	N/A	(HES Installed)
GIW-05	05/15/17	0.1	1.6	20.6	77.7	91.5	-10.2	N/A	(HES Installed)
GIW-05	05/23/17	0.0	4.1	20.8	75.1	73.0	-4.4	N/A	(HES Installed)
GIW-05	05/23/17	0.0	2.0	21.3	76.7	73.6	-3.7	N/A	(HES Installed)
GIW-05	05/30/17	0.0	3.0	20.5	76.5	83.1	-0.1	N/A	(HES Installed)
GIW-05	05/30/17	0.0	1.6	20.8	77.6	83.6	-0.1	N/A	(HES Installed)
GIW-05	06/05/17	0.2	5.5	20.2	74.1	101.3	-4.2	N/A	(HES Installed)
GIW-05	06/05/17	1.2	22.6	11.9	64.3	101.1	-4.3	N/A	(HES Installed)
GIW-05	06/12/17	0.2	13.9	17.9	68.0	95.3	-0.6	N/A	(HES Installed)
GIW-05	06/12/17	0.7	23.0	14.1	62.2	96.7	-0.2	N/A	(HES Installed)
GIW-05	06/19/17	2.8	54.5	0.0	42.7	88.8	1.0	N/A	(HES Installed)
GIW-05	06/19/17	2.9	54.2	0.0	42.9	89.2	1.1	N/A	(HES Installed)
GIW-05	06/26/17	2.7	55.0	0.0	42.3	88.2	1.3	N/A	(HES Installed)
GIW-05	06/26/17	2.8	56.0	0.0	41.2	90.9	1.3	N/A	(HES Installed)
GIW-05	07/06/17	2.2	52.9	0.1	44.8	99.9	0.5	N/A	(HES Installed)
GIW-05	07/06/17	2.1	48.3	1.6	48.0	100.6	-0.7	N/A	(HES Installed)
GIW-05	07/12/17	5.3	49.5	0.0	45.2	91.2	1.3	N/A	(HES Installed)
GIW-05	07/12/17	5.7	47.8	0.0	46.5	92.6	1.2	N/A	(HES Installed)
GIW-05	07/17/17	6.6	54.9	0.0	38.5	92.7	1.8	N/A	(HES Installed)
GIW-05	07/17/17	6.6	55.7	0.0	37.7	95.3	1.9	N/A	(HES Installed)
GIW-05	07/24/17	8.0	56.0	0.0	36.0	93.8	1.9	N/A	(HES Installed)
GIW-05	07/24/17	8.2	56.3	0.0	35.5	95.8	2.1	N/A	(HES Installed)
GIW-05	07/31/17	1.8	53.2	0.0	45.0	93.9	1.2	N/A	(HES Installed)
GIW-05	07/31/17	2.0	54.9	0.0	43.1	95.5	1.1	N/A	(HES Installed)
GIW-05	08/07/17	1.9	53.5	0.0	44.6	76.1	4.0	N/A	(HES Installed)
GIW-05	08/07/17	2.0	54.7	0.0	43.3	77.1	4.3	N/A	(HES Installed)
GIW-05	08/09/17	2.0	53.9	0.0	44.1	81.2	3.8	N/A	(HES Installed)
GIW-05	08/09/17	1.6	46.1	0.0	52.3	84.3	3.8	N/A	(HES Installed)
GIW-05	08/11/17	3.1	48.7	0.6	47.6	87.5	-0.1	N/A	(HES Installed)
GIW-05	08/15/17	2.5	53.3	0.0	44.2	99.7	1.0	N/A	(HES Installed)
GIW-05	08/15/17	2.6	54.3	0.0	43.1	101.8	-0.2	N/A	(HES Installed)
GIW-05	08/22/17	30.4	48.3	0.7	20.6	88.2	-17.8	N/A	(HES Installed)
GIW-05	08/22/17	29.1	41.7	2.6	26.6	87.9	-0.5	N/A	(HES Installed)
GIW-05	08/29/17	0.7	23.0	12.8	63.5	88.0	-0.8	N/A	(HES Installed)
GIW-05	08/29/17	0.4	16.1	13.7	69.8	91.0	-0.8	N/A	(HES Installed)

# GIW-5 Wellhead Temperatures

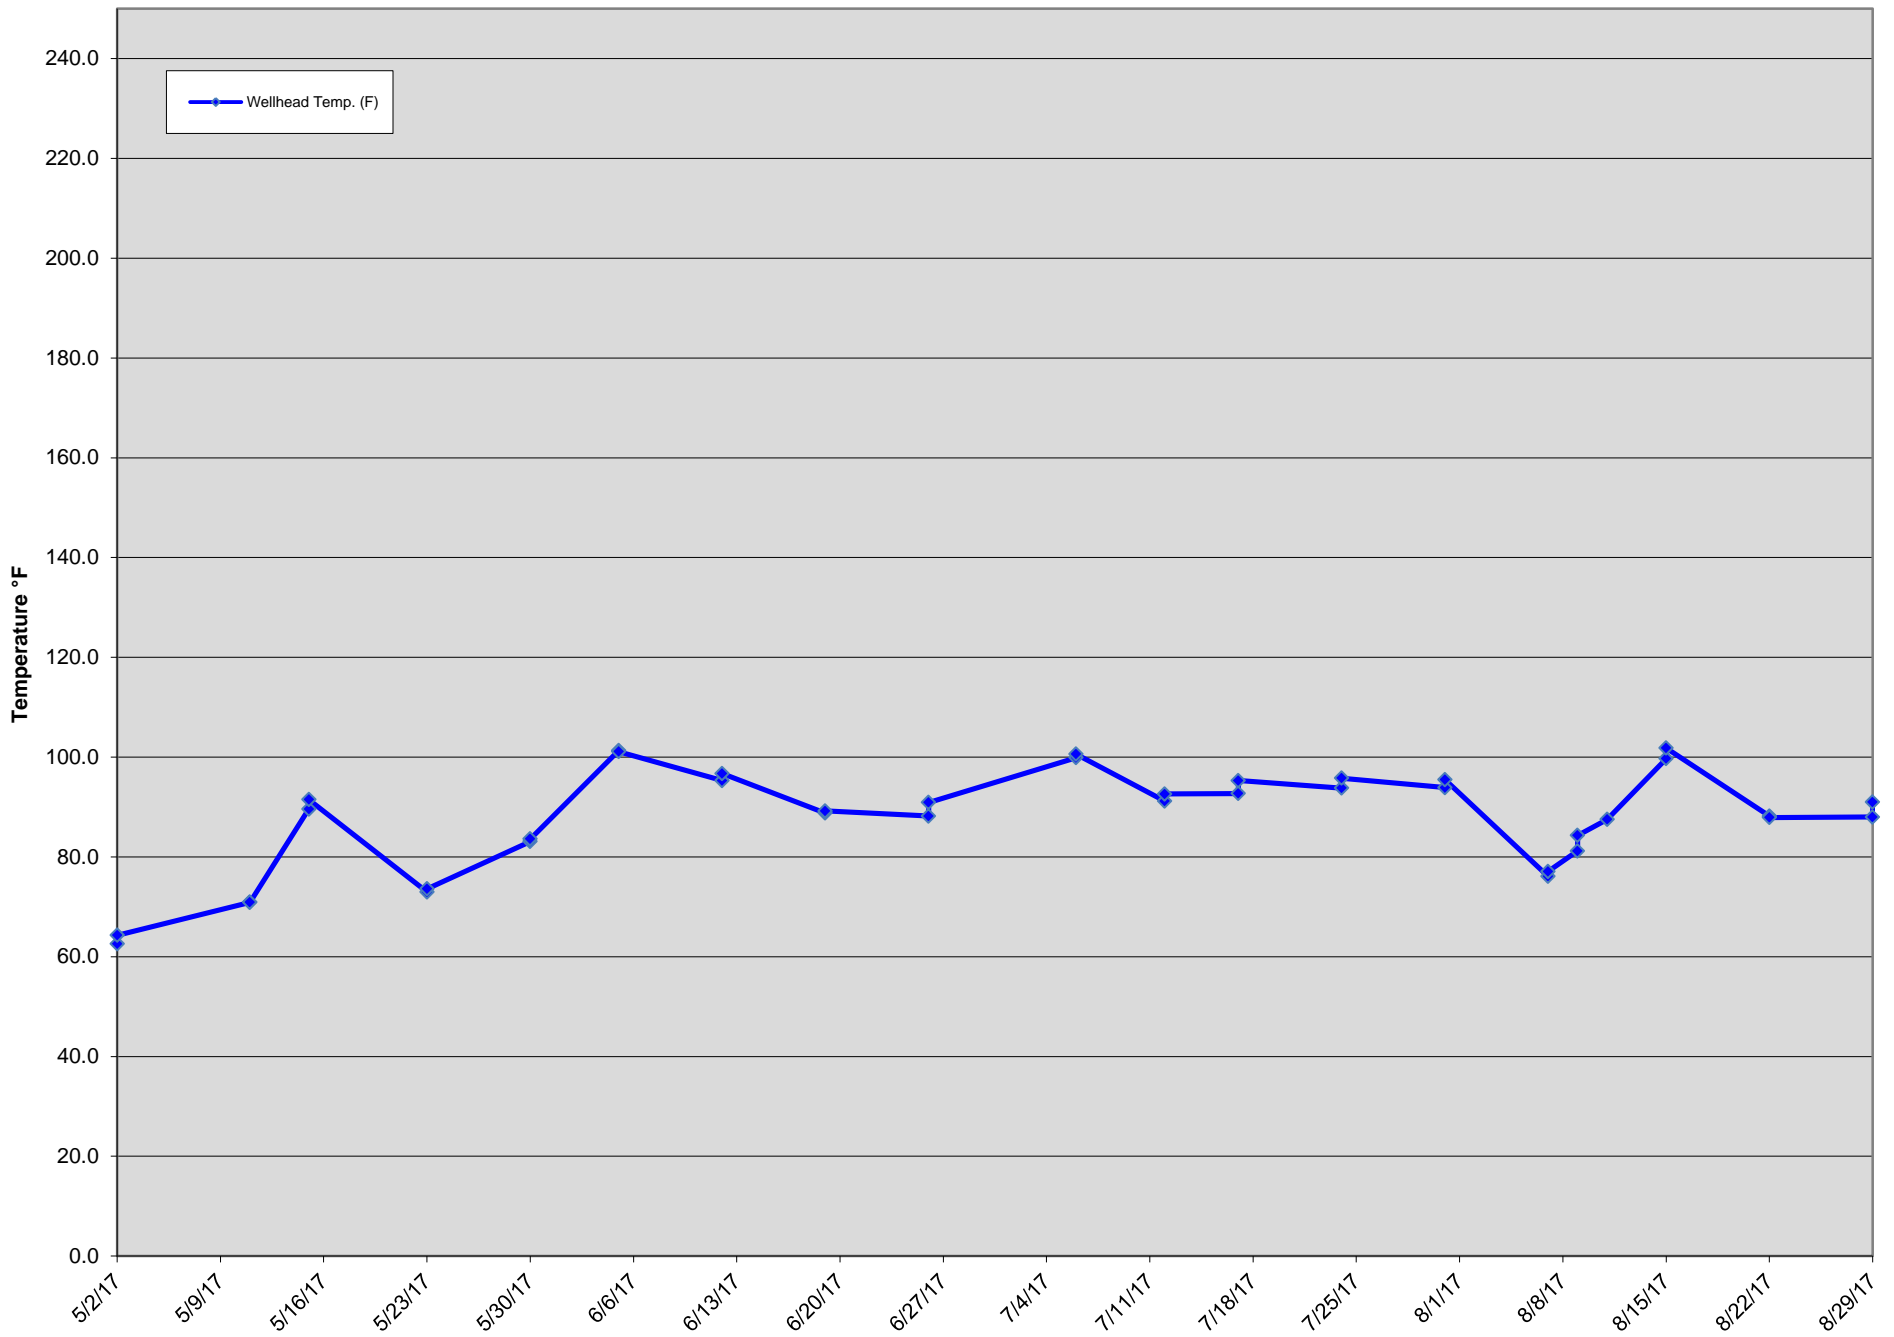


GIW ID#	Reading Date	CH4 (% Vol.)	CO2 (% Vol.)	Oxygen (% Vol.)	Balance (% Vol.)	Wellhead Temp. (F)	Initial Static Pressure (In W.C.)	Pump Operational (Y/N)	Comments
GIW-06	05/02/17	4.8	52.9	0.0	42.3	72.5	-2.3	N/A	(HES Installed)
GIW-06	05/02/17	5.5	51.2	0.0	43.3	70.7	-2.3	N/A	(HES Installed)
GIW-06	05/11/17	24.9	48.6	0.1	26.4	70.4	-3.4	N/A	(HES Installed)
GIW-06	05/15/17	24.7	46.3	0.0	29.0	91.9	-2.7	N/A	(HES Installed)
GIW-06	05/23/17	17.3	48.3	0.2	34.2	75.0	-3.5	N/A	(HES Installed)
GIW-06	05/30/17	22.1	48.5	0.1	29.3	90.3	-4.4	N/A	(HES Installed)
GIW-06	06/05/17	9.8	50.6	0.6	39.0	98.4	-4.5	N/A	(HES Installed)
GIW-06	06/05/17	11.2	48.7	0.6	39.5	95.8	-4.4	N/A	(HES Installed)
GIW-06	06/12/17	14.4	48.6	0.7	36.3	99.1	-4.8	N/A	(HES Installed)
GIW-06	06/19/17	17.2	50.8	0.2	31.8	92.9	-5.5	N/A	(HES Installed)
GIW-06	06/26/17	15.8	52.9	0.3	31.0	90.1	-5.7	N/A	(HES Installed)
GIW-06	07/06/17	14.1	52.2	0.3	33.4	105.0	-8.4	N/A	(HES Installed)
GIW-06	07/12/17	10.9	51.9	0.2	37.0	98.4	-5.4	N/A	(HES Installed)
GIW-06	07/12/17	9.6	48.3	0.2	41.9	99.6	-5.4	N/A	(HES Installed)
GIW-06	07/17/17	10.0	52.5	0.2	37.3	103.5	-3.3	N/A	(HES Installed)
GIW-06	07/24/17	7.1	53.1	0.1	39.7	104.0	-2.2	N/A	(HES Installed)
GIW-06	07/31/17	22.3	52.4	0.0	25.3	94.1	-3.1	N/A	(HES Installed)
GIW-06	08/07/17	21.2	52.9	0.0	25.9	78.60	-2.6	N/A	(HES Installed)
GIW-06	08/09/17	22.2	52.1	0.0	25.7	86.30	-2.5	N/A	(HES Installed)
GIW-06	08/09/17	20.9	47.3	0.0	31.8	89.30	-2.9	N/A	(HES Installed)
GIW-06	08/15/17	11.0	53.4	0.0	35.6	104.00	-0.2	N/A	(HES Installed)
GIW-06	08/23/17	36.3	44.0	0.4	19.3	85.90	-19.0	N/A	(HES Installed)
GIW-06	08/23/17	36.2	44.9	0.1	18.8	86.30	-17.3	N/A	(HES Installed)
GIW-06	08/29/17	14.7	48.8	0.2	36.3	91.40	-16.7	N/A	(HES Installed)

# GIW-6 Wellhead Temperatures

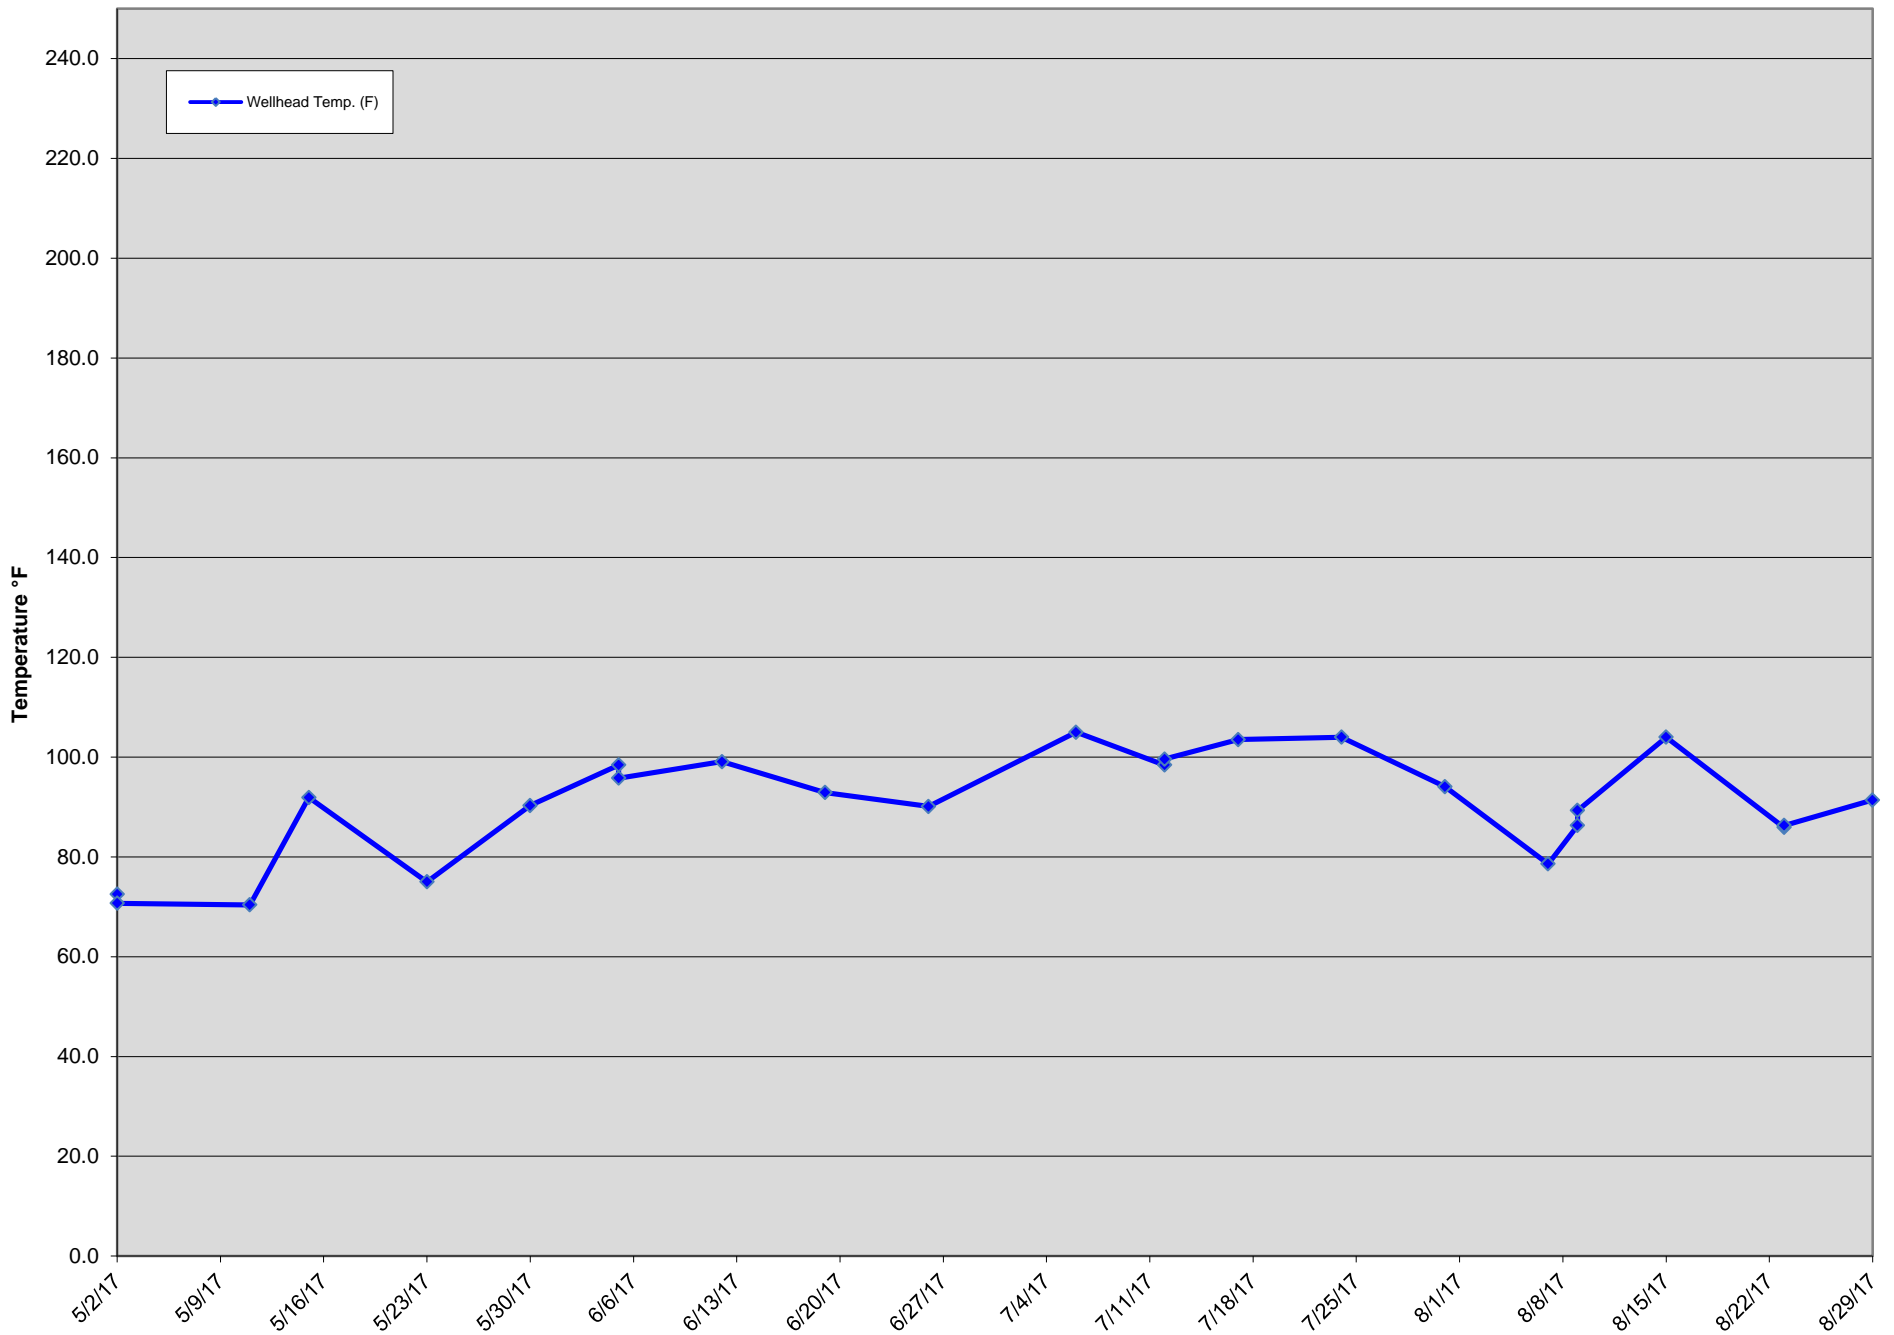


GIW ID#	Reading Date	CH4 (% Vol.)	CO2 (% Vol.)	Oxygen (% Vol.)	Balance (% Vol.)	Wellhead Temp. (F)	Pressure (In W.C.)	Pump Operational (Y/N)	Comments
GIW-07	05/02/17	18.1	50.3	3.1	28.5	77.7	-1.8	N/A	(HES Installed)
GIW-07	05/02/17	16.9	51.8	2.9	28.4	78.0	-1.7	N/A	(HES Installed)
GIW-07	05/11/17	29.0	48.4	1.6	21.0	70.4	-2.3	N/A	(HES Installed)
GIW-07	05/15/17	34.0	47.9	0.9	17.2	100.9	-1.7	N/A	(HES Installed)
GIW-07	05/23/17	33.4	48.7	0.9	17.0	75.7	-2.1	N/A	(HES Installed)
GIW-07	05/30/17	34.9	49.1	0.8	15.2	88.2	-2.6	N/A	(HES Installed)
GIW-07	06/05/17	36.9	47.7	0.9	14.5	92.0	-2.3	N/A	(HES Installed)
GIW-07	06/05/17	37.4	46.7	1.0	14.9	91.6	-2.4	N/A	(HES Installed)
GIW-07	06/12/17	35.4	46.9	0.9	16.8	100.8	-2.8	N/A	(HES Installed)
GIW-07	06/19/17	36.8	47.0	1.1	15.1	93.8	-3.8	N/A	(HES Installed)
GIW-07	06/26/17	37.1	49.4	1.0	12.5	94.2	-4.2	N/A	(HES Installed)
GIW-07	07/06/17	34.2	49.0	1.4	15.4	101.2	-5.9	N/A	(HES Installed)
GIW-07	07/12/17	27.8	54.1	1.2	16.9	100.4	-3.9	N/A	(HES Installed)
GIW-07	07/12/17	27.5	48.2	1.5	22.8	97.4	-3.8	N/A	(HES Installed)
GIW-07	07/17/17	29.1	52.9	0.9	17.1	101.3	-2.3	N/A	(HES Installed)
GIW-07	07/24/17	28.5	53.9	0.9	16.7	99.4	-1.4	N/A	(HES Installed)
GIW-07	07/31/17	32.8	51.5	0.3	15.4	91.7	-0.9	N/A	(HES Installed)
GIW-07	08/07/17	30.6	54.8	0.0	14.6	78.1	-0.4	N/A	(HES Installed)
GIW-07	08/09/17	32.4	51.6	0.0	16.0	92.2	-0.5	N/A	(HES Installed)
GIW-07	08/09/17	31.3	50.2	0.1	18.4	93.9	-0.4	N/A	(HES Installed)
GIW-07	08/15/17	23.1	61.7	0.0	15.2	101.0	0.8	N/A	(HES Installed)
GIW-07	08/16/17	35.8	46.3	0.4	17.5	82.3	-0.7	N/A	(HES Installed)
GIW-07	08/23/17	42.6	46.0	0.5	10.9	90.1	-18.0	N/A	(HES Installed)
GIW-07	08/29/17	28.0	52.7	0.5	18.8	93.6	-16.1	N/A	(HES Installed)

# GIW-7 Wellhead Temperatures

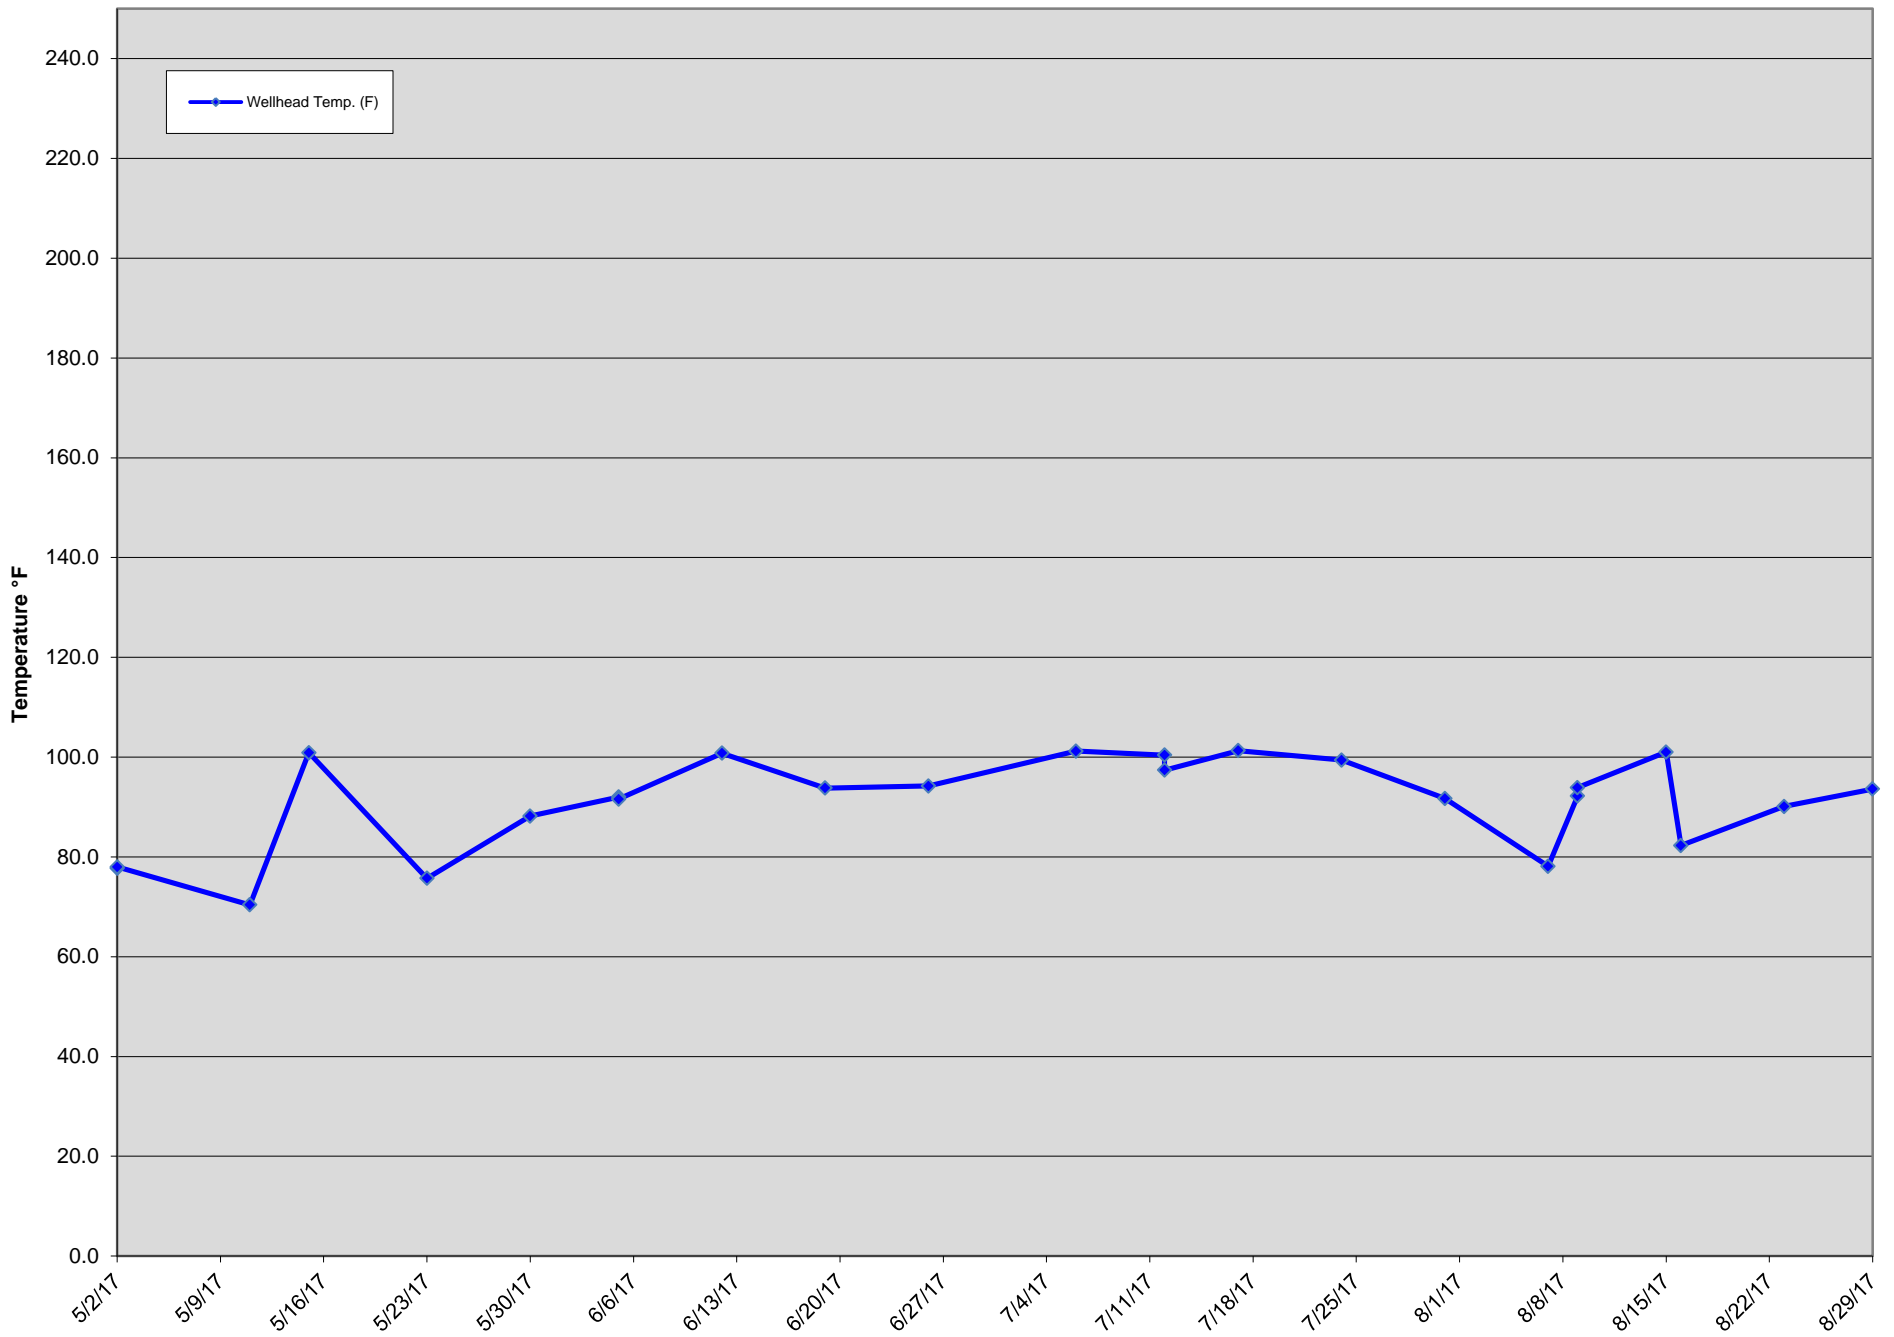

GIW ID#	Reading Date	CH4 (% Vol.)	CO2 (% Vol.)	Oxygen (% Vol.)	Balance (% Vol.)	Wellhead Temp. (F)	Initial Static Pressure (In W.C.)	Pump Operational (Y/N)	Comments
GIW-08	05/02/17	27.6	59.1	0.0	13.3	76.4	-1.5	N/A	(HES Installed)
GIW-08	05/02/17	28.2	61.8	0.0	10.0	77.1	-1.5	N/A	(HES Installed)
GIW-08	05/11/17	29.1	58.7	0.0	12.2	71.4	-1.9	N/A	(HES Installed)
GIW-08	05/15/17	31.0	57.5	0.0	11.5	101.5	-1.5	N/A	(HES Installed)
GIW-08	05/23/17	29.4	56.8	0.0	13.8	76.2	-1.8	N/A	(HES Installed)
GIW-08	05/30/17	30.0	57.2	0.0	12.8	94.6	-2.1	N/A	(HES Installed)
GIW-08	06/05/17	33.2	55.6	0.0	11.2	96.5	-2.2	N/A	(HES Installed)
GIW-08	06/05/17	33.3	54.9	0.0	11.8	94.2	-2.2	N/A	(HES Installed)
GIW-08	06/12/17	30.2	54.5	0.0	15.3	107.6	-2.3	N/A	(HES Installed)
GIW-08	06/19/17	29.3	55.3	0.0	15.4	94.8	-2.9	N/A	(HES Installed)
GIW-08	06/26/17	27.9	57.7	0.0	14.4	101.7	-3.1	N/A	(HES Installed)
GIW-08	07/06/17	27.2	57.4	0.0	15.4	110.2	-4.3	N/A	(HES Installed)
GIW-08	07/12/17	26.0	58.1	0.0	15.9	99.1	-3.0	N/A	(HES Installed)
GIW-08	07/12/17	26.1	56.8	0.0	17.1	98.4	-3.0	N/A	(HES Installed)
GIW-08	07/17/17	26.1	59.2	0.0	14.7	111.0	-1.9	N/A	(HES Installed)
GIW-08	07/24/17	25.7	59.7	0.0	14.6	107.0	-1.4	N/A	(HES Installed)
GIW-08	07/31/17	36.2	53.7	0.0	10.1	97.2	-1.5	N/A	(HES Installed)
GIW-08	08/07/17	43.3	51.9	0.0	4.8	81.2	-1.4	N/A	(HES Installed)
GIW-08	08/09/17	44.2	48.1	0.0	7.7	89.6	-1.3	N/A	(HES Installed)
GIW-08	08/09/17	44.3	46.8	0.0	8.9	90.5	-1.3	N/A	(HES Installed)
GIW-08	08/15/17	42.2	51.5	0.0	6.3	106.8	0.0	N/A	(HES Installed)
GIW-08	08/15/17	42.8	50.3	0.0	6.9	108.2	0.0	N/A	(HES Installed)
GIW-08	08/23/17	29.3	49.1	0.0	21.6	92.2	-7.2	N/A	(HES Installed)
GIW-08	08/23/17	27.6	51.7	0.0	20.7	95.3	-3.0	N/A	(HES Installed)
GIW-08	08/29/17	22.7	54.6	0.0	22.7	102.5	-3.9	N/A	(HES Installed)


# GIW-8 Wellhead Temperatures

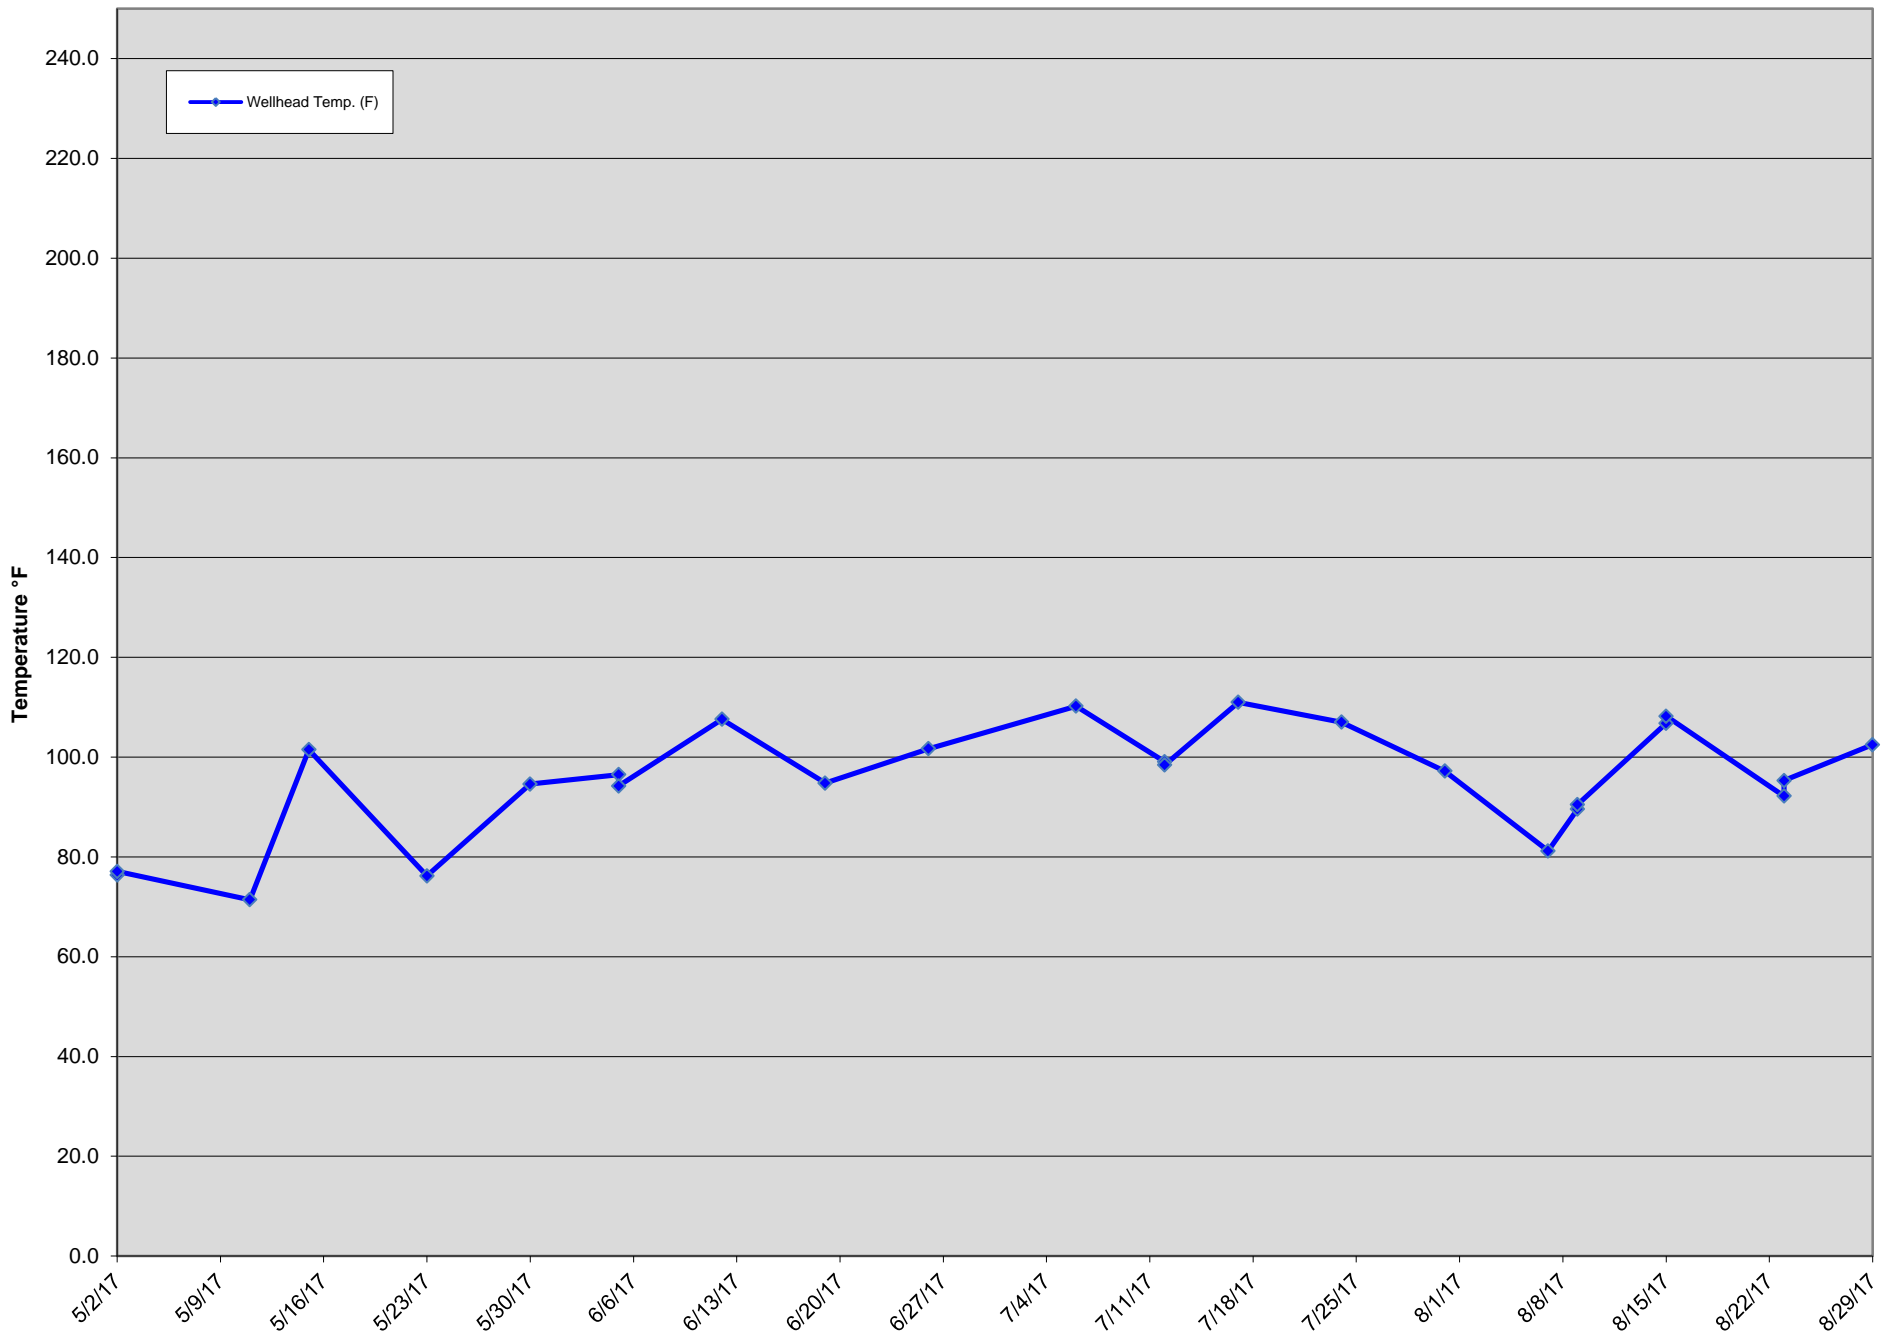




GIW ID#	Reading Date	CH4 (% Vol.)	CO2 (% Vol.)	Oxygen (% Vol.)	Balance (% Vol.)	Wellhead Temp. (F)	Initial Static Pressure (In W.C.)	Pump Operational (Y/N)	Comments
GIW-09	05/02/17	11.5	36.2	1.6	50.7	74.8	-0.2	N/A	(HES Installed)
GIW-09	05/02/17	12.4	30.6	1.8	55.2	74.5	-0.3	N/A	(HES Installed)
GIW-09	05/11/17	2.8	34.4	3.2	59.6	70.0	-0.3	N/A	(HES Installed)
GIW-09	05/15/17	2.6	25.2	3.7	68.5	95.1	-0.2	N/A	(HES Installed)
GIW-09	05/23/17	8.2	32.6	1.0	58.2	74.5	-0.2	N/A	(HES Installed)
GIW-09	05/30/17	3.9	29.4	1.7	65.0	92.1	-0.3	N/A	(HES Installed)
GIW-09	06/06/17	3.0	24.2	3.6	69.2	92.7	-0.3	N/A	(HES Installed)
GIW-09	06/06/17	2.6	25.0	3.5	68.9	92.9	-0.3	N/A	(HES Installed)
GIW-09	06/12/17	10.2	33.3	0.6	55.9	100.8	-0.4	N/A	(HES Installed)
GIW-09	06/19/17	5.0	27.3	3.7	64.0	90.9	-0.6	N/A	(HES Installed)
GIW-09	06/26/17	9.7	28.7	2.1	59.5	96.7	-0.7	N/A	(HES Installed)
GIW-09	07/06/17	4.3	24.1	3.6	68.0	108.2	-1.2	N/A	(HES Installed)
GIW-09	07/12/17	11.0	30.0	0.3	58.7	100.6	-1.0	N/A	(HES Installed)
GIW-09	07/12/17	11.0	27.9	0.5	60.6	98.4	-0.9	N/A	(HES Installed)
GIW-09	07/17/17	6.6	34.4	1.8	57.2	103.6	-0.7	N/A	(HES Installed)
GIW-09	07/24/17	8.9	32.3	1.9	56.9	100.1	-0.6	N/A	(HES Installed)
GIW-09	07/31/17	20.4	43.0	0.0	36.6	95.5	-0.2	N/A	(HES Installed)
GIW-09	08/07/17	25.1	43.5	0.0	31.4	79.1	-0.3	N/A	(HES Installed)
GIW-09	08/09/17	28.3	41.3	0.0	30.4	94.8	-0.3	N/A	(HES Installed)
GIW-09	08/09/17	28.1	36.9	0.0	35.0	96.5	-0.3	N/A	(HES Installed)
GIW-09	08/15/17	28.3	51.2	0.0	20.5	101.6	0.2	N/A	(HES Installed)
GIW-09	08/15/17	29.1	50.5	0.0	20.4	103.0	0.1	N/A	(HES Installed)
GIW-09	08/23/17	15.7	35.9	1.0	47.4	91.0	-2.6	N/A	(HES Installed)
GIW-09	08/29/17	9.4	29.1	2.3	59.2	101.4	-3.5	N/A	(HES Installed)

# GIW-9 Wellhead Temperatures

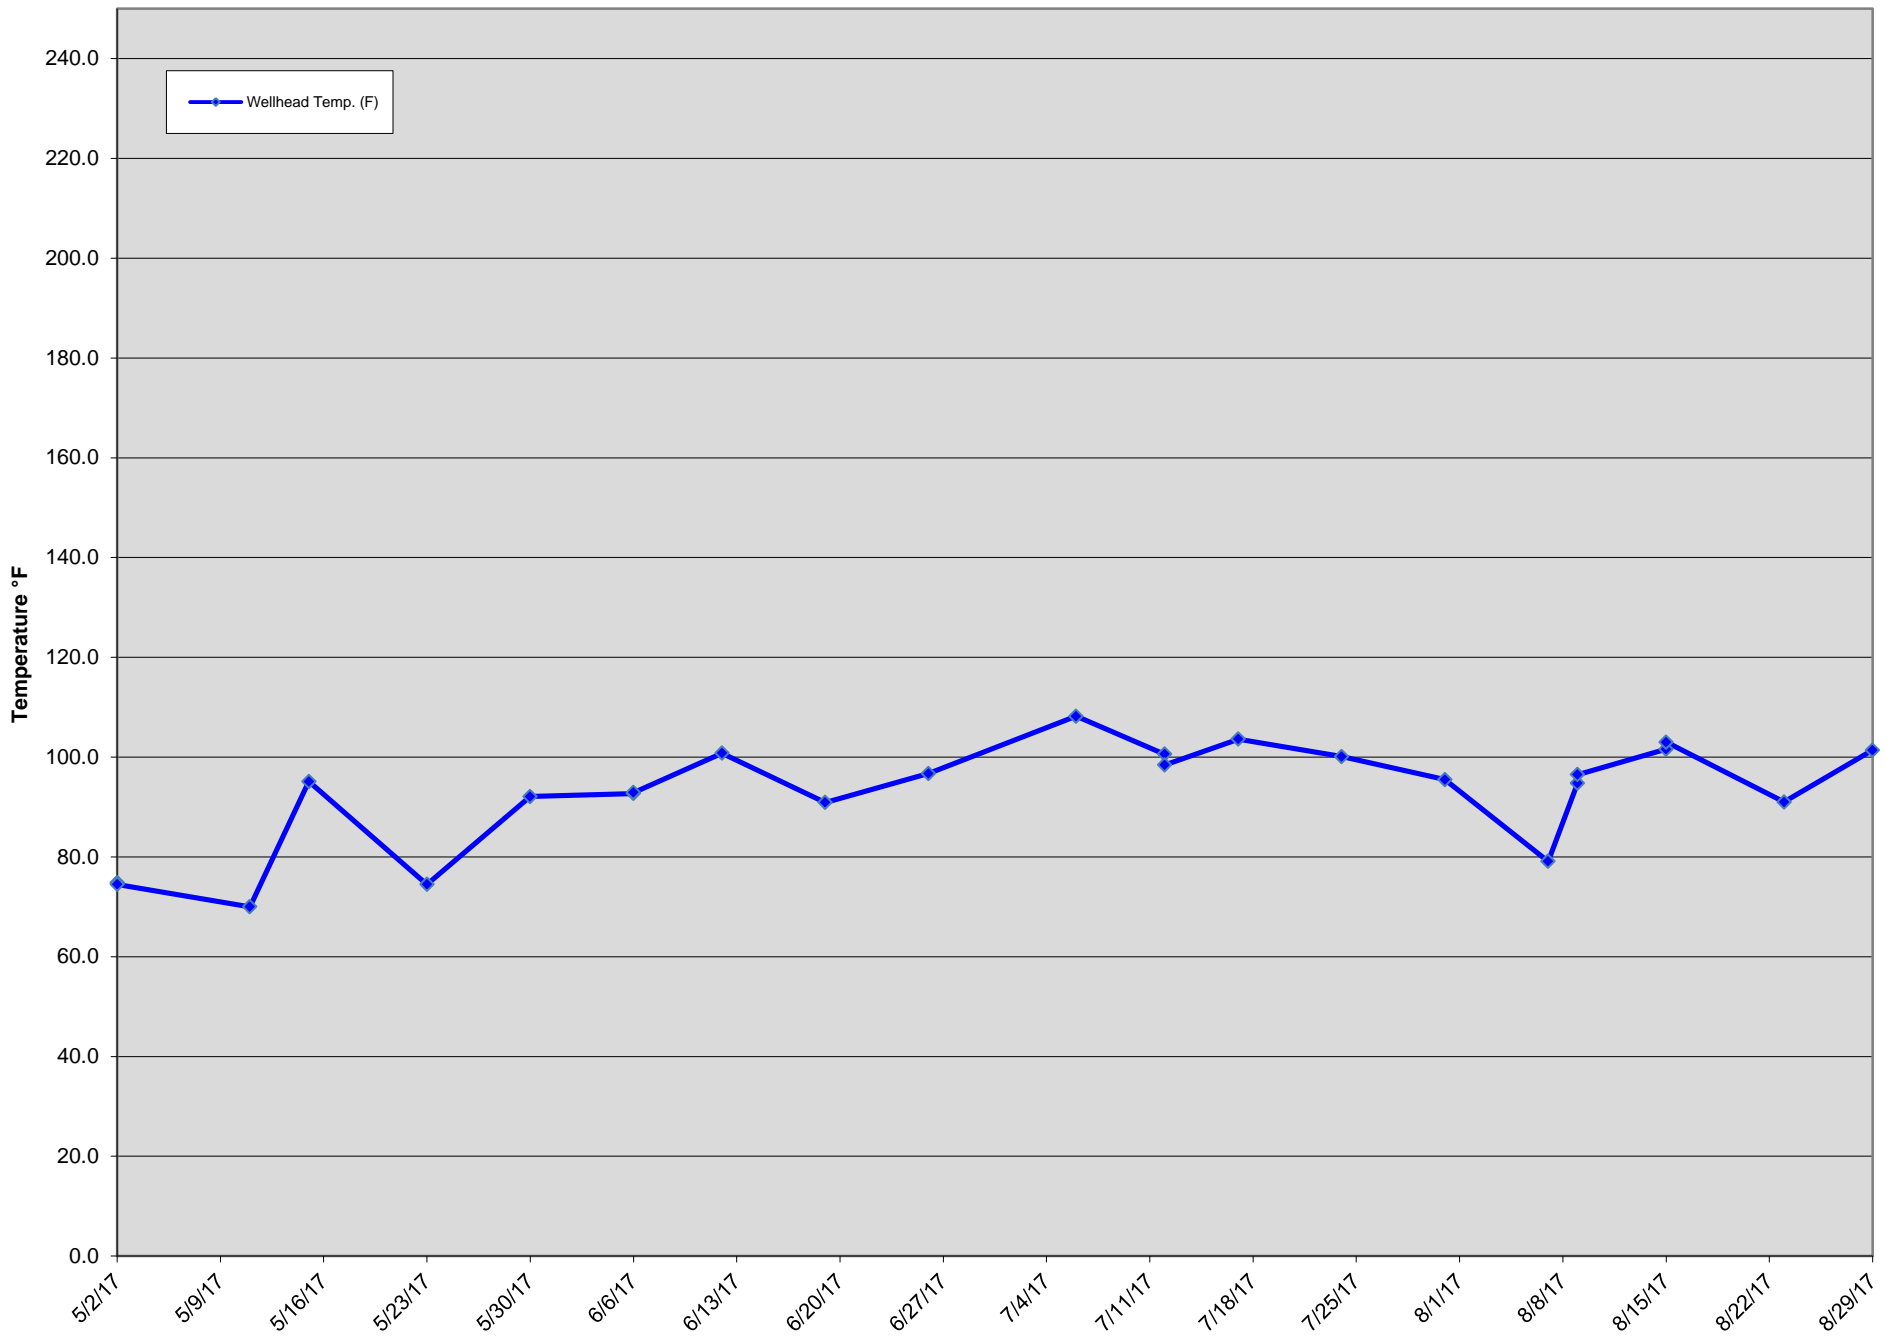


GIW ID#	Reading Date	CH4 (% Vol.)	CO2 (% Vol.)	Oxygen (% Vol.)	Balance (% Vol.)	Wellhead Temp. (F)	Pressure (In W.C.)	Pump Operational (Y/N)	Comments
GIW-10	05/02/17	5.3	48.9	0.0	45.8	60.0	-0.1	N/A	(HES Installed)
GIW-10	05/02/17	4.6	52.3	0.0	43.1	60.7	-0.1	N/A	(HES Installed)
GIW-10	05/11/17	2.3	52.6	0.0	45.1	71.1	-0.5	N/A	(HES Installed)
GIW-10	05/15/17	2.8	52.4	0.0	44.8	88.4	-0.3	N/A	(HES Installed)
GIW-10	05/23/17	3.6	52.4	0.0	44.0	76.6	-0.5	N/A	(HES Installed)
GIW-10	05/30/17	4.1	53.4	0.0	42.5	90.1	-0.7	N/A	(HES Installed)
GIW-10	06/05/17	5.3	50.8	0.0	43.9	108.0	-0.6	N/A	(HES Installed)
GIW-10	06/05/17	6.0	53.3	0.0	40.7	109.0	-0.6	N/A	(HES Installed)
GIW-10	06/12/17	3.8	50.4	0.0	45.8	96.5	-0.9	N/A	(HES Installed)
GIW-10	06/19/17	4.7	51.1	0.0	44.2	91.1	-1.3	N/A	(HES Installed)
GIW-10	06/26/17	4.2	53.3	0.0	42.5	90.5	-1.5	N/A	(HES Installed)
GIW-10	07/05/17	3.9	52.1	0.0	44.0	87.1	-1.9	N/A	(HES Installed)
GIW-10	07/12/17	2.8	52.8	0.0	44.4	91.7	-1.5	N/A	(HES Installed)
GIW-10	07/12/17	2.6	51.4	0.0	46.0	91.7	-1.5	N/A	(HES Installed)
GIW-10	07/17/17	3.3	53.6	0.0	43.1	96.2	-0.9	N/A	(HES Installed)
GIW-10	07/24/17	2.9	54.6	0.0	42.5	92.7	-0.5	N/A	(HES Installed)
GIW-10	07/31/17	7.2	54.1	0.0	38.7	96.5	-0.4	N/A	(HES Installed)
GIW-10	08/07/17	7.3	54.3	0.0	38.4	77.7	-0.2	N/A	(HES Installed)
GIW-10	08/09/17	7.3	50.3	0.0	42.4	79.6	-0.4	N/A	(HES Installed)
GIW-10	08/09/17	7.0	46.1	0.0	46.9	80.9	-0.4	N/A	(HES Installed)
GIW-10	08/15/17	5.5	52.1	0.0	42.4	104.9	0.5	N/A	(HES Installed)
GIW-10	08/15/17	5.5	54.1	0.0	40.4	106.3	0.0	N/A	(HES Installed)
GIW-10	08/22/17	12.1	52.7	0.0	35.2	90.8	-11.6	N/A	(HES Installed)
GIW-10	08/22/17	12.3	53.0	0.0	34.7	91.2	-6.3	N/A	(HES Installed)
GIW-10	08/29/17	10.1	50.3	0.0	39.6	94.3	-4.1	N/A	(HES Installed)

# GIW-10 Wellhead Temperatures

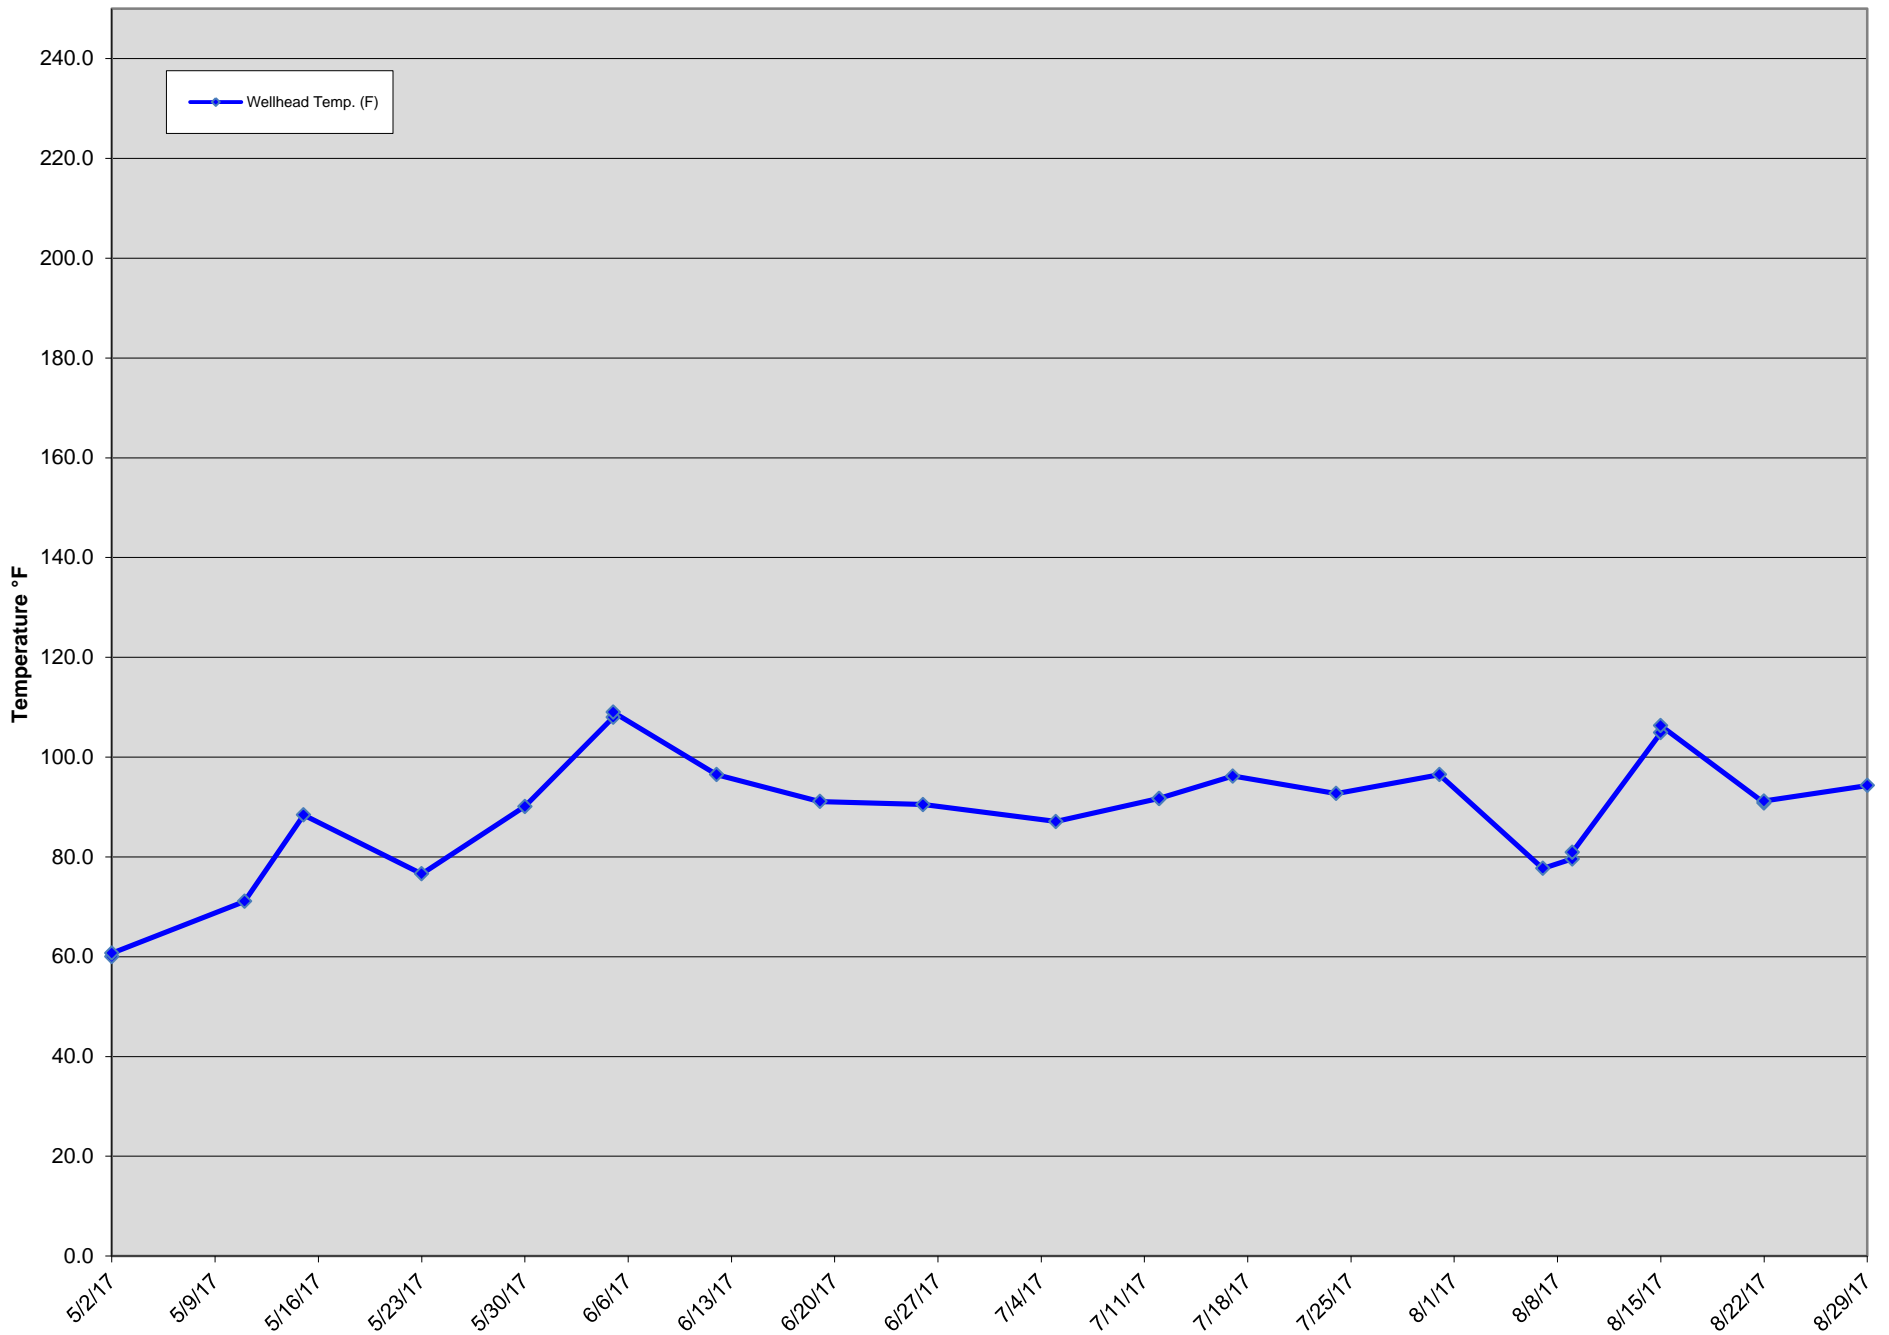


GIW ID#	Reading Date	CH4 (% Vol.)	CO2 (% Vol.)	Oxygen (% Vol.)	Balance (% Vol.)	Wellhead Temp. (F)	Pressure (In W.C.)	Pump Operational (Y/N)	Comments
GIW-11	05/02/17	2.3	58.1	0.0	39.6	71.1	-0.4	N/A	(HES Installed)
GIW-11	05/02/17	2.1	59.8	0.0	38.1	71.4	-0.4	N/A	(HES Installed)
GIW-11	05/11/17	3.1	57.7	0.0	39.2	71.6	-0.5	N/A	(HES Installed)
GIW-11	05/15/17	2.5	56.5	0.0	41.0	92.9	-0.3	N/A	(HES Installed)
GIW-11	05/23/17	2.3	57.8	0.0	39.9	74.1	-0.3	N/A	(HES Installed)
GIW-11	05/30/17	2.1	60.5	0.0	37.4	92.2	-0.3	N/A	(HES Installed)
GIW-11	06/05/17	1.9	59.4	0.0	38.7	98.4	-0.2	N/A	(HES Installed)
GIW-11	06/05/17	2.1	59.7	0.0	38.2	98.2	-0.2	N/A	(HES Installed)
GIW-11	06/12/17	4.8	58.5	0.0	36.7	100.1	-0.3	N/A	(HES Installed)
GIW-11	06/19/17	6.7	57.7	0.0	35.6	91.5	-0.5	N/A	(HES Installed)
GIW-11	06/26/17	7.4	58.2	0.0	34.4	94.9	-0.4	N/A	(HES Installed)
GIW-11	07/05/17	7.9	57.5	0.0	34.6	86.8	-0.6	N/A	(HES Installed)
GIW-11	07/12/17	7.8	58.2	0.0	34.0	92.9	-0.6	N/A	(HES Installed)
GIW-11	07/12/17	7.1	57.2	0.0	35.7	93.6	-0.7	N/A	(HES Installed)
GIW-11	07/17/17	8.6	56.7	0.0	34.7	97.9	-0.5	N/A	(HES Installed)
GIW-11	07/24/17	9.1	58.7	0.0	32.2	97.9	-0.4	N/A	(HES Installed)
GIW-11	07/31/17	11.4	55.9	0.0	32.7	97.7	-0.4	N/A	(HES Installed)
GIW-11	08/07/17	10.4	56.8	0.0	32.8	78.9	-0.4	N/A	(HES Installed)
GIW-11	08/08/17	10.3	54.7	0.0	35.0	94.3	-0.4	N/A	(HES Installed)
GIW-11	08/08/17	9.5	52.1	0.0	38.4	94.1	-0.4	N/A	(HES Installed)
GIW-11	08/15/17	10.4	54.2	0.0	35.4	106.4	-0.3	N/A	(HES Installed)
GIW-11	08/21/17	19.3	52.0	0.0	28.7	102.8	-1.4	N/A	(HES Installed)
GIW-11	08/29/17	18.2	50.6	0.0	31.2	98.4	-1.2	N/A	(HES Installed)

# GIW-11 Wellhead Temperatures

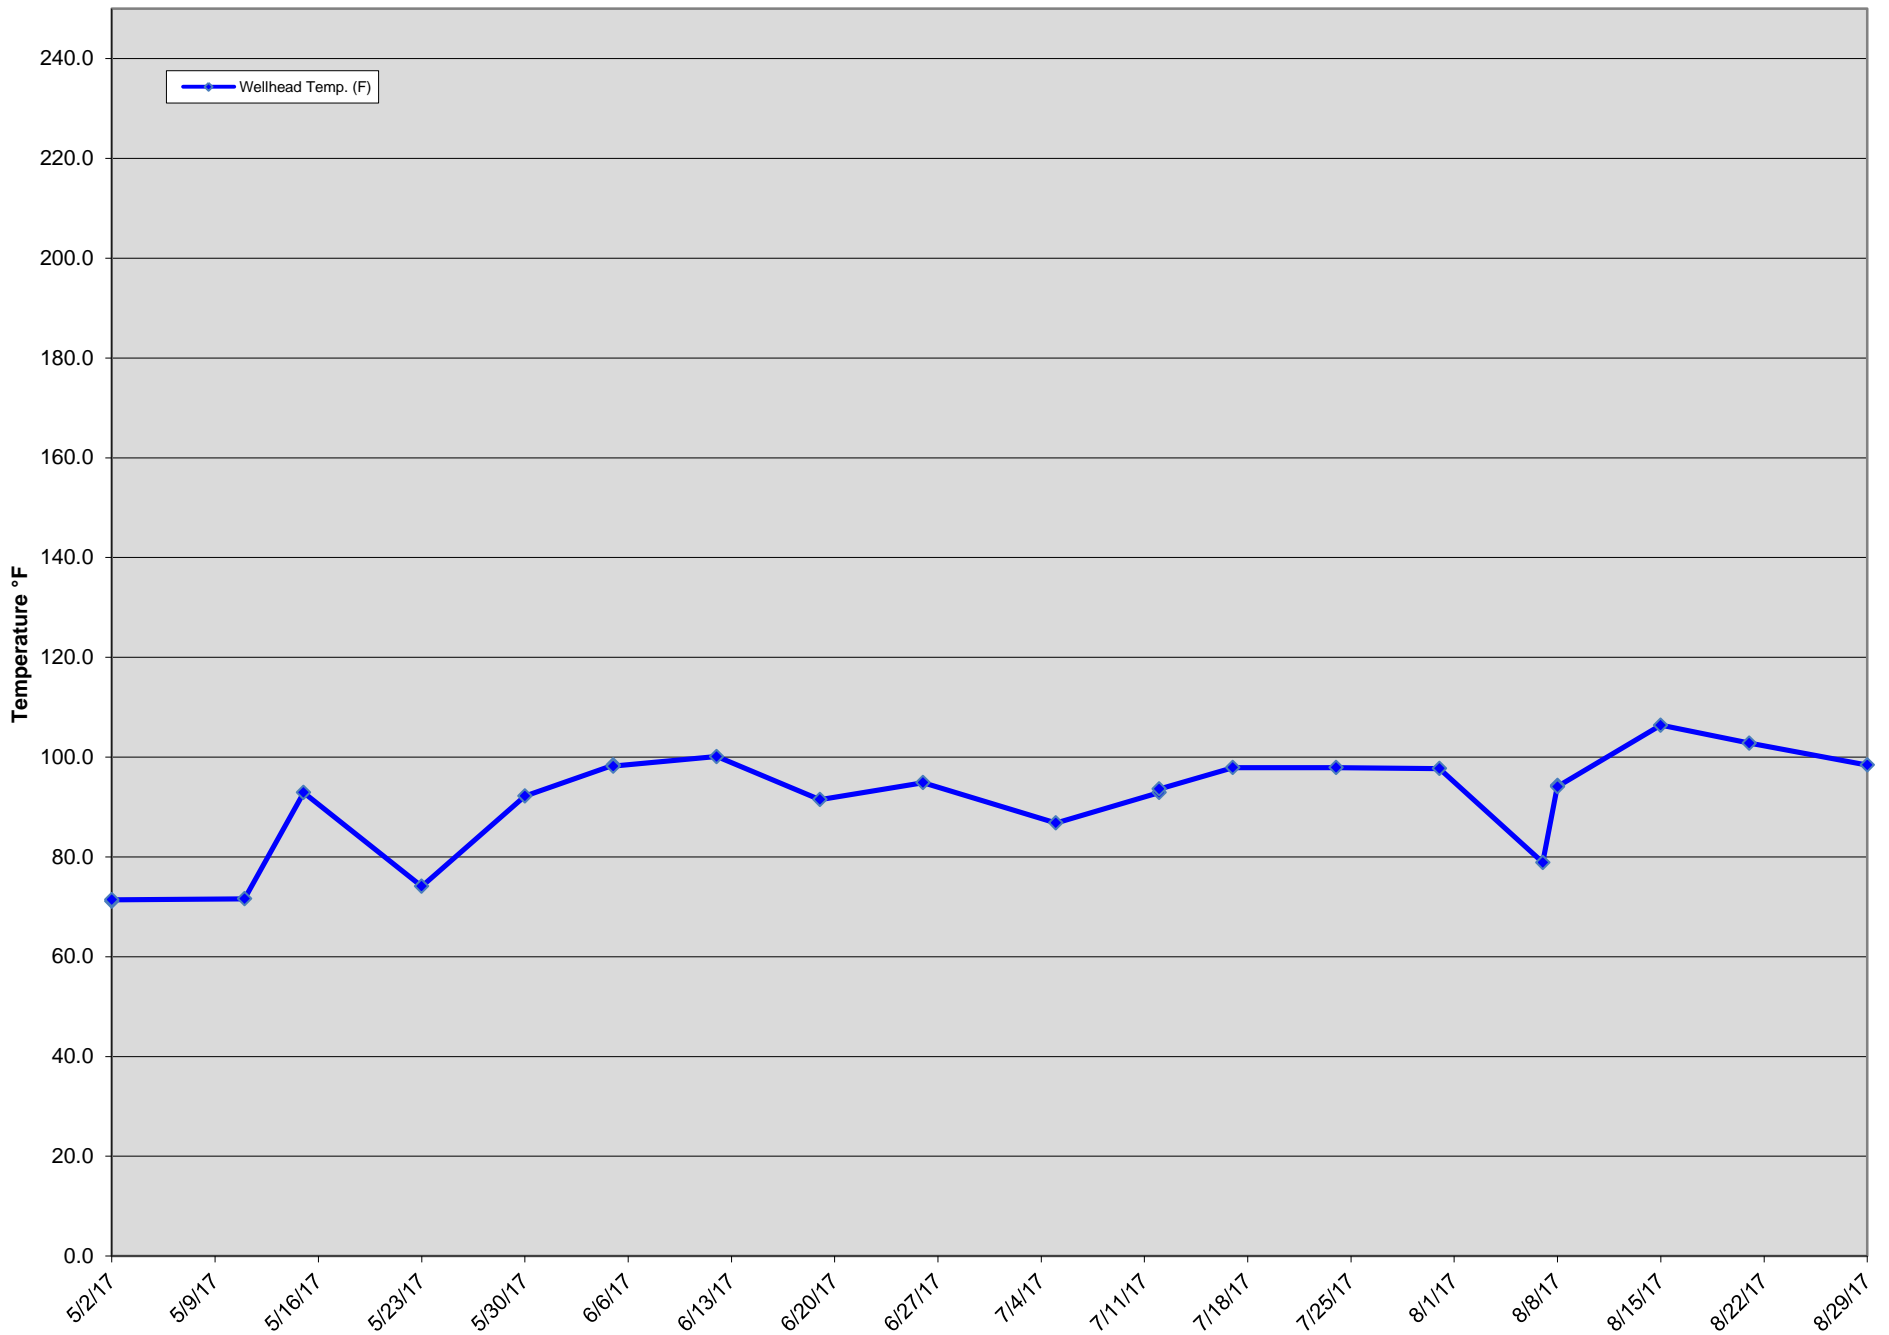

GIW ID#	Reading Date	CH4 (% Vol.)	CO2 (% Vol.)	Oxygen (% Vol.)	Balance (% Vol.)	Wellhead Temp. (F)	Pressure (In W.C.)	Pump Operational (Y/N)	Comments
GIW-12	05/02/17	11.2	44.3	5.2	39.3	71.2	-0.2	N/A	(HES Installed)
GIW-12	05/02/17	11.7	38.8	5.5	44.0	73.0	-0.2	N/A	(HES Installed)
GIW-12	05/11/17	12.1	44.2	5.0	38.7	70.9	-0.3	N/A	(HES Installed)
GIW-12	05/11/17	12.2	43.1	5.0	39.7	70.7	-0.3	N/A	(HES Installed)
GIW-12	05/15/17	12.9	44.8	4.5	37.8	91.7	-0.2	N/A	(HES Installed)
GIW-12	05/23/17	12.1	45.7	4.6	37.6	73.6	-0.2	N/A	(HES Installed)
GIW-12	05/30/17	13.1	43.3	4.9	38.7	89.8	-0.2	N/A	(HES Installed)
GIW-12	06/05/17	11.7	45.3	4.2	38.8	97.0	-0.2	N/A	(HES Installed)
GIW-12	06/05/17	12.1	44.0	4.3	39.6	99.4	-0.2	N/A	(HES Installed)
GIW-12	06/12/17	11.9	43.3	4.9	39.9	98.6	-0.2	N/A	(HES Installed)
GIW-12	06/19/17	12.7	41.3	6.3	39.7	92.1	-0.3	N/A	(HES Installed)
GIW-12	06/19/17	13.2	39.0	6.4	41.4	91.8	-0.3	N/A	(HES Installed)
GIW-12	06/26/17	13.8	41.2	5.0	40.0	94.2	-0.2	N/A	(HES Installed)
GIW-12	06/27/17	14.1	40.5	3.9	41.5	92.2	-0.3	N/A	(HES Installed)
GIW-12	07/05/17	13.9	38.6	3.9	43.6	87.6	-0.3	N/A	(HES Installed)
GIW-12	07/11/17	13.5	41.3	4.5	40.7	105.7	-0.3	N/A	(HES Installed)
GIW-12	07/11/17	13.4	39.3	4.4	42.9	103.3	-0.2	N/A	(HES Installed)
GIW-12	07/17/17	13.8	44.2	4.5	37.5	96.9	-0.2	N/A	(HES Installed)
GIW-12	07/24/17	13.6	44.9	4.2	37.3	96.1	-0.2	N/A	(HES Installed)
GIW-12	07/31/17	15.7	46.7	2.5	35.1	98.2	-0.2	N/A	(HES Installed)
GIW-12	08/07/17	14.7	46.6	3.4	35.3	79.1	-0.2	N/A	(HES Installed)
GIW-12	08/08/17	15.3	47.0	2.9	34.8	92.0	-0.2	N/A	(HES Installed)
GIW-12	08/08/17	15.1	45.4	3.0	36.5	92.3	-0.2	N/A	(HES Installed)
GIW-12	08/15/17	16.0	47.3	2.6	34.1	102.4	-0.2	N/A	(HES Installed)
GIW-12	08/21/17	14.8	37.0	6.6	41.6	102.1	-0.4	N/A	(HES Installed)
GIW-12	08/21/17	15.7	34.6	6.8	42.9	102.1	-0.4	N/A	(HES Installed)
GIW-12	08/29/17	14.8	36.5	6.1	42.6	93.1	-0.3	N/A	(HES Installed)
GIW-12	08/29/17	15.3	34.9	6.2	43.6	95.0	-0.2	N/A	(HES Installed)

# GIW-12 Wellhead Temperatures

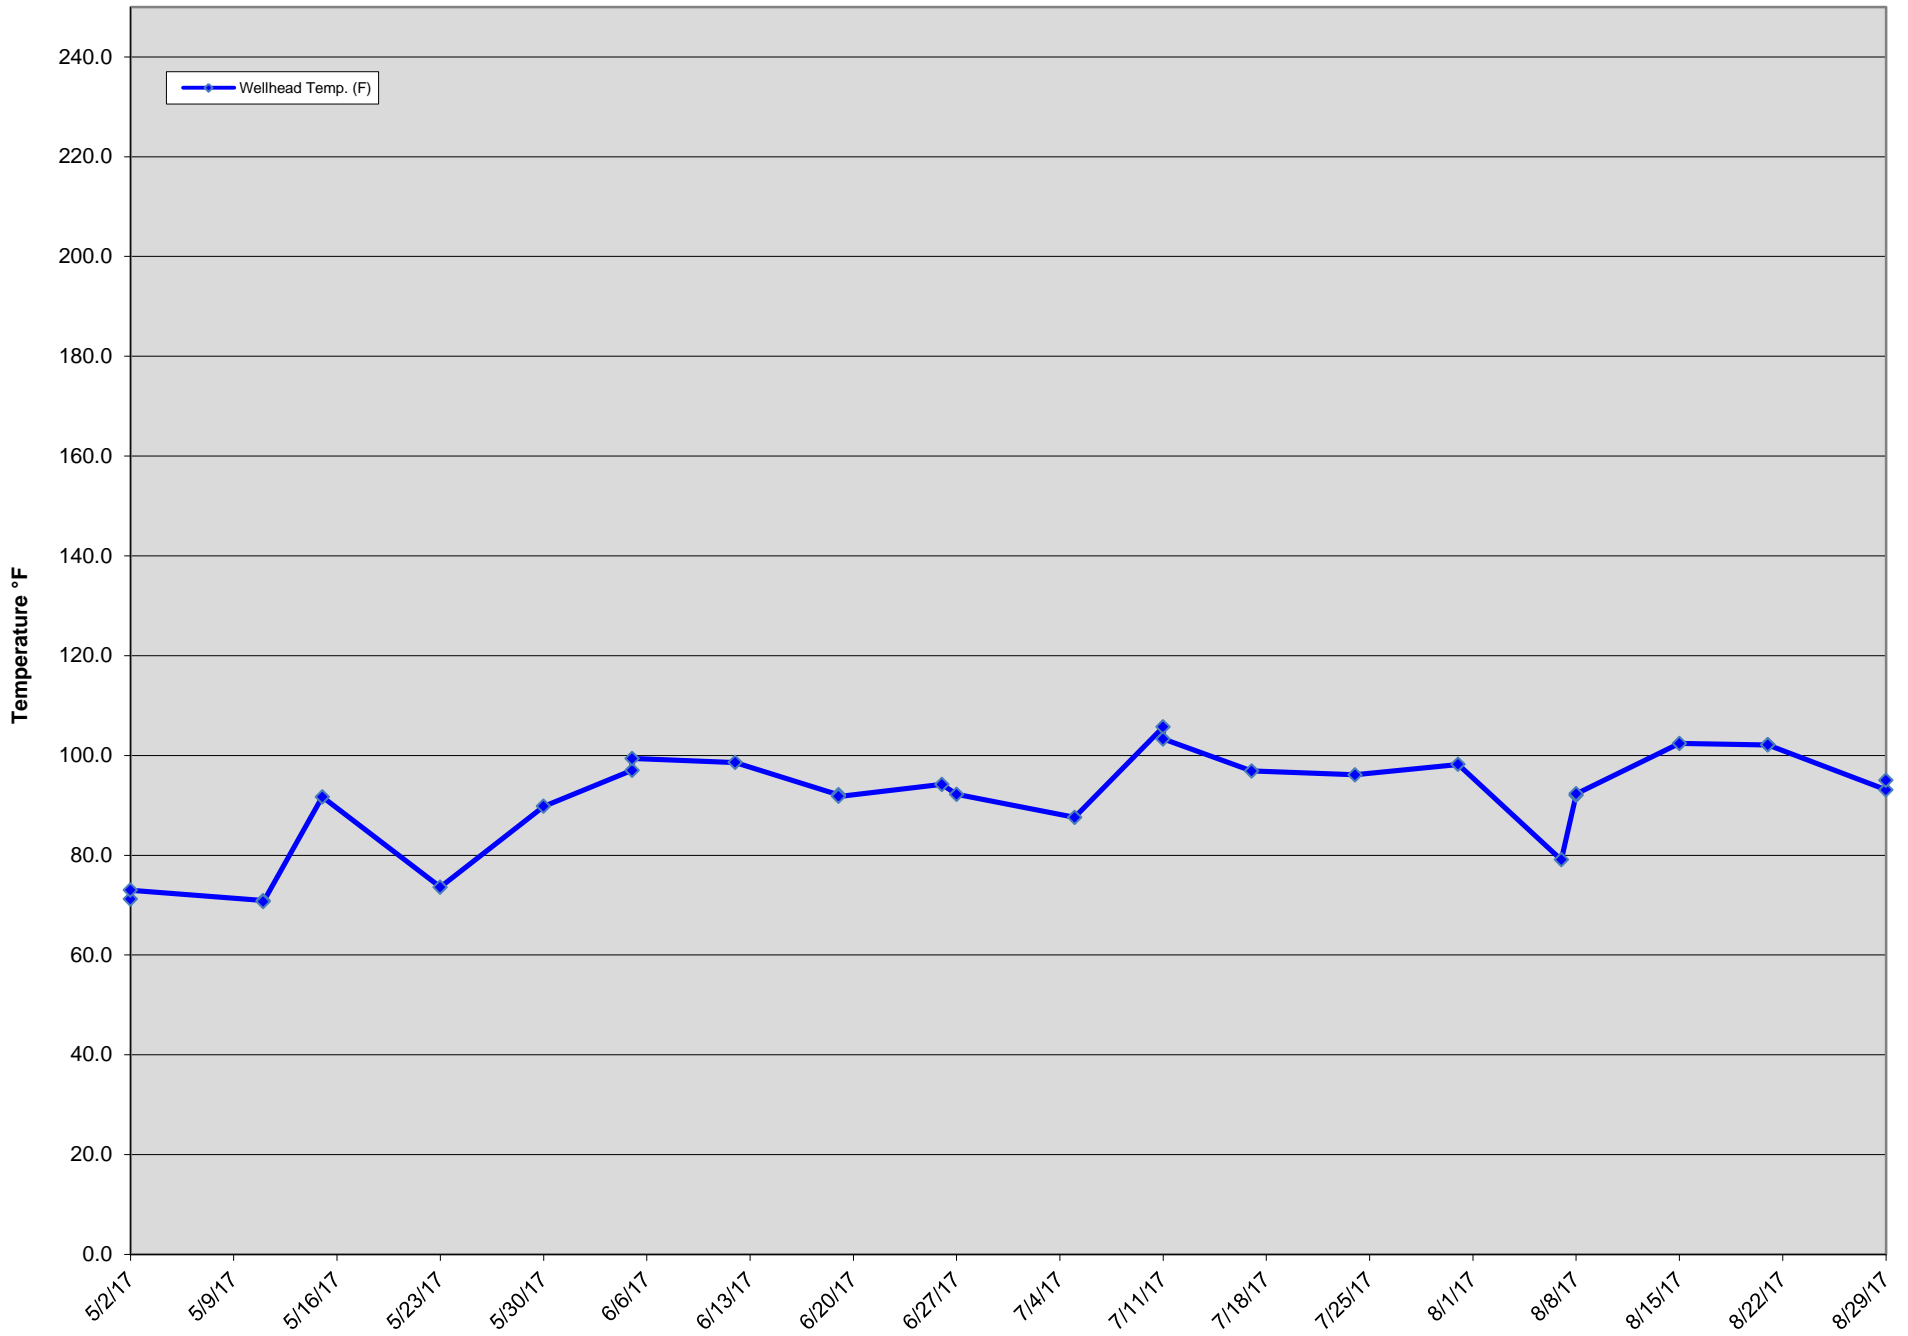



GIW ID#	Reading Date	CH4 (% Vol.)	CO2 (% Vol.)	Oxygen (% Vol.)	Balance (% Vol.)	Wellhead Temp. (F)	Pressure (In W.C.)	Pump Operational (Y/N)	Comments
GIW-13	05/02/17	11.3	60.0	0.0	28.7	71.6	-0.7	N/A	(HES Installed)
GIW-13	05/02/17	10.0	60.2	0.0	29.8	72.8	-0.7	N/A	(HES Installed)
GIW-13	05/11/17	10.2	62.6	0.0	27.2	71.4	-0.7	N/A	(HES Installed)
GIW-13	05/15/17	10.0	59.3	0.0	30.7	90.7	-0.5	N/A	(HES Installed)
GIW-13	05/23/17	9.6	62.2	0.0	28.2	74.3	-0.6	N/A	(HES Installed)
GIW-13	05/30/17	10.8	59.1	0.0	30.1	88.5	-0.8	N/A	(HES Installed)
GIW-13	06/05/17	9.8	61.0	0.0	29.2	100.1	-0.7	N/A	(HES Installed)
GIW-13	06/05/17	10.4	61.2	0.0	28.4	98.4	-0.7	N/A	(HES Installed)
GIW-13	06/12/17	9.5	62.6	0.0	27.9	99.1	-0.8	N/A	(HES Installed)
GIW-13	06/19/17	11.1	61.5	0.1	27.3	91.7	-0.8	N/A	(HES Installed)
GIW-13	06/26/17	11.6	62.8	0.0	25.6	94.0	-0.7	N/A	(HES Installed)
GIW-13	07/05/17	11.7	62.6	0.0	25.7	90.1	-0.7	N/A	(HES Installed)
GIW-13	07/11/17	11.6	59.5	0.1	28.8	108.5	-0.6	N/A	(HES Installed)
GIW-13	07/11/17	10.0	57.7	0.0	32.3	108.8	-0.6	N/A	(HES Installed)
GIW-13	07/17/17	11.7	61.2	0.0	27.1	96.2	-0.7	N/A	(HES Installed)
GIW-13	07/24/17	12.5	62.3	0.1	25.1	94.6	-0.9	N/A	(HES Installed)
GIW-13	07/31/17	12.8	55.2	0.0	32.0	97.4	-0.9	N/A	(HES Installed)
GIW-13	08/07/17	11.9	59.9	0.0	28.2	79.8	-0.9	N/A	(HES Installed)
GIW-13	08/08/17	12.3	58.8	0.0	28.9	92.2	-0.9	N/A	(HES Installed)
GIW-13	08/08/17	11.2	58.9	0.0	29.9	90.1	-0.9	N/A	(HES Installed)
GIW-13	08/15/17	11.7	59.7	0.0	28.6	99.6	-0.8	N/A	(HES Installed)
GIW-13	08/21/17	15.7	56.9	0.0	27.4	101.1	-1.3	N/A	(HES Installed)
GIW-13	08/29/17	14.1	62.1	0.0	23.8	88.9	-0.9	N/A	(HES Installed)

# GIW-13 Wellhead Temperatures

